

Troubleshooting SAR Crashes on the PA-A3

Document ID: 10501

- Introduction**
- Prerequisites**
 - Requirements
 - Components Used
 - Conventions
- PA-A3 Architecture**
- Crash Types**
- Known Issues**
- Troubleshooting**
- Related Information**

Introduction

In rare circumstances, the main processor on the PA-A3 ATM port adapters may crash and print to the console a "crashdump" with output similar to this:

```
%ATMPA-3-SARCRASH: ATM1/0: SAR1 Chip Crashdump:
%ATMPA-7-REG00: status 0xF040FF00, cause 0x00008018, epc 0xBFC002EC
%ATMPA-7-REG01: ccc 0x03E7B620, eepc 0x00000000, apu_status 0x00015010
%ATMPA-7-REG02: edma_src 0x4B050964, edma_dest 0xA0820968, edma_cntl 0x00280000
%ATMPA-7-REG03: edma_count 0x060001E0, edma_status 0x00000000, aci_cntrl 0x44400540
%ATMPA-7-CWREG00: zero 0xBABEBABE, at 0x10000000, v0 0xBFC002EC, v1 0xF040FF00
%ATMPA-7-CWREG01: a0 0xB8000804, a1 0x08000000, a2 0x00000190, a3 0x10338530
%ATMPA-7-CWREG02: t0 0x8066B590, t1 0x00015010, t2 0x4B050964, t3 0xA0820968
%ATMPA-7-CWREG03: t4 0x060001E0, t5 0x00280000, t6 0x00000000, t7 0x44400540
%ATMPA-7-CWREG04: s0 0xC0000000, s1 0x00008001, s2 0x00000000, s3 0x00000000
%ATMPA-7-CWREG05: s4 0xB8100000, s5 0x4B01EA44, s6 0x88800000, s7 0x008002F4
%ATMPA-7-CWREG06: t8 0xF557C400, t9 0xB8000000, k0 0x00000000, k1 0xAB0DE6D4
%ATMPA-7-CWREG07: gp 0x8080309C, sp 0x8080398C, fp/s8 0xCCCCCCCD, ra 0x80801440
%ATMPA-7-MISC0: 00 0x00008001, 01 0x00000000, 02 0x00000000, 03 0xB8100000
%ATMPA-7-MISC1: 04 0x4B01EA44, 05 0x88800000, 06 0x008002F4, 07 0x00000000
%ATMPA-7-MISC2: 08 0x00000000, 09 0x00000000, 10 0x00000000, 11 0x00000000
%ATMPA-7-MISC3: 12 0x00000000, 13 0x00000000, 14 0x00000000, 15 0x00000000
```

This document explains how to troubleshoot segmentation and reassembly (SAR) crashes on the PA-A3.

Prerequisites

Requirements

There are no specific requirements for this document.

Components Used

This document is not restricted to specific software and hardware versions.

Conventions

For more information on document conventions, refer to the Cisco Technical Tips Conventions.

PA-A3 Architecture

The PA-A3 uses a chip called LSI ATMizer II to provide SAR as well as other key functions. The name of the SAR is displayed in the output of the **show controllers atm** command.

```
router# show controller atm 3/0
Interface ATM3/0 is up
Hardware is ENHANCED ATM PA - DS3 (45Mbps)
Lane client mac address is 0030.7b1e.9054
Framer is PMC PM7345 S/UNI-PDH, SAR is LSI ATMIZER II
Firmware rev: G119, Framer rev: 1, ATMIZER II rev: 3
```

!--- Output suppressed.

The ATMizer microcode (firmware) is an image that provides SAR-specific software instructions. The Versatile Interface Processor (VIP) IOS® on the Cisco 7500 platform and the system IOS on the 7200 platform contain the SAR firmware, which is downloaded to the SAR when it comes out of reset. Use the following commands depending on the platform used to display the currently loaded and running microcode version for your ATM interface:

- 7200 series – **show controller atm** (see sample output above)
- 7500 series – **show controller vip slot# tech**

The PA-A3 uses two SARs to provide the processing power necessary to handle and transmit simultaneously for a high-speed OC-3 and OC-12 link.


Note: A single SAR is sufficient for a DS-3/E-3, but the PA-A3-T3 also uses two SARs for consistency.

The SAR crashdump indicates which SAR is experiencing the problem.

```
%ATMPA-3-SARCRASH: ATM1/0: SAR1 Chip Crashdump:
SAR0 = receive
SAR1 = transmit
```

The PA-A3 is supported in 7xxx router series. The 7200 and 7500 routers use peripheral component interconnect (PCI) buses as a data path between the port adapters and "host" memory. Host memory is the local SRAM on the VIP or the SRAM on the Network Processing Engine (NPE) of the 7200.

This diagram illustrates the architecture of the VIP2 and the location of the PCI buses:

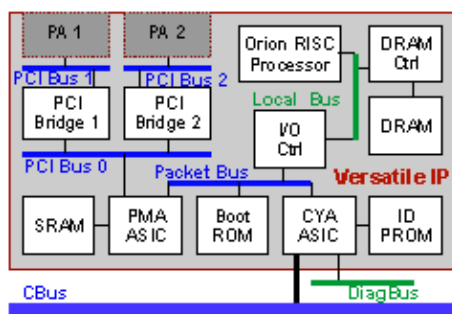

The SAR provides connectivity to the PCI bus for transfers into packet memory. It also provides SAR functionality for ATM cell processing and a PHY or physical interface to the external wire.

Crash Types

We can classify SAR crashes into several categories based on the cause of the crash. Anytime a non-recoverable error is found, the SAR crashes. These errors can be the result of software or hardware. To determine the cause, consult the cause register that appears in the second line of the crashdump output. The Exception-Code is recorded in bits two through six of the cause register value. Start from the right-most bit as bit zero. For example:

```
%ATMPA-7-REG00: status 0xF040FF10, cause 0x00004018, epc 0x80802F68
```

1. Translate the hexadecimal value of 0x00004018 into binary. Note that each hex value represents four bits. The binary equivalent in our example is 4 = 0100, 0 = 0000, 1 = 0001, and 8 = 1000, then 0x00004018 = 0100 0000 **0001 1000**.
2. Locate bits two through six by counting from right to left. In our example, bits two through six equate to 00110
3. Convert these five bits back into hexadecimal. In our example, 00110 converts to 0x06.
4. Consult the exception code table. In the example, the SAR crashed in response to a secondary bus error exception.

Exception Code	Description	Likely Cause
0x00	Interrupt	Interrupt condition asserted.
0x01	TLB modification exception	
0x02	TLB exception (load/fetch)	
0x03	TLB exception (store)	
0x04	Address error (load/fetch)	Unaligned address (software).
0x05	Address error (store)	Unaligned address (software).
0x06	Bus error	Bus timeout, parity errors, etc. (hardware).
0x07	Reserved	
0x08	Syscall	Attempt to execute SYSCALL instruction.
0x09	Breakpoint	Attempt to execute BREAK instruction.
0x0a	Reserved instruction	Attempt to execute invalid instruction.
0x0b	Coprocessor unusable	Attempt to execute on unusable coprocessor.
0x0c	Arithmetic overflow	
0x0d	Trap	

0x0e	Reserved	
0x0f	Floating-point	Attempt to access non-existent FPU.
0x10-1f	Reserved	

When any value cause register has bit 15 set to one, the cause of the SAR crash is a PCI abort or parity error due to hardware. Specifically, the cause register will appear in the crashdump as:

```
cause 0x00008000
```

Troubleshoot this cause value by replacing the ATM port adapter. If the problem persists, replace the versatile interface processor (VIP) if using a 7500 series router, or the network processing engine (NPE) / network services engine (NSE) if using a 7200 or 7400 series router.

Known Issues

Cisco Bug ID CSCdr09895 prevents repeated crashdumps from being printed to the console since only the first crashdump is relevant to troubleshooting. The following Bug IDs resolve rare conditions that cause SAR crashes. Please use the Bug Toolkit (registered customers only) to determine if your Cisco IOS Software release is affected by these Bug IDs.

Cisco Bug ID	Explanation
CSCdp62791	Prevents SAR1 crashes by not sending packets to the SAR on an unconfigured VC or sending packets to the SAR with invalid encapsulation. Note: Although it reports a different symptom, CSCdp01166 dupes to and is fixed via CSCdp62791.
CSCdp42529	Prevents SAR1 crashes caused by receiving a cell on a VPI/VCI pair that does not exist on the transmit SAR. This problem can occur when a large number of SVCs are being created or torn down, so the transmit SAR misses a command interrupt from the host CPU on the VIP or NPE. When this occurs, a VC is defined on the receive SAR only, and the transmit SAR crashes if an OAM loopback or resource management cell is received on the undefined VPI/VCI pair.
CSCdr09895	Prevents SAR0 crashes that occur when, with heavy transit traffic, the SAR tries to access an illegal address in secondary memory, where packets waiting for segmentation and reassembly are stored. This condition is called a bus error.
CSCdp64588	Prevents a router crash due to repeated SAR (0 or 1) crashes. When the SAR crashes, the PCI host-driver (which provides an interface between the PA-A3 and the PCI bus in the router) tries to start the PA again. If there are repeated SAR

crashes and the PA does not respond to the host-driver, the host-driver tries to shutdown (power-down) the PA, and the PA is switched off. In some cases, if the SAR has crashed and the host-driver has already cleared the memory related to this PA, the router crashes due to bus-error.

Troubleshooting

The following points summarize how to troubleshoot SAR crashes on a PA-A3 ATM port adapter:

- Determine whether SAR0 (receive SAR) or SAR1 (transmit SAR) crashed. The first line of the crashdump will tell you.

```
%ATMPA-3-SARCRASH: ATM1/0: SAR1 Chip Crashdump
```

- Use the exception code table to decode the cause register value in the crashdump output.
- If the cause register is a value with bit 15 set to one, replace the hardware.
- If the cause register is any other value, collect the following information for Cisco Technical Support:
 - ◆ crashdump output
 - ◆ **show controller atm** (7200 series)
 - ◆ **show controller vip slot# tech** (7500 series)
 - ◆ **show tech-support**
- Give serious consideration to installing the most recent maintenance release of the Cisco IOS Software train that you are currently running.

Related Information

- **Troubleshooting Input Queue Drops and Output Queue Drops**
- **Troubleshooting Output Drops on ATM Router Interfaces**
- **Cisco ATM Port Adapter**
- **ATM Technology Support**
- **ATM Acronyms**
- **Technical Support – Cisco Systems**

[Contacts & Feedback](#) | [Help](#) | [Site Map](#)

© 2008 – 2009 Cisco Systems, Inc. All rights reserved. [Terms & Conditions](#) | [Privacy Statement](#) | [Cookie Policy](#) | [Trademarks of Cisco Systems, Inc.](#)

Updated: Nov 15, 2007

Document ID: 10501
