

# What Causes LOGDATA Errors on CIP and CPA Routers?

Document ID: 12338

---

**Introduction**

**Prerequisites**

Requirements

Components Used

Conventions

**LOGDATA Error Message**

**Troubleshooting**

**NetPro Discussion Forums – Featured Conversations**

**Related Information**

---

## Introduction

This document discusses the causes of LOGDATA error messages on a Channel Interface Processor (CIP) or a Channel Port Adapter (ECPA) router. It also discusses the steps to take to remedy this condition.

In the majority of cases, LOGDATA error messages are due to hardware problems, specifically cables, the Enterprise System Connection (ESCON) Director, or connectors. In many cases, the problem can be solved if you clean the optics and ensure that the cables are properly seated.

**Note:** Although this document primarily refers to a CIP, the errors and troubleshooting methods apply equally to a ECPA card.

## Prerequisites

### Requirements

There are no specific requirements for this document.

### Components Used

The information in this document is based on an ESCON CIP or ECPA with an ESCON-attached Mainframe.

### Conventions

For more information on document conventions, refer to the Cisco Technical Tips Conventions.

## LOGDATA Error Message

LOGDATA error messages appear in the CIP router console log in the format shown in the next code example. They begin with address 0000 and end with address 0D80.

The entire log must be captured, from the `%ADAPTER-6-LOGOUT: Port 0 logout data` line to the `%ADAPTER-6-LOGDATA: 0D80` line. For this reason, it is recommended that you set **logging buffered** to at least **80000** on all CIP and ECPA routers.

```
Jan 7 09:31:50 CST: %CIP2-6-MSG: slot2 %ADAPTER-6-LOGOUT: Port 0 logout data.
Adapter microcode C50602D4
Jan 7 09:31:50 CST: %CIP2-6-MSG: slot2 %ADAPTER-6-LOGDATA: 0000 D5E2C3C1
00000D60 0A000120 00000000 FDE81572 0048A000 00000000 E8000000
Jan 7 09:31:50 CST: %CIP2-6-MSG: slot2 %ADAPTER-6-LOGDATA: 0020 00000800
08180001 08D38400 07D301A1 10120C00 5D000010 0048A000 01000000
Jan 7 09:31:50 CST: %CIP2-6-MSG: slot2 %ADAPTER-6-LOGDATA: 0040 00000000
00400003 C6010000 A0C20001 00114100 00117940 00112400 00118100
```

## Troubleshooting

LOGDATA error messages only occur on ESCON channel connections. Most of the time, LOGDATA records indicate that there was some type of transmission error or protocol error on the link. In order to troubleshoot this error condition, a few questions must be answered:

- Did this error condition cause an outage?
- Is this the first occurrence of this error?
- Were there any changes at the physical layer, for example cables, the ESCON Director, and so forth?

If this error condition *did not* cause any outage, then it was a recoverable code violation. If this error condition *did* cause an outage???for example, a fatal error???then further investigation is required.

For transmission errors, the most likely causes are poorly seated cables, dirty optics, bad transmitting LEDs, or bad receivers.

Protocol errors indicate that either the CIP, the ESCON Director, or the mainframe violated the ESCON protocol. Most of these errors???even the protocol errors???are recoverable without the application (virtual telecommunications access method [VTAM] or TCP/IP) even knowing about it.

A good place to start to troubleshoot is with the **show extended channel statistics** or **show extended channel subchannel** commands. If there clearly were transmission errors, make sure that you clean the optics and that the cables are properly seated. Some bit errors are not reported in the statistics; so, even if those statistics are 0, there still could have been a code violation.

In 99.999% of all cases, LOGDATA error messages are due to hardware: cables, the ESCON Director, or connectors. In either case, the error dump can only be analyzed by IBM and may not always be conclusive. Given that 99.999% of the time this is due to hardware, it is extremely important to completely eliminate hardware issues before you consider sending your error dump to be decoded. Also, when you run the latest available CIP microcode, you ensure that any fixes for these issues are applied. Once you rule out hardware problems, Cisco Technical Support can send the dump to IBM for analysis.

**Note:** It is important to again note that all CIP routers should have logging buffered 80000, at the very least, so that the full dump is captured. If your syslog server address is unreachable and the log output is lost because your logging buffered is only 4000, then you will have to wait for another occurrence to find out what happened. This is undesirable.

**Note:** Each occurrence of the error starts with Port 0 logout data:

```
%CIP2-6-MSG: slot5 %ADAPTER-6-LOGOUT: Port 0 logout data.
Adapter microcode C50602D4
```

Each occurrence ends with LOGSAME:

```
%CIP2-6-MSG: slot5 %ADAPTER-6-LOGSAME: 0D80 to 1000
```

**Note:** In some customer environments, LOGDATA records with multiple error messages can occur when the mainframe takes longer than 500 ms to respond to device-level activity. The ESCON architecture states that this timeout value can range from 400 ms to 850 ms. To avoid some of the occurrences of LOGDATA, use CIP21-21 or higher or CIP22-28 or higher, as per Cisco bug ID CSCdj84218 ( registered customers only) .

## NetPro Discussion Forums – Featured Conversations

Networking Professionals Connection is a forum for networking professionals to share questions, suggestions, and information about networking solutions, products, and technologies. The featured links are some of the most recent conversations available in this technology.

NetPro Discussion Forums – Featured Conversations for IBM
---

Network Infrastructure: Enterprise Data Centers
---

---

## Related Information

- [How to Select and Upgrade CIP or CPA Microcode for Various Cisco IOS Software Releases](#)
- [Technology Support](#)
- [Product Support](#)
- [Technical Support – Cisco Systems](#)

---

[Contacts & Feedback](#) | [Help](#) | [Site Map](#)

© 2008 – 2009 Cisco Systems, Inc. All rights reserved. [Terms & Conditions](#) | [Privacy Statement](#) | [Cookie Policy](#) | [Trademarks of Cisco Systems, Inc.](#)

---

Updated: Sep 09, 2005

Document ID: 12338

---