

CHAPTER

Known Issues and Workarounds

This section lists the Known Issues in Cisco CP Express Release 2.7.

Table 1 List of Open Caveats in Cisco CP Express

Bug ID	Description
CSCtz82923	Configured parameters do not reflect on the edit screen.
	Symptom The Interfaces screen "edit VLAN and edit Interface (edit VLAN for End User view)" dialog boxes do not reflect the correct values for attributes displayed on the Summary screen.
	Conditions When the Interfaces feature is in use, and an interface or a VLAN is being edited.
	Workaround Upgrade your Cisco IOS Software Release to 15.2(4)M, or later.
CSCua25946	In a MAC environment with Google Chrome, the vertical scroll bar of the dashboard does not function correctly.
	Symptom The dashboard screen freezes.
	Conditions On MAC, Google Chrome browser is resized and this causes the horizontal scroll bar to appear.
	Workaround Reload the browser and continue using Cisco CP Express.