



CHAPTER 13

Troubleshooting Gigabit Ethernet SPAs

This chapter describes techniques that you can use to troubleshoot the operation of Gigabit Ethernet SPAs, and it includes the following sections:

- [General Troubleshooting Information, page 13-1](#)
- [Performing Basic Interface Troubleshooting, page 13-2](#)
- [Configuring the Interface for Internal Loopback, page 13-6](#)
- [Using the Cisco IOS Event Tracer to Troubleshoot Problems, page 13-7](#)
- [Preparing for Online Insertion and Removal of a SPA, page 13-7](#)

The first section provides information about basic interface troubleshooting. If you are having a problem with your SPA, use the steps in the “[Performing Basic Interface Troubleshooting](#)” section to begin your investigation of a possible interface configuration problem.

General Troubleshooting Information

This section describes general information for troubleshooting SIPs and SPAs. It includes the following sections:

- [Using debug Commands, page 13-1](#)
- [Using show Commands, page 13-2](#)

Using debug Commands

Along with the other **debug** commands supported on the Cisco uBR10012 router, you can obtain specific debug information for SPAs on the Cisco uBR10012 router using the **debug hw-module subslot** privileged EXEC command.

The **debug hw-module subslot** command is intended for use by Cisco technical support personnel.



Caution

Because debugging output is assigned high priority in the CPU process, it can render the system unusable. For this reason, use **debug** commands only to troubleshoot specific problems or during troubleshooting sessions with Cisco technical support staff. Moreover, it is best to use **debug** commands during periods of lower network traffic and fewer users. Debugging during these periods decreases the likelihood that increased **debug** command processing overhead will affect system use.

For information about other **debug** commands supported on the Cisco uBR10012 router, see the *Cisco IOS CMTS Cable Command Reference* at the following URL:

http://www.cisco.com/en/US/docs/ios/cable/command/reference/cbl_book.html

Using show Commands

There are several **show** commands that you can use to monitor and troubleshoot the SPAs on the Cisco uBR10012 router. This chapter describes using the **show interfaces** command to perform troubleshooting of your SPA.

Performing Basic Interface Troubleshooting

You can perform most of the basic interface troubleshooting using the **show interfaces gigabitethernet** or **show interfaces tengigabitethernet** command and examining several areas of the output to determine how the interface is operating.

The following example shows output from the **show interfaces gigabitethernet** and **show interfaces tengigabitethernet** commands with some of the significant areas of the output to observe shown in bold:

```
Router# show interfaces gigabitethernet 3/0/0
GigabitEthernet3/0/0 is down, line protocol is down
  Hardware is GigEther SPA, address is 000a.f330.2e40 (bia 000a.f330.2e40)
  Internet address is 2.2.2.1/24
  MTU 1500 bytes, BW 1000000 Kbit, DLY 10 usec,
    reliability 255/255, txload 1/255, rxload 1/255
  Encapsulation ARPA, loopback not set
  Keepalive not supported
Full-duplex, 1000Mb/s, link type is force-up, media type is SX
  output flow-control is on, input flow-control is on
  ARP type: ARPA, ARP Timeout 04:00:00
  Last input 03:18:49, output 03:18:44, output hang never
  Last clearing of "show interface" counters never
  Input queue: 0/75/0/0 (size/max/drops/flushes); Total output drops: 0
  Queueing strategy: fifo
  Output queue: 0/40 (size/max)
  5 minute input rate 0 bits/sec, 0 packets/sec
  5 minute output rate 0 bits/sec, 0 packets/sec
    1703 packets input, 638959 bytes, 0 no buffer
    Received 23 broadcasts (0 IP multicasts)
    0 runts, 0 giants, 0 throttles
    0 input errors, 0 CRC, 0 frame, 0 overrun, 0 ignored
    0 watchdog, 1670 multicast, 0 pause input
    1715 packets output, 656528 bytes, 0 underruns
    0 output errors, 0 collisions, 4 interface resets
    0 babbles, 0 late collision, 0 deferred
    0 lost carrier, 0 no carrier, 0 pause output
    0 output buffer failures, 0 output buffers swapped out

Router# show interfaces tenGigabitEthernet 3/0/0
TenGigabitEthernet3/0/0 is up, line protocol is up (connected)
  Hardware is TenGigEther SPA, address is 0000.0c00.0102 (bia 000f.342f.c340)
  Internet address is 15.1.1.2/24
  MTU 1500 bytes, BW 10000000 Kbit, DLY 10 usec,
    reliability 255/255, txload 1/255, rxload 1/255
  Encapsulation ARPA, loopback not set
  Keepalive not supported
Full-duplex, 10Gb/s
```

```

input flow-control is on, output flow-control is on
ARP type: ARPA, ARP Timeout 04:00:00
Last input never, output 00:00:10, output hang never
Last clearing of "show interface" counters 20:24:30
Input queue: 0/75/0/0 (size/max/drops/flushes); Total output drops: 0
Queueing strategy: fifo
Output queue: 0/40 (size/max)
5 minute input rate 0 bits/sec, 0 packets/sec
5 minute output rate 0 bits/sec, 0 packets/sec
L2 Switched: ucast: 0 pkt, 0 bytes - mcast: 0 pkt, 0 bytes
L3 in Switched: ucast: 0 pkt, 0 bytes - mcast: 0 pkt, 0 bytes mcast
L3 out Switched: ucast: 0 pkt, 0 bytes mcast: 0 pkt, 0 bytes
237450882 packets input, 15340005588 bytes, 0 no buffer
Received 25 broadcasts (0 IP multicasts)
 0 runts, 0 giants, 0 throttles
 0 input errors, 0 CRC, 0 frame, 0 overrun, 0 ignored
 0 watchdog, 0 multicast, 0 pause input
 0 input packets with dribble condition detected
1676 packets output, 198290 bytes, 0 underruns
 0 output errors, 0 collisions, 4 interface resets
 0 babbles, 0 late collision, 0 deferred
0 lost carrier, 0 no carrier, 0 PAUSE output
 0 output buffer failures, 0 output buffers swapped out

```

To verify that your interface is operating properly, complete the steps in [Table 13-1](#).

Table 13-1 Verifying the Interface

	Action	Example
Step 1	From global configuration mode, enter the show interfaces gigabitethernet or show interfaces tengigabitethernet command.	Router# show interfaces gigabitethernet 1/3/0 Router# show interfaces tengigabitethernet 3/0/0
Step 2	Verify that the interface is up.	Router# show interfaces gigabitethernet 1/3/0 GigabitEthernet1/3/0 is up , line protocol is up Router# show interfaces tengigabitethernet 3/0/0 TenGigabitEthernet3/0/0 is up , line protocol is up (connected)
Step 3	Verify that the line protocol is up.	Router# show interfaces gigabitethernet 1/3/0 GigabitEthernet1/3/0 is up, line protocol is up Router# show interfaces tengigabitethernet 3/0/0 TenGigabitEthernet3/0/0 is up, line protocol is up (connected)
Step 4	Verify that the interface duplex mode matches the remote interface configuration.	The following example shows that the local interface is currently operating in full-duplex mode: Router# show interfaces gigabitethernet 1/3/0 [text omitted] Keepalive not supported Full-duplex , 1000Mb/s, link type is force-up, media type is SX Router# show interfaces tengigabitethernet 3/0/0 [text omitted] Keepalive not supported Full-duplex , 10Gb/s

	Action	Example
Step 5	Verify that the interface speed matches the speed on the remote interface.	The following example shows that the local interface is currently operating at 100 Mbps (Gigabit Ethernet) or 10Gbps (10-Gigabit Ethernet): Router# show interfaces gigabitethernet 1/3/0 [text omitted] Keepalive not supported Full-duplex, 1000Mb/s , link type is force-up, media type is SX Router# show interfaces tengigabitethernet 3/0/0 [text omitted] Full-duplex, 10Gb/s
Step 6	Observe the output hang status on the interface.	ARP type: ARPA, ARP Timeout 04:00:00 Last input 03:18:49, output 03:18:44, output hang never
Step 7	Observe the CRC counter.	0 input errors, 0 CRC , 0 frame, 130043940 overrun, 0 ignored
Step 8	Observe the late collision counter.	0 output errors, 0 collisions, 4 interface resets 0 babbles, 0 late collision , 0 deferred
Step 9	Observe the carrier signal counters.	0 lost carrier , 0 no carrier , 0 pause output 0 output buffer failures, 0 output buffers swapped out

For more information about the verification steps and possible responses to correct detected problems, see the following sections:

- [Verifying the Interface Is Up](#), page 13-4
- [Verifying the Line Protocol Is Up](#), page 13-5
- [Verifying Output Hang Status](#), page 13-5
- [Verifying the CRC Counter](#), page 13-5
- [Verifying Late Collisions](#), page 13-5
- [Verifying the Carrier Signal](#), page 13-6

Verifying the Interface Is Up

In the output from the **show interfaces gigabitethernet** or **show interfaces tengigabitethernet** command, verify that the interface is up. If the interface is down, perform the following corrective actions:

- If the interface is *administratively down*, use the **no shutdown** interface configuration command to enable the interface.
- Be sure that the cable is fully connected.
- Verify that the cable is not bent or damaged. If the cable is bent or damaged, the signal will be degraded.
- Verify that a hardware failure has not occurred. Observe the LEDs to confirm the failure. See the other troubleshooting sections of this chapter, and refer to the *Cisco uBR10012 Universal Broadband Router SIP and SPA Hardware Installation Guide*. If the hardware has failed, replace the SPA as necessary.

Verifying the Line Protocol Is Up

In the output from the **show interfaces gigabitethernet** or **show interfaces tengigabitethernet** command, verify that the line protocol is up. If the line protocol is down, the line protocol software processes have determined that the line is unusable.

Perform the following corrective actions:

- Replace the cable.
- Check the local and remote interface for misconfiguration.
- Verify that a hardware failure has not occurred. Observe the LEDs to confirm the failure. See the other troubleshooting sections of this chapter, and refer to the *Cisco uBR10012 Universal Broadband Router SIP and SPA Hardware Installation Guide*. If the hardware has failed, replace the SPA as necessary.

Verifying Output Hang Status

In the output from the **show interfaces gigabitethernet** or **show interfaces tengigabitethernet** command, observe the value of the output hang field.

The output hang provides the number of hours, minutes, and seconds since the last reset caused by a lengthy transmission. When the number of hours in the field exceeds 24 hours, the number of days and hours is shown. If the field overflows, asterisks are printed. The field shows a value of *never* if no output hangs have occurred.

Verifying the CRC Counter

In the output from the **show interfaces gigabitethernet** or **show interfaces tengigabitethernet** command, observe the value of the CRC counter. Excessive noise will cause high CRC errors accompanied by a low number of collisions.

Perform the following corrective actions if you encounter high CRC errors:

- Check the cables for damage.
- Verify that the correct cables are being used for the SPA interface.

Verifying Late Collisions

In the output from the **show interfaces gigabitethernet** or **show interfaces tengigabitethernet** command, observe the value of the late collision counter.

Perform the following corrective actions if you encounter late collisions on the interface:

- Verify that the duplex mode on the local and remote interface match. Late collisions occur when there is a duplex-mode mismatch.
- Verify the length of the Ethernet cables. Late collisions result from cables that are too long.

Verifying the Carrier Signal

In the output from the **show interfaces gigabitethernet** or **show interfaces tengigabitethernet** command, observe the value of the carrier signal counters. The lost carrier counter shows the number of times that the carrier was lost during transmission. The no carrier counter shows the number of times that the carrier was not present during transmission.

Carrier signal resets can occur when an interface is in loopback mode or shut down.

Perform the following corrective actions if you observe the carrier signal counter incrementing outside of these conditions:

- Check the interface for a malfunction.
- Check for a cable problem.

Configuring the Interface for Internal Loopback

Loopback support is useful for testing the interface without connectivity to the network, or for diagnosing equipment malfunctions between the interface and a device. The Gigabit Ethernet SPAs support internal loopback mode.

To enable internal loopback at the MAC device on a Gigabit Ethernet SPA, use the following command in interface configuration mode:

Command or Action	Purpose
Router(config-if)# loopback mac	Enables internal loopback at the MAC device on the interface.

Verifying Loopback Status

To verify whether loopback is enabled on an interface port on a SPA, use the **show interfaces gigabitethernet** or **show interfaces tengigabitethernet** command in privileged EXEC mode and observe the value shown in the “loopback” field.

The following example shows that loopback is disabled for interface port 0 (the first port) on the Gigabit Ethernet SPA installed in the top (0) subslot of the SIP that is located in slot 1 of the Cisco uBR10012 router:

```
Router# show interfaces gigabitethernet 1/0/0
GigabitEthernet1/0/0 is up, line protocol is up
  Hardware is GigMac 1 Port 10 GigabitEthernet, address is 0008.7db3.8dfe (bia)
  Internet address is 10.0.0.2/24
  MTU 1500 bytes, BW 10000000 Kbit, DLY 10 usec, rely 255/255, load 1/255
  Encapsulation ARPA, loopback not set
```

The following example shows that loopback is disabled for interface port 0 (the first port) on the 10-Gigabit Ethernet SPA installed in the top (0) subslot of the SIP that is located in slot 3 of the Cisco uBR10012 router:

```
Router# show interfaces tengigabitethernet 3/0/0
TenGigabitEthernet3/0/0 is up, line protocol is up (connected)
  Hardware is TenGigEther SPA, address is 0000.0c00.0102 (bia 000f.342f.c340)
  Internet address is 15.1.1.2/24
  MTU 1500 bytes, BW 10000000 Kbit, DLY 10 usec,
    reliability 255/255, txload 1/255, rxload 1/255
```

Encapsulation ARPA, loopback not set

Using the Cisco IOS Event Tracer to Troubleshoot Problems



Note

This feature is intended for use as a software diagnostic tool and should be configured only under the direction of a Cisco Technical Assistance Center (TAC) representative.

The Event Tracer feature provides a binary trace facility for troubleshooting Cisco IOS software. This feature gives Cisco service representatives additional insight into the operation of the Cisco IOS software and can be useful in helping to diagnose problems in the unlikely event of an operating system malfunction or, in the case of redundant systems, Route Processor (RP) switchover.

Event tracing works by reading informational messages from specific Cisco IOS software subsystem components that have been preprogrammed to work with event tracing, and by logging messages from those components into system memory. Trace messages stored in memory can be displayed on the screen or saved to a file for later analysis.

The SPAs currently support the “spa” component to trace SPA OIR-related events.

For more information about using the Event Tracer feature, refer to the following URL:

http://www.cisco.com/en/US/docs/ios/12_0s/feature/guide/evnttrcr.html

Preparing for Online Insertion and Removal of a SPA

The Cisco uBR10012 router supports online insertion and removal (OIR) of the SIP, in addition to each of the SPAs. Therefore, you can remove a SIP with its SPAs still intact, or you can remove a SPA independently from the SIP, leaving the SIP installed in the router.

With OIR, a SIP can remain installed in the router with one SPA remaining active, while you remove another SPA from one of the SIP subslots. If you are not planning to immediately replace a SPA into the SIP, then be sure to install a blank filler plate in the subslot. The SIP should always be fully installed with either functional SPAs or blank filler plates.

For more information about activating and deactivating SPAs in preparation for OIR, see the “[Preparing for Online Insertion and Removal of SIPs and SPAs](#)” section on page 5-2.

