

Release Notes for Cisco RV110W Firmware Version 1.0.1.6

August 9, 2011

Contents

This document includes the following topics:

- [Resolved Issues](#)
- [Known Issues](#)
- [Related Information](#)

Resolved Issues

Table 1 Resolved Issues in Firmware Version 1.0.1.6

Ref Number	Description
CSCto89324	The Cisco RV110W router's web-based configuration utility cannot support IP addresses that have octets with a value above 250.
CSCtn12643	The Cisco RV110W router's web-based configuration utility may not respond consistently over time, although network traffic is unaffected.
CSCtn30604	Remote and LAN access to the router's web-based configuration utility fails after setting Web Access and Remote Access to HTTP.
CSCto81709	Using a Firefox 4 web browser for remote management can cause the router to block clients from accessing the web-based configuration utility.

Release Notes

Table 1 Resolved Issues in Firmware Version 1.0.1.6

Ref Number	Description
CSCto75073	When a user attempts to load a configuration file from firmware version 1.0.0.2 to firmware version 1.0.1.6, the web-based configuration utility continuously asks the user to enter a username and password.
CSCto42810	When you enter a policy name on the Internet Access Policy page and press the Enter key, the web-based configuration utility logs you out.
CSCtn90545	The user ID information of the user who initiated the last Simple Network Management Protocol (SNMP) configuration change needs to be added.
CSCto03538	The Time of Day Access option does not work for Wireless Distribution System (WDS) peers.
CSCtn97014	The System Summary page shows two instances of DNS 2.
CSCtn97018	On the Networking > Dynamic DNS page, the Dyn dns password should be empty by default.
CSCtn97021	Moving from the SNMP page to the Diagnostics page results in unnecessary popups.
CSCtn97023	IPv6 remote management can be accessed even if the remote access of the web-based configuration utility is turned off.
CSCtn97033	WLAN and LAN clients are not able to access the remote web-based configuration utility through the 6to4 tunnel.
CSCtn97038	A Point-to-Point Tunneling Protocol (PPTP) VPN client is able to access the router using HTTP even if HTTP access is disabled.
CSCtn97042	The information imported from the VPN Client Settings file must be verified.
CSCtn97051	When a second language is uploaded, a message is briefly displayed on the Connected Devices and View Logs page.
CSCtn97058	After generating a new certificate, the router continuously displays a Rebooting Device message.
CSCtn97063	When a user logs into the router through HTTP and generates a new VPN certificate, the router doesn't return to the correct webpage.
CSCtn97325	A QuickVPN connection can cause the HTTPS process to quit, causing a user to be unable to login.
CSCto12416	The Point-to-Point Tunneling Protocol (PPTP) client cannot connect to the PPTP Server if CHAP is enabled.

Table 1 Resolved Issues in Firmware Version 1.0.1.6

Ref Number	Description
CSCto15292	A user cannot create an Inbound (WAN to LAN) access rule. Error checking forces user to put the IP address in the same subnet as the LAN, but this is incorrect.
CSCto15118	The Cisco RV110W router doesn't allow the user to increase the length of a password beyond the length of the current password.
CSCto15088	While running the Setup Wizard and entering the wireless security key, if a leading or trailing blank space is entered the wizard does not prompt for an error, but stops.
CSCto15510	When you try to add two identical MAC addresses on the Wireless > WDS page, both MAC addresses can appear in the web-based configuration utility.
CSCto17638	The web-based configuration utility hangs when a user enters spaces instead of a pin when configuring Method 2 on the Wireless > WDS page.
CSCto14926	When the system is rebooted, there are some errors with the linkUp trap.
CSCto22883	When using SNMPv3 for the traps, no traps are being sent to trap destination.
CSCto22889	If you have a SNMP community set for v1 or v2c and switch to v3, the Community field is nulled out when you save. After the save is complete, the value is restore.
CSCto35408	The error message on the Administration > Backup / Restore Settings page needs to be changed.
CSCto40516	The router does not allow users to create a DHCP server IP address upper range when the subnet mask is different than /24 (255.255.255.0).
CSCto40489	A user can't consistently establish a WDS connection if using ciscosb.
CSCto42810	In the Firewall > Internet Access Policy page when you enter a policy name and press the Enter key, the web-based configuration utility logs you out.
CSCto45953	When you upload a new language pack to the router, every time you change the language in the first log in screen, you must log in twice in order to access the web-based configuration utility.

Known Issues

- Upgrading the firmware via Simple Network Management Protocol (SNMP) requires the firmware image to be renamed to *code.bin*.
Workaround—None.
- The **Website Blocking Table** on the **Internet Access Policy** page allows duplicate entries. **Workaround**—Do not create duplicate entries.
- The PPTP client does not support Microsoft Point-To-Point Encryption (MPPE). **Workaround**—None.
- Text-based configuration files cannot be modified by the user and then uploaded to the router. **Workaround**—None.
- Multicast traffic does not pass to wireless clients from LAN to WLAN.
Workaround—None.
- Degraded performance with certain wireless client adapters.
Workaround—Upgrade to the latest drivers. Enable Wireless Multimedia (WMM) and disable the power save mode in the wireless client driver properties.
- Some time zones are incorrect on **Time Settings** page of the web-based Device Manager. **Workaround**—Set the local time manually in the router's web-based Device Manager.

Related Information

Support	
Cisco Small Business Support Community	www.cisco.com/go/smallbizsupport
Cisco Small Business Support and Resources	www.cisco.com/go/smallbizhelp
Phone Support Contacts	www.cisco.com/en/US/support/tsd_cisco_small_business_support_center_contacts.html
Cisco Small Business Firmware Downloads	www.cisco.com/go/software Select a link to download firmware for Cisco Small Business Products. No login is required.
Product Documentation	
Cisco Small Business RV Series Routers	www.cisco.com/go/smallbizrouters
Cisco Small Business	
Cisco Partner Central for Small Business (Partner Login Required)	www.cisco.com/web/partners/sell/smb
Cisco Small Business Home	www.cisco.com/smb

Cisco and the Cisco Logo are trademarks of Cisco Systems, Inc. and/or its affiliates in the U.S. and other countries. A listing of Cisco's trademarks can be found at www.cisco.com/go/trademarks. Third party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1005R)

© 2011 Cisco Systems, Inc. All rights reserved.

OL-25573-01