

Release Notes for Cisco RV110W Firmware Version 1.1.0.9

November 3, 2011

Contents

This document includes the following topics:

- **Changes Since Firmware Release 1.0.1.6**
- **Known Issues in Release 1.1.0.9**
- **Related Information**

Changes Since Firmware Release 1.0.1.6

- **Additions**
- **Resolved Issues**

Additions

- Added “No-IP.com” to supported DDNS services.
- Clicking **Help** now displays the context-sensitive online help page.
- Statistics display has been revised to allow users to display data in KB, MB, GB, or TB.
- The RV110W now provides a user-configurable refresh rate for the system dashboard display.
- The RV110W now provides the ability to add Static DHCP from the DHCP Leased Clients table.

Resolved Issues

Table 1 Resolved Issues in Firmware Version 1.1.0.9

Ref Number	Description
CSCts58689	In the Firewall > Basic Settings page, filtering options for cookies and proxy do not work.
CSCts67685	The RV110W does not perform input checking on the QVPN client list when importing.
CSCts56561	Setting up port forwarding causes the router to freeze when using VNC.
CSCts45243	Default remote management login should use https and port 443.
CSCts43176	QVPN clients cannot access any devices behind the LAN.
CSCts16833	RV110W should allow a maximum of 100 static route entries.
CSCts29174	Changing from WPA to WPA2 security mode requires a password change.
CSCts13892	PPTP users can access all VLANS.
CSCto97498	The Cisco RV110W allows the creation of multiple subnets that overlap.
CSCto97785	There are no logs or status indicators for RIP.
CSCtq90512	Incorrect SNMP option name.
CSCtr83877	DNS lookup hint is incorrect.
CSCtr83951	In the Wireless Statistics page, when using the Show Simplified Statistics Data option, data is shown incorrectly.

Table 1 Resolved Issues in Firmware Version 1.1.0.9

Ref Number	Description
CSCtr91841	PPTP server input fields do not check for correct input.
CSCtr92661	After using the backup and restore functions, the default gateway is unresponsive.
CSCts00211	The Firewall > Access Rules page gives an error when a user deactivates and reactivates a previously-configured access rule.
CSCts00987	The QOS > COS page displays incorrect default settings.
CSCts08816	Navigating from the Time settings page gives an incorrect error.
CSCts08841	VLAN page displays incorrect prompt when setting the default gateway of a VLAN to one that was previously allocated.
CSCtl77834	The PPTP client does not support Microsoft Point-To-Point Encryption (MPPE).
CSCtl89139	The RV110W stores the WAN IP address and uses it instead of obtaining a new WAN IP address.
CSCtn87791	Upgrading the firmware via Simple Network Management Protocol (SNMP) requires the firmware image to be renamed to <i>code.bin</i> .
CSCtn15514	The Website Blocking Table on the Internet Access Policy page allows duplicate entries.
CSCtn51404	Multicast traffic does not pass to wireless clients from LAN to WLAN.
CSCtn90976	Some time zones are incorrect on Time Settings page of the web-based Device Manager.
CSCtn40792	Changing VLAN subnet causes system reboot.
CSCtn43215	Multicast traffic passes from LAN to LAN clients, but does not work from LAN to WLAN.
CSCtn48412	WDS: WLAN fails to associate with the WAP4410N in N-Only wireless mode.
CSCtn54551	When copying any configuration file to the startup configuration, the system reboots without warning.
CSCtn54336	Guest user account is not disabled by default.
CSCtn59407	When viewing logs, the oldest logs are displayed first, rather than the newest logs.
CSCtn72050	When configuring the Firewall > Internet Access Policy , the “allow by schedule, otherwise block” option allows access after the schedule ends.
CSCtn74683	Static DHCP pop-up message needs clarification.

Release Notes

Table 1 Resolved Issues in Firmware Version 1.1.0.9

Ref Number	Description
CSCtn78322	When configuring WDS links with the maximum number of peers, WDS links become unstable.
CSCto15252	In Wireless Security, the terminology for security key needs revision and the password needs to be masked after it is saved.
CSCto14516	“Set on incomplete OID” causes SNMP to lock up.
CSCto45937	Typographical error in French graphical user interface.
CSCto65805	The RV110W needs to display the gateway WAN IP address in the summary page.
CSCto81941	Pressing Enter on the Schedule Management pages logs out the user.
CSCto78766	The AP Management VLAN does not work correctly.
CSCto97723	Deleting a VLAN causes the LAN configuration page to display blank.
CSCtq05397	The QVPN client cannot access LAN clients when inter-VLAN routing is enabled.
CSCtq05513	The Setup Wizard should not display again after it has been completed.
CSCtq05475	Message that the administrator is already logged in is shown in error.
CSCtq40722	Checksum for the MIB needs to be provided.
CSCtr05042	The RV110W does not handle DHCP requests from untagged packets.

Known Issues in Release 1.1.0.9

- Text-based configuration files cannot be modified by the user and then uploaded to the router. **Workaround**—None.
- Degraded performance with certain wireless client adapters. **Workaround**—Upgrade to the latest drivers. Enable Wireless Multimedia (WMM) and disable the power save mode in the wireless client driver properties.

Related Information

Support	
Cisco Small Business Support Community	www.cisco.com/go/smallbizsupport
Cisco Small Business Support and Resources	www.cisco.com/go/smallbizhelp
Phone Support Contacts	www.cisco.com/en/US/support/tsd_cisco_small_business_support_center_contacts.html
Cisco Small Business Firmware Downloads	www.cisco.com/go/software Select a link to download firmware for Cisco Small Business Products. No login is required.
Product Documentation	
Cisco Small Business RV Series Routers	www.cisco.com/go/smallbizrouters
Cisco Small Business	
Cisco Partner Central for Small Business (Partner Login Required)	www.cisco.com/web/partners/sell/smb
Cisco Small Business Home	www.cisco.com/smb

Cisco and the Cisco Logo are trademarks of Cisco Systems, Inc. and/or its affiliates in the U.S. and other countries. A listing of Cisco's trademarks can be found at www.cisco.com/go/trademarks. Third party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1005R)

© 2011 Cisco Systems, Inc. All rights reserved.

OL-26159-01