

Release Notes for the Cisco Small Business RV215W Series Firmware Version 1.1.0.5

April 18, 2013

These Release Notes describe the updates and fixes in versions 1.1.0.5 of the Cisco Small Business RV215W firmware.

Contents

This document includes the following topics:

- [Cisco Small Business RV215W Firmware Changes for Version 1.1.0.5](#)
- [Related Information](#)

Cisco Small Business RV215W Firmware Changes for Version 1.1.0.5

Enhancements in Firmware Version 1.1.0.5

Users can upgrade the firmware by using a USB Flash (or thumb) drive.

More 3G and 4G dongles are supported.

Users can upload dongle module files to support new dongles.

IKE local and remote identifiers can be configured to support NAT scenarios.

Caveats in Firmware Version 1.1.0.5

PFS Option in Site-to-Site VPN is Always Disabled (CSCue85378)

The PFS is always disabled, even if it is enabled by using the GUI. The VPN peer must disable PFS to establish VPN tunnel.

Workaround: Disable the PFS option on the VPN peer.

Fails to Upload a Configuration File from a USB Device (CSCue88474)

System continuously reboots when trying to use a USB drive to restore a configuration.

Workaround: Unplug the USB Flash drive to avoid rebooting, and restore the configuration from a PC.

The WAN Connection Does Not Reliably Recover from a 3G Link to an Ethernet Link (CSCue72776)

The connection does not always failover to the Ethernet WAN link when the 3G connection fails, often when device is in IPv4/IPv6 Dual Stack mode.

Workaround: None.

Fail to Upgrade Firmware or Configuration File from NTFS Formatted USB Device (CSCue88485)

Cannot use a NTFS-formatted USB drive to upgrade firmware or a configuration file.

Workaround: Use a drive formatted for FAT32.

Ratio of Passed Traffic is not Accurate on the LAN4 port when in Port-based QoS Mode (CSCuf24392)

When port-based QoS is enabled, the queue schedule does not work on the LAN4 port; the ratio of passed traffic is not correct.

Workaround: Use the LAN1, LAN2, or LAN3 port instead of the LAN4 to use port-based QoS.

Resolved Caveats in Firmware Version 1.1.0.5

SNMPv3 Setting User noAuthNoPriv by using XML Requires Authorization (CSCub87985)

SNMPv3 Privacy Algorithm does not change to DES by using XML (CSCub87686)

Bonjour Advertisement Seen on Non-AP Management VLAN (CSCub08689)

Related Information

Support	
Cisco Small Business Support Community	www.cisco.com/go/smallbizsupport
Cisco Small Business Support and Resources	www.cisco.com/go/smallbizhelp
Phone Support Contacts	www.cisco.com/en/US/support/tsd_cisco_small_business_support_center_contacts.html
Cisco Small Business Firmware Downloads	www.cisco.com/go/smallbizfirmware Select a link to download firmware for Cisco Small Business Products. No login is required.
Product Documentation	
Cisco Small Business RV Series Routers	www.cisco.com/cisco/web/solutions/small_business/products/routers_switches/small_business_routers/index.html-tab-ForPartners
Cisco Small Business RV215W	www.cisco.com/en/US/partner/products/ps12678/index.html
Regulatory Compliance and Safety Information	www.cisco.com/en/US/docs/routers/csbr/rcsi/78-19314.pdf (French) www.cisco.com/en/US/docs/routers/csbr/rcsi/78-20910.pdf
Cisco Small Business	
Cisco Partner Central for Small Business (Partner Login Required)	www.cisco.com/web/partners/sell/smb
Cisco Small Business Home	www.cisco.com/smb

Release Notes

Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL: www.cisco.com/go/trademarks. Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1110R)

Copyright © 2013 Cisco Systems, Inc. All rights reserved.

78-TBD-01