

# Release Notes for 200, 300, and 500 Series Switches Software Version 1.4.10.6

**May 7, 2019**

These Release Notes describe the recommended practices and known issues that apply to software version 1.4.10.6 for the products listed in the table below.

Model	Description	Ports
SF200-24	24-Port 10/100 Smart Switch	e1-e24, g1-g2
SF200-24P	24-Port 10/100 PoE Smart Switch	e1-e24, g1-g2
SF200-48	48-Port 10/100 Smart Switch	e1-e48, g1-g2
SF200-48P	48-Port 10/100 PoE Smart Switch	e1-e48, g1-g2
SG200-18	18-port Gigabit Smart Switch	g1-g18
SG200-26	26-port Gigabit Smart Switch	g1-g26
SG200-26P	26-port Gigabit PoE Smart Switch	g1-g26
SG200-50	50-port Gigabit Smart Switch	g1-g50
SG200-50P	50-port Gigabit PoE Smart Switch	g1-g50
SG300-10	10-port Gigabit Managed Switch	g1-g10
SG300-10MP	10-port Gigabit PoE Managed Switch	g1-g10

## Release Notes

Model	Description	Ports
SG300-10MPP	10-Port Gigabit PoE+ Managed Switch	g1-g10
SG300-10SFP	10-port Gigabit PoE Managed Switch	8 SFP + 2 Combo slots
SG300-10P	10-port Gigabit PoE Managed Switch	g1-g10
SG300-10PP	10-Port Gigabit PoE+ Managed Switch	g1-g10
SG300-20	20-port Gigabit Managed Switch	g1-g20
SG300-28	28-port Gigabit Managed Switch	g1-g28
SG300-28P	28-port Gigabit PoE Managed Switch	g1-g28
SG300-28PP	28-Port Gigabit PoE+ Managed Switch	g1-g28
SG300-28MP	28-port Gigabit Max PoE Managed Switch	g1-g28
SG300-28SFP	28-port Gigabit SFP Managed Switch	g1-g24, g25-g28 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/ 5GE SFP)
SG300-52	52-port Gigabit Managed Switch	g1-g52
SG300-52P	52-port Gigabit PoE Managed Switch	g1-g52
SG300-52MP	52-port Gigabit Max PoE Managed Switch	g1-g52
SF300-08	8-port 10/100 Managed Switch	e1-e8

Model	Description	Ports
SF302-08	8-port 10/100 Managed Switch	e1-e8, g1-g2
SF302-08MP	8-port 10/100 PoE Managed Switch	e1-e8, g1-g2
SF302-08P	8-port 10/100 PoE Managed Switch	e1-e8, g1-g2
SF302-08PP	8-Port 10/100 PoE+ Managed Switch	e1-e8, g1-g2
SF302-08MPP	8-Port 10/100 PoE+ Managed Switch	e1-e8, g1-g2
SF300-24	24-port 10/100 Managed Switch	e1-e24, g1-g4
SF300-24P	24-port 10/100 PoE Managed Switch	e1-e24, g1-g4
SF300-24MP	24-port 10/100 Max PoE Managed Switch	e1-e24, g1-g4
SF300-24PP	24-Port 10/100 PoE+ Managed Switch	e1-e24, g1-g4
SF300-48	48-port 10/100 Managed Switch	e1-e48, g1-g4
SF300-48P	48-port 10/100 PoE Managed Switch	e1-e48, g1-g4
SF300-48PP	48-Port 10/100 PoE+ Managed Switch	e1-e48, g1-g4
SF500-24	24-port 10/100 Stackable Managed Switch	e1-e24, g1-g4 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/5GE SFP)

## Release Notes

Model	Description	Ports
SF500-24P	24-port 10/100 PoE Stackable Managed Switch	e1-e24, g1-g4 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/ 5GE SFP)
SF500-24MP	24-port 10/100 PoE+ Stackable Managed Switch with 4-port GE	e1-e24, g1-g4 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/ 5GE SFP)
SF500-48	48-port 10/100 Stackable Managed Switch	e1-e48, g1-g4 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/ 5GE SFP)
SF500-48P	48-port 10/100 PoE Stackable Managed Switch	e1-e48, g1-g4 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/ 5GE SFP)
SF500-48MP	48-port 10/100 PoE+ Stackable Managed Switch with 4-port GE	e1-e48, g1-g4 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/ 5GE SFP)
SG500-28	28-port 10/100/1000 Stackable Managed Switch	g1-g28 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/ 5GE SFP)
SG500-28P	28-port 10/100/1000 PoE Stackable Managed Switch	g1-g28 4 Gigabit Ethernet (2 combo* Gigabit Ethernet+ 2 1GE/5GE SFP)
SG500-28MPP	28-port Gigabit PoE+ Stackable Managed Switch	g1-g28 4 Gigabit Ethernet (2 combo* Gigabit Ethernet+ 2 1GE/5GE SFP)

Model	Description	Ports
SG500-52	52-port 10/100/1000 Stackable Managed Switch	g1-g52 4 Gigabit Ethernet (2 combo* Gigabit Ethernet + 2 1GE/5GE SFP)
SG500-52P	52-port 10/100/1000 PoE Stackable Managed Switch	g1-g52 4 Gigabit Ethernet (2 combo* Gigabit Ethernet+ 2 1GE/5GE SFP)
SG500-52MP	52-Port Gigabit PoE+ Stackable Managed Switch	g1-g52 4 Gigabit Ethernet (2 combo* Gigabit Ethernet+ 2 1GE/5GE SFP)
SG500X-24	24-port 10/100/1000 Stackable Managed Switch	g1-g24, xg1-xg4 4 10 Gigabit Ethernet SFP+ (1/5/10GE SFP+ modules)
SG500X-24P	24-port 10/100/1000 PoE Stackable Managed Switch	g1-g24, xg1-xg4 4 10 Gigabit Ethernet SFP+ (1/5/10GE SFP+ modules)
SG500X-24MPP	24-Port 10/100/1000 POE+ Stackable Managed Switch with 4-Port 10G	g1-g24, xg1-xg4 4 10 Gigabit Ethernet SFP+ (1/5/10GE SFP+ modules)
SG500X-48	48-port 10/100/1000 Stackable Managed Switch	g1-g48, xg1-xg4 4 10 Gigabit Ethernet SFP+ (1/5/10GE SFP+ modules)
SG500X-48P	48-port 10/100/1000 PoE Stackable Managed Switch	g1-g48, xg1-xg4 4 10 Gigabit Ethernet SFP+ (1/5/10GE SFP+ modules)
SG500X-48MP	48-Port 10/100/1000 POE+ Stackable Managed Switch with 4-Port 10G	g1-g48, xg1-xg4 4 10 Gigabit Ethernet SFP+ (1/5/10GE SFP+ modules)

## Release Notes

---

Model	Description	Ports
SG500XG-8F8T	16-Port 10-Gigabit Stackable Managed Switch	xg1-xg16 16 10GE ports (8 copper ports and 8 fiber ports) + 1GE port
ESW2-350G-52DC	52-port Gigabit Managed Switch	g1-g52
ESW2-550X-48DC	48-port 10/100/1000 Stackable Managed Switch	g1-g48, xg1-xg4 4 10 Gigabit Ethernet SFP+ (1/5/10GE SFP+ modules)

**NOTE** \*For the Sx500 Series, each combo mini-GBIC port has one 10/100/1000 copper Ethernet port and one mini-GBIC/SFP Gigabit Ethernet slot, with one port active at a time.

**TIP** As with any firmware release, please read these release notes before upgrading the firmware. Cisco also recommends backing up your configuration before any firmware upgrade.

---

## Contents

**Hardware Versions, page 7**

**What's New in this Release, page 8**

**Change in Flash File System, page 9**

**Issues Fixed in Version 1.4.10.6, page 10**

**Issues Addressed in Version 1.4.9.4, page 11**

**Limitations and Restrictions, page 12**

**Where to Find Support, page 22**

## Hardware Versions

This firmware runs on two different versions of hardware for the 200 Series Smart Switches, and the 300 Series Managed Switches. There is a single version of hardware for the 500 and ESW2 series switches. The number of supported MAC Addresses, Active VLANs, and Multicast Groups will be different depending on which version of hardware you are using. Refer to the following table for details:

V1 versus V2 Hardware	Total Number of MAC Addresses	Total Number of Active VLANs	Total Number of Multicast Groups
Sx200 in Firmware 1.0.x. HW VID=01	8K	128	128
Sx200 in Firmware 1.1.x and above. HW VID=01	8K	256	256
Sx200 in Firmware 1.1.x and above. HW VID=02	8K	256	256
Sx300 in Firmware 1.0.x. HW VID=01	8K	256	256
Sx300 in Firmware 1.1.x and above. HW VID=01	8K	256	256
Sx300 in Firmware 1.1.x and above. HW VID=02	16K	4K	1K

Sx500, SG500X and ESW2 switches have a single version of HW, see the admin guide for details.

To determine which version of hardware you are using, click **Status > System Summary**. Look at the lower portion of the screen under the graphic representation of the switch for the PID VID. The descriptor will end in the VID number. The version information is also shown on the product label on the back of the switch. The PID VID is located at the bottom of the label.

### What's New in this Release

- Enhanced security—To enhance device management security, this release introduces the following:
  - After you complete the initial connection to a device by logging in with the default user name **cisco** and the default password **cisco**, the system requires you to change the user name and password. In previous releases, you were asked to change only the password and could choose to skip the password change process.

#### NOTE

- Default credentials replacement also is enforced when upgrading from a previous release to this release, if the startup configuration in the previous release does not include level 15 credentials.

-If you disable password complexity, you can configure the user name **cisco** and the password **cisco** as your log in credentials. If you save these credentials to startup, you are not be prompted to change the credentials.

- The **cisco/cisco** credentials appear in the device configuration file. In previous releases, the **cisco/cisco** default credentials did not appear in configuration file.

- You cannot remove or delete the last privilege level 15 default username and password. This functionality prevents you from reverting (possibly without intention) to the default **cisco/cisco** credentials. In previous releases, you could remove last level 15 user, and in this case **cisco/cisco** credentials became active.
  - Deleting device configuration or rebooting a device to factory default restores the default login credentials. In this case, you will need to change the credentials again.
- Mirror configuration settings and file—The mirror config file no longer is supported on the Sx200 and Sx300 devices. It still is supported on Sx500 devices. Relevant CLI commands and GUI settings have been removed from Sx200 and Sx300 devices. The mirror config file on flash is erased when upgrading to release 1.4.8. If you need to save this file, back it up to an external server before you upgrade to this release.
  - Manual backup of config file to file on flash—The ability to copy a configuration file to a file in the flash no longer is supported on Sx200 and Sx300 devices. This functionality still is supported on Sx500 devices. Relevant CLI commands and GUI settings have been removed from Sx200



and Sx300 devices. Any such backup file on the flash is erased when upgrading a device to this release. If you need to save this file, back it up to an external server before you upgrade to this release

## Change in Flash File System

In versions 1.3.5.x and later, the Flash file system has been upgraded. This change has implications when upgrading from previous releases to version 1.3.5.x and later versions, and when downgrading from 1.3.7 or later to previous versions earlier than 1.3.5 as described below.

### Upgrading from Versions Earlier than 1.3.5.x

When upgrading the device from version prior to 1.3.5.x:

- For Sx200/Sx300 models, first upgrade the device image to image version 1.3.5.x and upgrade the boot file to 1.3.5.06
- For Sx500 models, first upgrade the device image to image version 1.3.7.x and upgrade the boot file to 1.3.7.01

During the first bootup of the new image version (1.3.5.x or 1.3.7.x), the flash file system is upgraded and:

- This process takes a few minutes. “...” progress in the console is displayed during this process (not relevant to Sx200).
- The syslog file is deleted during this process.
- The original image file is deleted. The two images on the Flash after the upgrade will have the same version (1.3.5.x/1.3.7.x).

After the device is running version 1.3.5.x/1.3.7.x, you can upgrade the device to version 1.4.0.48 or 1.4.1.3

### Boot Time when Upgrading to 1.4.x.x

This information is relevant to the following SKUs:

- SG300-52P, SG300-52MP
- SF500-24MP, SF500-48MP

- SG500X-24MP, SG500X-48MP

Software version 1.4.0.x includes upgraded firmware to the PoE controller. The PoE controller is upgraded automatically when the device is first booted, which makes the boot time longer (~7 minutes). During this time, the device is not responsive; however if a terminal is connected to the console port, the upgrade progress in percentage is displayed. If the upgrade process is interrupted (for example, device is shut down during this process), the upgrade restarts when the device is booted next.

### Downgrade from 1.4.0.x/1.4.y.x to releases earlier than 1.3.5.x

The downgrade copy operation process takes a few minutes, as the file system must be converted before the copy operation itself. The user is notified (using “....” progress on CLI or a message on the WEB GUI) that the conversion process is ongoing. When the conversion process is complete, the image download begins automatically. The device will automatically reboot after the copy is complete.

When a stacking system is downgraded, only the master is downgraded, and after the master comes up again, it loads the image to the other stack members.

Powering off the device during this process might damage the file system. In such cases, booting might require connecting to the device using the console cable (not relevant to Sx200) and loading the image file using XMODEM.

After the downgrade, only downloaded image file will remain on the Flash (the 1.4.0.x/1.4.1.x image is deleted during this process). There is no need to downgrade the boot file because the boot file supports both file systems. The boot file cannot be downgraded while version 1.4.0.x/1.4.1.x is active.

## Issues Fixed in Version 1.4.10.6

The following caveats have been resolved in this release:

**Problem:** Web application disables browser cross-site scripting filter (CSCvc97892).

**Problem:** Persistent Cross-Site Scripting Vulnerability when pasting script to “Administration > System Settings > Custom Banner Settings > Login Banner window (CSCvi87326).

**Problem:** TLS\_RSA\_WITH\_SEED\_CBC\_SHA weak cipher suite accepted by device (CSCvi95265).

**Problem:** VLANs with ID 1024 and above are removed from running configuration if voice VLAN ID is learned via VSDP protocol (CSCvj83014).

**Problem:** Cisco Small Business Switches Privileged Access Vulnerability (CSCvk20713).

**Problem:** Default cisco/cisco credentials are not shown as part of the configuration file (CSCvk26989).

**Problem:** After working for about a year Device runs at 100% CPU (CSCvm46827).

**Problem:** Cisco Small Business Series Managed Switches OpenSSH Vulnerability (CSCvo28588).

**Problem:** Cannot bind policy to all stack (4 units \* 48 ports) interfaces - limited to 129 interfaces (CSCvp43441).

**Problem:** RSTP - Tagged RPVST packets received on port are bridged on VLAN with double VLAN tag, this causes topology not to be stable (CSCvp43455).

**Problem:** FATAL ERROR ..GOAH. .VLIST was not built by adding ACL to max vlan range via GUI (CSCvp43467).

**Problem:** QoS - FATAL ERROR: POLI ABORT DATA exception - binding ACL to 2 interfaces causes device crash (CSCvp43473).

## Issues Addressed in Version 1.4.9.4

This release resolves the following bugs:

- High temperature alarm shutting ports. (CSCvf78994)
- Password field with autocomplete enabled. (CSCvc97869)
- Sx500 DHCP relay stops when ACL log-input configured. (CSCvd61441)
- ACL is matching only 50% of traffic via the port-channel, consisted of 2 physical links. (CSCvf84598)
- Sx300 and Sx500 Series Managed Switches cross-site scripting vulnerability. (CSCvg24637)

- Sx300 and Sx500 Series Managed Switches HTTP response splitting vulnerability. (CSCvg29980)
- When downgrade to an old image 1.4.7, image 1.4.8.6 is deleted. (CSCvg74842/CSCvg85110)
- QNAP server DHCP client cannot get an IP address. (CSCvi46892)

## Limitations and Restrictions

### The following caveats are acknowledged in firmware version 1.4.7.xx:

**Problem:** SG500X-48MP stacking with generic SFP—stack may not recover when disconnecting and reconnecting stack link. (CSCuz13705)

**Solution:** Use a DAC cable (SFP-H10GB-CU1M/3M/5M) for stacking. If the issue already occurred, reboot both units.

### The following caveats are acknowledged in firmware version 1.4.5.02:

There are no new acknowledged caveats in this release.

### The following caveats are acknowledged in firmware version 1.4.1.03:

**Problem:** When downloading (TFTP/HTTP) configuration to device - some commands, which were changed or deprecated before version 1.4.0.88, may not load correctly to the device.

**Solution:** Issue happens only if configuration file was copied/loaded from a device running an earlier version. If needed, backup configuration file (TFTP/HTTP) to server after upgrading device to version 1.4.1.3, and use this file as backup.

**Problem:** Port Settings page is not displayed correctly when using IE version 11 browser, in compatibility mode view.

**Solution:** Don't use IE compatibility mode or use other supported browsers, Firefox or Chrome.

**Problem:** SNTP Authentication, Remote Log Servers, and Port and VLAN Mirroring pages cannot be configured when using IE version 11 browser.

**Solution:** Use other supported browsers, Firefox or Chrome.

**Problem:** Vlan interface setting web page is not displayed correctly when using IE version 11 browser.

**Solution:** Use other supported browsers, Firefox or Chrome.

**Problem:** Using Chrome on MAC OS, for example, version 39.0.2171.71 (64-bit), in WEB GUI change configuration but not save, the WEB page will shakes.

**Solution:** Save configuration or use other browser, for example Firefox, IE.

### The following caveats are acknowledged in firmware version 1.4.0.x:

**Problem:** When Sx500 devices are connected in a ring topology, the IP mroute entry, learned through IGMP proxy, flaps. (CSCun67979)

**Solution:** There is no workaround.

**Problem:** VLAN1 cannot be configured as the secondary private VLAN. (CSCup22443)

**Solution:** There is no workaround.

**Problem:** MLD snooping does not work for Source Specific Multicast, if IPv6 is enabled on the VLAN interface. (CSCuq13229)

**Solution:** There is no workaround

**Problem:** DHCP relay stops working if the DHCP relay interface IP address is reassigned. (CSCuq13199)

**Solution:** Disable DHCP relay and then enable it again.

**Problem:** On Sx300 devices, the ISATAP tunnel configuration is lost after a firmware upgrade. This issue was noticed when firmware was upgraded to version 1.4.0. (CSCuq01246)

**Solution:** There is no workaround.

**Problem:** On Sx500 devices, the ISATAP tunnel type changes to Manual after the firmware upgraded to version 1.4.0, if the tunnel source is IP address or a physical port. (CSCuq01297)

**Solution:** There is no workaround.

**Problem:** After restart, the device is unable to send trap notifications to notification recipients, if the notification version is SNMPv2. (CSCuq00828)

**Solution:** There is no workaround.

**Problem:** LAG member port flaps if more than 4000 VLANs are added to the LAG at a time. (CSCuq00892)

**Solution:** Add fewer VLANs each time.

**Problem:** The ISATAP client can send RS packets only after the tunnel interface is restarted. (CSCuq03628)

**Solution:** There is no workaround.

**Problem:** Users are unable to set loop back interface IPv4 address as 192.168.1.x /24.

**Solution:** There is no workaround.

**Problem:** When using the 1G SFP module for the 5G or 10G stack port, such as the stack port of the SG500XG-8F8T, SG500X or Sx500 series switch, sometimes the stacking may have issues due to the limited bandwidth (1G), including packet loss and stack failure. (CSCur58273, CSCur58298)

**Solution:** Use the 10G SFP+ module for both 5G and 10G stack ports.

**Problem:** When using the 1G SFP module for the 5G or 10G stack port, such as the stack port of the SG500XG-8F8T, SG500X or Sx500 series switch, sometimes the stacking may have issues due to the limited bandwidth (1G), including packet loss and stack failure. (CSCur58273, CSCur58298)

**Solution:** When you first remove all telephony OUI items, and then save your settings and reboot the switch, the predefined telephony OUI items cannot be deleted and all telephony OUI items will be added automatically after boot up. (CSCuq92215)

**Solution:** Leave at least one telephony OUI item in the table so that all other telephony OUI items can be deleted successfully.

### The following caveats are acknowledged in release 1.3.7.18:

**Problem:** During SF500-24MP/48MP reset, the port GS4/S4 link is up for 5 seconds. (CSCum85751)

**Solution:** None.

### The following caveats are carried forward from release 1.3.5.58:

**Problem:** Sometimes on the SG500XG-8F8T, the 10G copper port goes up and down continuously if it is configured to a speed of 1G, and hence the stack experiences frame losses of around 3%. (CQ147378, CSCuj46317)

**Solution:** Configure Nikola switch ports in 1G speed to Auto-negotiation preferred master.

**Problem:** When setting a new key chain for RIP using the WEB GUI, if it does not include an accept-lifetime, it does not take effect, and only Key 1 takes effect with accept-lifetime. (CQ148403, CSCuh54765)

**Solution:** Use the CLI for entering the key chain, or enter both accept-lifetime and send-lifetime. Only use Key 1 with accept-lifetime.

**Problem:** WRR will lose efficacy after it is configured to egress shaping rate. (CQ146677, CSCuf82588)

**Solution:** Configure the WRR again.

**Problem:** When user tries to Telnet some other devices from switch, it takes a long time to logout. The user either needs to double click enter button or wait a long time to logout from the device and return to the switch. (CQ146113, CSCuj46177)

**Solution:** The only option is to either double click enter key or wait for a long time to logout.

**Problem:** On SG500XG-8F8T or SG500X, changing the stack mode from native to advanced-hybrid-xg causes the start-up configuration to be lost. (CQ148932, CSCui08988)

**Solution:** Backup startup-config file before changing the stack mode.

**Problem:** When the switch is used as a DHCP server, it always assigns its IP address as default router option (option 3), even if this option is not configured in the DHCP pool. Even if any other IP address is configured, the switch will still continue to provide option 3 as the configured IP to the client. (CQ149277, CSCui34225)

**Solution:** There is no workaround.

**Problem:** When the firmware is downgraded from 1.3.5.39 to 1.3.0.62, only the image for 1.3.0 exists in flash. This happens on all platforms. (CQ148803, CSCuj46205)

**Solution:** Copy the required image to flash again.

**Problem:** On stacking, some WEB GUI pages respond slowly. If 8 switches are stacked and 200 devices are connected, some WEB GUI pages take more than 10 seconds to respond. (CQ137261, CSCuj46218)

Some examples of such WEB GUI pages are:

- LLDP Neighbor Information.
- VLAN Management Interface Settings
- 802.1X Port Authentication
- Quality of Service Bandwidth
- Quality of Service Egress Shaping Per Queue

**Solution:** Wait until the web GUI pages respond or use CLI commands.

**Problem:** On SG500XG-8F8T switches, 1000BASE-T and 100BASE-TX modes only support frame sizes up to 9000 bytes. If the 10G copper port is configured in the 1G or 100M mode, and oversized frames are sent, the port drops the link. Shutting and then opening this port can bring up this port again. (CQ149642, CSCuj46378)

**Solution:** Limit frame size to 9000 bytes or less in 1000BASE-T mode.

**Problem:** For SX500 stacking, when the stack mode is changed from native to basic hybrid using the command: `stack basic-hybrid auto unit-id-auto reboot`, and the stack is reloaded then restarted with the default configuration, the startup configuration file is removed. (CQ150131, CSCuj37279)

**Solution:** Backup startup-config file before changing the stack mode.



**Problem:** When the Chinese localization file is installed on the SX500 stack master from TFTP on the web GUI, and the stack cable between master and backup unit is removed, the localization file is not installed on the backup unit. If CLI is used, or if the file is copied through http, this issue is not observed. (CQ150000, CSCuj46533)

**Solution:** Use HTTP to install localization file.

**Problem:** When the firmware is upgraded from 1.3.0 to 1.3.5, both firmware images (active and non active) are saved as 1.3.5 in the flash memory. (CQ148800, CSCuj46557)

**Solution:** There is no workaround.

**Problem:** When multiple different class PDs are connected to SF300-48PP, sometimes two or three ports are not delivered power although there is still power budget. This happens when Consumed Power is about 324 watt (86%) or more. (CQ147622, CSCuj46584)

**Solution:** There is no workaround.

**Problem:** The Stack Port LED on the System Summary page of the web GUI is inconsistent with front panel of SG500XG-8F8T. (CQ150109, CSCuj46594)

**Solution:** There is no workaround.

**Problem:** Users are unable to open IPv6 HTTP/HTTPS sessions on Apple Safari. (CQ147760, CSCuj46288)

**Solution:** Use Chrome or Internet Explorer.

**Problem:** In switch mode although multiple default gateways can be configured through CLI, only the gateway with lowest value can be active. Hence, switches should not allow the CLI to configure multiple default gateways. (CQ147302)

**Solution:** When modifying the default gateway through CLI, delete the old one first.

**Problem:** Some of the pages in the web-based interface require the Java Runtime Environment (JRE) to be installed, otherwise they may display incorrectly.

**Solution:** Install the latest JRE.

**Problem:** Granularity of traffic shaping on the following uplink ports starts with 2Mbps and not with 64Kbps. When configuring traffic shaping on these ports to rates lower than 2Mbps, the actual traffic shaping rate will be 2Mbps. (CQ123397, CQ130715, CQ133170)

- Sx200/Sx300 HW 1.0

- SF500 ports GE1-GE4
- SG500 ports GE-49 - GE52
- SG500X ports XG1 - XG4

**Solution:** Use the specified ports when traffic shaping is not required (for example, uplink or stack ports), or when the required traffic shaping rate is at least 2Mbps.

**Problem:** When the link on the SG500X ports XG1 - XG4 uplink ports comes up, the link may go up and down a few times then stabilize on the up state. (CQ135073)

**Solution:** There is no workaround.

**Problem:** After frequent changes of the stack topology from ring to chain and vice versa, one of the stack links might become non-operational (stuck in a state where even if the stack topology is ring, it will function as a chain). If the remaining operational stack link goes down, the stack might become non-operational. (CQ135108)

**Solution:** Wait for the stack to stabilize before changing its topology.

**Problem:** Copper SFP MGBT1 is not supported as stack port due to packet loss and bad CRC. (CQ135473)

**Solution:** Use Cisco approved SFPs.

**Problem:** When a PoE switch is connected to another PoE switch, one of the switches overcomes the internal power supply of the other PoE switch, so the other PoE switch cannot provide PoE power to powered devices. If the connection between these switches is removed, the switch that received power from the other switch will momentarily lose its power and reboot. (CQ135360, CQ138875)

**Solution:** Disable PoE on the ports connecting the two PoE switches.

**Problem:** Given a stack configuration with the stack master as unit #2. On the Port Vlan Membership page of the web-based interface, changing the value on the Interface Type drop-down, the drop-down returns to unit #1. The information displayed on the rest of the page belongs to the ports of the unit that was selected using the drop-down. (CQ141909)

**Solution:** There is no workaround.

**Problem:** The routing resource “Used number of hosts” is not displayed correctly. This is just a display issue, there is no user impact. (CQ133802)

**Solution:** There is no workaround.

**Problem:** In Layer 3 mode, SNTP Broadcast can only be operated from the CLI.

**Solution:** There is no workaround.

**Problem:** The EEE operational status should become disabled when Auto Negotiation is disabled. (CQ132106)

**Solution:** When the speed on a port is 1 Gigabit, auto negotiation has no effect on the EEE functioning state.

**Problem:** The Voice VLAN should be prevented from being set as Guest VLAN, and the user should receive a warning. This is not happening. (CQ132684)

**Solution:** Avoid setting the Voice VLAN as guest VLAN and vice-versa.

**Problem:** When the Mrouter learning mode is changed between “user defined” to “auto” and vice-versa, the IGMP Querier election process does not start. (CQ132805)

**Solution:** Disable IGMP Snooping and re-enable again, every time the Mrouter learning mode is changed to start the Querier election process.

**Problem:** Some WEB GUI pages require full version compatibility of JRE, Browser and JRE-Browser applets. For XML compatibility reasons, MSXML DLL Version 6 is required for IE browser users.

**Solution:** For download and installation information, refer to the following link: [www.microsoft.com/downloads/details.aspx?FamilyID=993C0BCF-3BCF-4009-BE21-27E85E1857B1&displaylang=en](http://www.microsoft.com/downloads/details.aspx?FamilyID=993C0BCF-3BCF-4009-BE21-27E85E1857B1&displaylang=en)

**Problem:** Notification Recipients table entry becomes uneditable with an incorrect or missing parameter. (CQ133316)

**Solution:** There will be an asterisk by any values for a table entry which are incorrect. This can be caused by the deletion of users, views, etc. If any of these values are incorrect, then the entry will be uneditable. First add the missing user, view, and so on, in order to edit the entry. The delete button still works regardless of whether the values are correct or not.

**Problem:** The result of cable length test for 100 meters is incorrect. It will show between 110 to 140 meters. (CQ132941)

**Solution:** There is no workaround.

**Problem:** The maximum number of IPv6 ACEs that can be applied on an interface is 244, not 512 as documented. The user receives the message “Cannot apply because of a lack of hardware resources.” (CQ130161)

**Solution:** There is no workaround.

**Problem:** If changing the active image with the menu CLI, the active image after reboot field is not updated. If you change the image number and reboot, then the image does change, but the display in the menu CLI is incorrect. (CQ132211)

**Solution:** There is no workaround.

**Problem:** When using the CLI, any time that DNS is used, the user is blocked from interacting with the CLI until the DNS lookup has completed. (CQ133234)

**Solution:** The user must wait until the DNS lookup has completed before issuing another command.

**Problem:** Egress rate shaping does not work as expected. Configuring egress shape on Gigabit ports or on Combo ports between 64k to 5000k, will always result in 2 Million Bits. This is resolved with the new hardware release 1.1.1.8. It still exists on HW V01. It also does not work on SG300-52/52P & SG200-52/52P switches and all uplink ports of Sx500 and SG500X. (CQ123397 and CQ130715)

**Solution:** There is no workaround.

**Problem:** SNTP synchronization error messages are not logged when an incorrect MD5 key leads to the loss of synchronization. (CQ132636)

**Solution:** There is no workaround for broadcast messages. For Unicast servers, in the SNTP server table the status message will either say "In process" or "Down" for those servers that have failed authentication.

**Problem:** PoE ports on certain Nikola switches might not power the connected powered devices (PD) when used along with Cisco IP Phone 7960 with PID=68-0808-xx. This issue impacts the following switch models:  
Switch SKUs: SG200-26P, SG200-50P, SG300-28P, SG500-28P, SG500-52P, SG500X-24P and SG500X-48P.

**Solution:** Use CAT 5 cables with 2 pair pins 1, 2, 3, and 6.

**Problem:** When configuring egress shaping rates on port 1, and enable flow control on port2, the whole vlan port egress rates will be the same. Flow control uses the whole buffer management scheme. When one port is configured to FC ALL ports are applied by the new scheme. QoS function on other ports will be effected also. (CQ144583)

**Solution:** When using QoS, disable the flow control function.

**Problem:** When managing a switch through the web-based interface, the loading time on some of the web pages can take a long time, approximately 3-10 seconds depending on the content in the tab. (CQ143850)

**Solution:** Use the command line interface instead.

**Problem:** When managing stacking switches through the web-based interface, the loading time on the following web pages is more than 10 seconds: (CQ14385 1)

- Status and Statistics
- Port Management
- VLAN Management
- Access Control
- Quality of Service

**Solution:** Use the command line interface instead.

**Problem:** If you modify an IPv6 tunnel configuration, the change will not take effect until you perform a *shut* then *no shut* on the tunnel interface. (CQ14607 1)

**Solution:** You must perform a *shut* then *no shut* the tunnel interface for it to take effect.

**Problem:** When a 10G DAC (Direct Attached Cable) is connected to the copper port of the SG500 using the last two ports (combo ports), the fiber link status display might be up even when the link is not active.

**Solution:** There is no workaround.

**Problem:** When enabling IPv6 unicast-routing, the interface cannot get an ipv6 address via auto-config. (CQ146156)

**Solution:** Configure the interface using a static IPv6 address.

## Japanese language files and firmware version compatibility guideline

Users will see a mismatch in the features between the English language and the Japanese language when running certain combinations of firmware and language files. Users will see new features added since version 1.1.1.6 in English instead of Japanese in the GUI when running firmware version 1.1.2.0 and higher subject to the following restriction:

- Japanese language files version 1.1.1.6 and older are forward compatible up to Firmware version 1.1.2.0. For example: loading a version 1.1.1.6 language file onto a device running firmware version 1.2.7.76 and up will fail.
- Japanese language files version 1.1.1.10 and newer are only compatible with firmware version 1.2.7.76 and newer.

## Where to Find Support

For current support information, visit the following URLs:

[www.cisco.com/cisco/web/solutions/small\\_business/products/routers\\_switches/500\\_series\\_switches/index.html](http://www.cisco.com/cisco/web/solutions/small_business/products/routers_switches/500_series_switches/index.html)

[www.cisco.com/cisco/web/solutions/small\\_business/products/routers\\_switches/300\\_series\\_switches/index.html](http://www.cisco.com/cisco/web/solutions/small_business/products/routers_switches/300_series_switches/index.html)

[www.cisco.com/cisco/web/solutions/small\\_business/products/routers\\_switches/200\\_series\\_switches/index.html](http://www.cisco.com/cisco/web/solutions/small_business/products/routers_switches/200_series_switches/index.html)

[www.cisco.com/go/smallbizsupport](http://www.cisco.com/go/smallbizsupport)



## Release Notes

---

---

Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL: [www.cisco.com/go/trademarks](http://www.cisco.com/go/trademarks). Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1110R)

© 2019 Cisco Systems, Inc. All rights reserved.