ıllıılıı cısco

Cisco ACI Virtual Edge Release Notes, Release 3.1(3)

Introduction

Cisco Application Centric Infrastructure (ACI) Virtual Edge is a hypervisor-independent distributed service virtual machine (VM) that is specifically designed for Cisco ACI. It leverages the native distributed virtual switch that belongs to the hypervisor. Cisco ACI Virtual Edge runs in the user space, operates as a virtual leaf, and is managed by Cisco APIC.

Cisco ACI Virtual Edge is supported as a vLeaf for Cisco APIC with the VMware ESXi hypervisor. It manages a data center defined by the VMware vCenter Server. If you use Cisco AVS, you can migrate to Cisco ACI Virtual Edge; if you use VMware VDS, you can run Cisco ACI Virtual Edge on top of it.

The Cisco Application Centric Infrastructure (ACI) is an architecture that allows the application to define the networking requirements in a programmatic way. This architecture simplifies, optimizes, and accelerates the entire application deployment lifecycle. Cisco Application Policy Infrastructure Controller (APIC) is the software, or operating system, that acts as the controller.

This document describes the features, issues, and limitations for the Cisco ACI Virtual Edge software. Use this document with the <u>Cisco Application Policy Infrastructure Controller Release Notes</u>, Release 3.1(3).

For more information about this product, see "Related Content."

Note: The documentation set for this product strives to use bias-free language. For the purposes of this documentation set, bias-free is defined as language that does not imply discrimination based on age, disability, gender, racial identity, ethnic identity, sexual orientation, socioeconomic status, and intersectionality. Exceptions may be present in the documentation due to language that is hardcoded in the user interfaces of the product software, language used based on RFP documentation, or language that is used by a referenced third-party product.

Date	Description
April 15, 2021	Updated the Limitations and Restrictions section. Information was added for transient faults raised and cleared due to heart beat timeouts.
February 1, 2021	Release 3.1(3b) became available.

New Software Features

There are no new software features in this release.

Changes in Behavior

There are no changes in behavior in this release.

Open Issues

Click the bug ID to access the Bug Search tool and see additional information about the bug. The "Exists In" column of the table specifies the 3.1(3) releases in which the bug exists. A bug might also exist in releases other than the 3.1(3) releases.

Bug ID	Description	Exists in
CSCvj58344	When control channel (OpFlex) from Cisco ACI Virtual Edge to the physical leaf is down, any port that attaches and then detaches before OpFlex comes back will remain in Cisco ACI Virtual Edge indefinitely. No functional impact since the actual port has already gone away.	3.1(3b) and later

Resolved Issues

There are no resolved issues in this release.

Known Issues

Click the bug ID to access the Bug Search tool and see additional information about the bug. The "Exists In" column of the table specifies the 3.1(3) releases in which the bug exists. A bug might also exist in releases other than the 3.1(3) releases.

Bug ID	Description	Exists in
CSCvq87091	When moving a port with vMotion—and some external factors, such as network or storage failure occur—the port detaches on the source host. If the port is actively sending packets, it re-attaches immediately. For a silent host, the port remains detached until it sends some traffic.	3.1(3b) and later
CSCvh06525	When doing a bulk vMotion of 50 or more ports, the ports take additional time to come up and start forwarding traffic. We see delays of about 30 seconds to two minutes for the very last port to come up when doing vMotion of 300 ports. Some ports forward traffic much earlier as they are in the front of the vMotion queue.	3.1(3b) and later
CSCvj59097	If a bridge domain multicast is configured with optimized flood and is moved by vMotion, the subscriber to another policy group that is another VPC or other top-of-rack pair can cause loss of reception of up to the maximum configured querier interval time.	3.1(3b) and later
CSCvj74270	Traffic loss is seen on VMs when disconnecting and reconnecting Cisco ACI Virtual Edge VM NICs from VMware vCenter.	3.1(3b) and later
CSCvq63041	Cisco ACI Virtual Edge—when not part of Cisco ACI Virtual Pod—fails to come up. In the kernel logs, we see logs similar to the following one, showing that it was blocked for more than 2 minutes:	3.1(3b) and later
	Jul 21 22:09:26 localhost kernel: INFO: task jbd2/dm-21-8:3051 blocked for more than 120 seconds.	
	Or you see logs similar to the following ones, in which the writes were blocked for more than 8 minutes:	
	Jul 21 22:01:47 localhost systemd[1]: Started Process Monitoring and Control Daemon.	
	Jul 21 22:09:26 localhost systemd-journal[3700]: Permanent journal is using 16.0M (max allowed 594.7M, trying to leave 892.0M free of 5.4G available	
N/A	The Process vemfwd Always runs at 100% of CPU: The Cisco ACI Virtual Edge process vemfwd always runs at 100% of CPU. This is by design; Cisco ACI Virtual Edge always runs at a high CPU on one core to accommodate the Data Plane Development Kit (DPDK).	3.1(3b) and later

Bug ID	Description	Exists in
N/A	False Memory Fault in VMware vCenter: The Cisco ACI Virtual Edge VM can trigger a false memory fault in VMware vCenter. This is a cosmetic issue. For performance reasons, the latency sensitivity of the Cisco ACI Virtual Edge VM is set to high. This setting is known to trigger false positives in VMware vCenter.	3.1(3b) and later
	See the following article on the VMware website: Memory usage alarm triggers for certain types of Virtual Machines in ESXi 6.x (2149787).	
N/A	Permission Denied for some Files on vem-support with Admin Login: When you log in as an administrator, you may be denied some files when you enter a vem-support command. However, you can use one of two methods to get the files:	3.1(3b) and later
	Generate a log bundle by entering a command in the Cisco APIC GUI:	
	 Go to Admin > Import/Export > Export Policies > AVE/AVS Tech Support. 	
	 Right-click AVE/AVS Tech Support and choose Create AVS Tech Support. 	
	 In the Create AVE/AVS Tech Support dialog box, create a tech support export policy, which creates an archive file containing configuration information, logs, and diagnostic data that will help Cisco Technical Assistance Center (TAC) with troubleshooting and resolving a technical issue. 	
	 Enter sudo mode and run the vem-support all command, as shown in the following example: 	
	cisco-ave_192.0.2.162_AVE-Lag:~\$ su	
	Password:	
	cisco-ave_192.0.2.162_AVE-Lag:admin# vem-support all	
N/A	Brief Delay Possible When Switching EPG from Native to AVE Mode: Changing the switching mode from Native to AVE (Cisco ACI Virtual Edge) on an EPG requires changing the underlying switching platform from regular VMware DVS to Cisco ACI Virtual Edge. It also requires moving all the associated ports from DVS to Cisco ACI Virtual Edge.	3.1(3b) and later
	This operation requires reprogramming of the port group associated with that EPG. That in turn requires a VMware vCenter operation. This operation may take a few seconds to complete and for ports to show up in forwarding state on the Cisco ACI Virtual Edge switching platform. The length of time depends on the VMware vCenter load as well as the number of endpoints that reside on the EPG that is being moved from Native to AVE mode.	
N/A	LACP Policy Not Applied on Port Channel: When a Link Aggregation Control Protocol (LACP) policy is applied as a vSwitch policy for the VMM domain, the LACP policy is applied only to the VMware vSphere Distributed Switch (VDS) uplinks. However, it is not applied to the Cisco ACI Virtual Edge port channel.	3.1(3b) and later
	This is expected behavior. Cisco ACI Virtual Edge does not support LACP on its uplinks because VDS does not support it for its virtual Ethernet (vEth) interfaces. So, the VMM port channel policy is applied only for the VDS uplinks.	

Bug ID	Description	Exists in
N/A	Fault Raised After Process Crash Regardless of When Crash Occurred: A fault for an invalid port group is raised on Cisco ACI Virtual Edge downgrades earlier than 2.0(1a). In Cisco ACI Virtual Edge Release 2.0(1a), a new port group, outside-cloud, is created for the Cisco ACI Virtual Edge VMM. When Cisco ACI Virtual Edge is downgraded to pre-2.0(1a) releases, the port group is removed from Cisco APIC but not from VMware vCenter.	3.1(3b) and later
	To avoid this fault, manually delete the port group outside-cloud from the VMware vCenter if you have an existing Cisco ACI Virtual Edge domain and you are downgrading from Cisco APIC 4.0(1h) or later.	

Limitations and Restrictions

General

L3 Multicast is not supported on bridge domains with endpoints after AVE.

Hypervisor Availability

Cisco ACI Virtual Edge is available only on the VMware hypervisor.

VMware vSphere Support

Cisco ACI Virtual Edge is supported only on VMware vSphere 6.0 and later versions.

Cisco ACI Virtual Edge Deployment

The server where you install Cisco ACI Virtual Edge must have an Intel Nehalem CPU or later. You also must set the cluster Enhanced vMotion Compatibility (EVC) to a Nehalem CPU or later. See the knowledge base article Enhanced vMotion Compatibility (EVC) processor support (1003212) on the VMware web site.

We recommend that you install only one Cisco ACI Virtual Edge virtual machine (VM) on each host.

Removing Cisco ACI Virtual Edge or the ESXi host from the VMware vCenter and then adding it back in is not supported. If you do that, Cisco ACI Virtual Edge loses password, infra VLAN, IP address, and other key configurations. You should instead delete the original Cisco ACI Virtual Edge and deploy a new one.

After you deploy Cisco ACI Virtual Edge, if the Cisco ACI Virtual Edge VM is moved across VMware vCenter, all the configurations that you made during deployment are lost.

Transient Fault, F3278, is raised and cleared due to Heart Beat (HB) timeouts that happen between AVE and leaf switches. The fault clears when the next HB is seen on AVE.

Management Interface IP Address

The Cisco ACI Virtual Edge management interface must have an IPv4 address. It can have an additional IPv6 address, but you cannot configure it with only an IPv6 address.

VMware vSphere vMotion Support

VMware vSphere vMotion is supported for endpoints but not supported for Cisco ACI Virtual Edge itself.

Note: After you migrate VMs using cross-data center VMware vMotion in the same VMware vCenter, you may find a stale VM entry under the source DVS. This stale entry can cause problems, such as host removal failure. The workaround for this problem is to enable "Start monitoring port state" on the vNetwork DVS. See the KB topic "Refreshing port state information for a vNetwork Distributed Virtual Switch" on the VMware Web site for instructions.

Features Not Supported for Cisco ACI Virtual Edge with Multipod

The following features are not supported for Cisco ACI Virtual Edge with multipod:

- Storage vMotion with two separate NFS in two separate PODs
- ERSPAN destination in different PODs
- Distributed Firewall syslog server in different PODs

Features Not Supported for Cisco ACI Virtual Edge when It Is Part of Cisco ACI vPod

Cisco ACI Virtual Edge is not supported for the following features when it is part of Cisco ACI vPod:

- VMware vSphere Proactive HA
- SPAN and ERSPAN
- Subnets configured under endpoint group EPGs

Pre-provisioning Not Supported for EPG Resolution Immediacy

When you set EPG resolution immediacy, Cisco ACI Virtual Edge does not support pre-provisioning, which downloads a policy to a switch before the switch is installed.

VMware Fault Tolerance and Distributed Firewall

When VMware Fault Tolerance failover occurs, Cisco ACI Virtual Edge cannot transfer pods because no VMware vMotion is involved in the failover. When that occurs, you need to reestablish all TCP sessions. This issue occurs regardless of whether Cisco ACI Virtual Edge is part of a Cisco ACI Virtual Pod.

Unsupported Operations in VMware vCenter

Any manual modification and override of Cisco ACI Virtual Edge portgroups in VMWare vCenter or modification of the interface connection states in Cisco ACI Virtual Edge are not supported. Making these modifications might render the Cisco ACI Virtual Edge unstable.

MAC Pinning Not Supported with Direct Connection to VPC Leaf Pair

Do not use MAC pinning with a direct connection to a VPC leaf pair. Instead, use Link Aggregation Control Protocol (LACP) or enhanced LACP to provide redundancy and reliability. Using MAC pinning with a direct connection leads to traffic loss when peer leaf switches are rebooted. Use MAC Pinning only where virtual port channel (VPC) cannot be supported, such as for Cisco UCS Fabric Interconnects with southbound interfaces.

Compatibility Information

This section lists virtualization compatibility information for the Cisco APIC software.

- For a table that shows the supported virtualization products, see the <u>ACI Virtualization Compatibility</u>
 <u>Matrix</u>.
- For information about Cisco APIC compatibility with Cisco UCS Director, see the appropriate <u>Cisco UCS Director Compatibility Matrix</u> document.
- If you use Microsoft vSwitch and want to downgrade to Cisco APIC Release 2.3(1) from a later release, you first must delete any microsegment EPGs configured with the **Match All** filter.
- This release supports the following additional virtualization products:

Product	Supported Release	Information Location
VMware ESXI hypervisor	6.0 and later versions.	N/A
Cisco APIC	5.1(3e)	Cisco APIC and ACI Virtual Edge Support Matrix
Virtualization interoperability	5.1(3e)	Cisco ACI Virtualization Compatibility Matrix

Compatibility and Upgrade and Downgrade Considerations

Support Matrix

The Cisco APIC and ACI Virtual Edge Support Matrix is an interactive tool that enables you to choose an APIC version and view the compatible Cisco ACI Virtual Edge, vSphere, and compatible Cisco APIC versions.

Cisco ACI Virtual Edge Upgrade Method

You must use the Cisco ACI vCenter plug-in to upgrade Cisco ACI Virtual Edge. See the chapter "Cisco ACI Virtual Edge Upgrade" in the Cisco ACI Virtual Edge Installation Guide, Release 3.0(x) on Cisco.com for upgrade instructions.

Number of IP Addresses when Upgrading Cisco ACI Virtual Edge

If you use static or DHCP IP pools and want to upgrade Cisco ACI Virtual Edge, ensure that you have enough IP addresses. There must be more IP addresses in the static or DHCP pools than there are in the Cisco ACI Virtual Edge service VMs in the data center in VMware vCenter. Otherwise, the upgrade of the new Cisco ACI Virtual Edge will fail.

Scalability

Scalability information about Cisco ACI Virtual Edge is available in the *Verified Scalability Guide for Cisco APIC, Release 5.1(3), Multi-Site, Release 3.2(1), and Cisco Nexus 9000 Series ACI-Mode Switches, Release 15.1(3).*

Related Content

See the Cisco Application Policy Infrastructure Controller (APIC) page for the documentation.

The documentation includes installation, upgrade, configuration, programming, and troubleshooting guides, technical references, release notes, and knowledge base (KB) articles, as well as other documentation. KB articles provide information about a specific use case or a specific topic.

By using the "Choose a topic" and "Choose a document type" fields of the APIC documentation website, you can narrow down the displayed documentation list to make it easier to find the desired document.

You can watch videos that demonstrate how to perform specific tasks in the Cisco APIC on the <u>Cisco Data Center Networking</u> YouTube channel.

Temporary licenses with an expiry date are available for evaluation and lab use purposes. They are strictly not allowed to be used in production. Use a permanent or subscription license that has been purchased

through Cisco for production purposes. For more information, go to <u>Cisco Data Center Networking</u> Software Subscriptions.

The following table provides links to the related documentation:

Document	Description
Cisco ACI Virtual Edge Installation Guide, Release 3.0(x)	Provides installation, upgrade, and migration information for Cisco ACI Virtual Edge.
Cisco ACI Virtual Edge Configuration Guide, Release 3.0(x)	Provides configuration information for Cisco ACI Virtual Edge.
Cisco ACI Virtual Edge Health Status	Provides information for monitoring health of Cisco ACI Virtual Edge, including viewing and troubleshooting faults.

Documentation Feedback

To provide technical feedback on this document, or to report an error or omission, send your comments to apic-docfeedback@cisco.com. We appreciate your feedback.

Legal Information

Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL:

http://www.cisco.com/go/trademarks. Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1110R)

Any Internet Protocol (IP) addresses and phone numbers used in this document are not intended to be actual addresses and phone numbers. Any examples, command display output, network topology diagrams, and other figures included in the document are shown for illustrative purposes only. Any use of actual IP addresses or phone numbers in illustrative content is unintentional and coincidental.

© 2021 Cisco Systems, Inc. All rights reserved.