



Troubleshooting of Data Path Alarms

This chapter provides a description, severity, and troubleshooting procedure for each commonly encountered Cisco NCS 1010 data path alarm and condition. When an alarm is raised, refer to its clearing procedure.

- [EGRESS-AMPLI-GAIN-HIGH](#), on page 1
- [EGRESS-AMPLI-GAIN-LOW](#), on page 2
- [EGRESS-AUTO-LASER-SHUT](#), on page 2
- [EGRESS-AUTO-POW-RED](#), on page 3
- [HIGH-RX-BR-PWR](#), on page 3
- [HIGH-TX-BR-PWR](#), on page 4
- [INGRESS-AMPLI-GAIN-HIGH](#), on page 4
- [INGRESS-AMPLI-GAIN-LOW](#), on page 5
- [INGRESS-AUTO-LASER-SHUT](#), on page 5
- [INGRESS-AUTO-POW-RED](#), on page 6
- [RAMAN-AUTO-LASER-SHUT](#), on page 6
- [RAMAN-AUTO-POW-RED](#), on page 6
- [RAMAN-\[1-5\]-HIGH-PWR](#), on page 7
- [RAMAN-\[1-5\]-LOW-PWR](#), on page 7
- [RX-LOC](#), on page 8
- [RX-LOS-P](#), on page 8
- [SPAN-TOO-SHORT-RX](#), on page 8
- [SPAN-TOO-SHORT-TX](#), on page 9
- [TD-FAILED](#), on page 9
- [TD-INPROGRESS](#), on page 10
- [TD-SUCCESS](#), on page 10
- [TG-INPROGRES](#), on page 10
- [TX-POWER-FAIL-LOW](#), on page 11

EGRESS-AMPLI-GAIN-HIGH

Default Severity: Non Service-Affecting (NSA)

Logical Object: Controller OTS

The EGRESS-AMPLI-GAIN-HIGH alarm is raised when the EGRESS EDFA module cannot reach the gain setpoint. This condition occurs if the amplifier reaches its range boundaries and the Egress Amplifier Gain Degrade is high.

Clear the EGRESS-AMPLI-GAIN-HIGH Alarm

Step 1 Adjust the gain setting to a correct value.

If the APC value is set to the disabled state, the applied gain results from the configuration. Therefore, you must adjust the gain setting to a high value.

Step 2 Check the overall system settings, performance, and the configured EDFA Gain.

If the APC value is set to the enabled state, it may be due to an unexpected long or short span, or due to other measured channels. If the alarm persists, it may indicate an amplifier hardware failure.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

EGRESS-AMPLI-GAIN-LOW

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The EGRESS-AMPLI-GAIN-LOW alarm is raised when the Egress Amplifier Gain Degrade is Low.

Clear the EGRESS-AMPLI-GAIN-LOW Alarm

Step 1 Adjust the gain setting to a correct value.

If the APC value is set to the disabled state, the applied gain results from the configuration. Therefore, you must adjust the gain setting to a low value.

Step 2 Check the overall system settings, performance, and the configured EDFA Gain.

If the APC value is set to the enabled state, it may be due to an unexpected long or short span, or due to other measured channels. If the alarm persists, it may indicate an amplifier hardware failure.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

EGRESS-AUTO-LASER-SHUT

Default Severity: Not Alarmed (NA), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The EGRESS-AUTO-LASER-SHUT alarm is raised for safety concerns. If the safety-control-mode is set to the auto state on line OTS controller, the Egress EDFA shuts down its Tx power if it is not receiving on the Line Rx port due to a fiber cut.

Clear the EGRESS-AUTO-LASER-SHUT Alarm

Step 1 For controller OTS, check the RX-LOC or RX-LOS-P alarm.

Step 2 Ensure that the fiber is properly plugged and there is no fiber cut on the span.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

EGRESS-AUTO-POW-RED

Default Severity: Not Alarmed (NA), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The EGRESS-AUTO-POW-RED alarm is raised when the egress amplifier is in power reduction mode for safety reasons.

Clear the EGRESS-AUTO-POW-RED Alarm

Step 1 For Controller OTS, check if the APR configuration is active.

Step 2 Check if the safety conditions of the Egress EDFA are active for APR.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

HIGH-RX-BR-PWR

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The HI-RX-BR-PWR alarm is raised when there is a high back reflection power at the ingress port

Clear the HIGH-RX-BR-PWR Alarm

Clean the fiber and port, and reconnect the fiber to the port.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

HIGH-TX-BR-PWR

Default Severity: Critical (CR), Service-Affecting (SA)

Logical Object: Controller OTS

The HI-TX-BR-PWR alarm is raised when there is a high back reflection power at the egress port.

Clear the HIGH-TX-BR-PWR Alarm

Clean the fiber and port, and reconnect the fiber to the port.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

INGRESS-AMPLI-GAIN-HIGH

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The INGRESS-AMPLI-GAIN-HIGH alarm is raised when the Ingress EDFA module cannot reach the gain setpoint. This condition occurs if the amplifier reaches its range boundaries.

Clear the INGRESS-AMPLI-GAIN-HIGH Alarm

Step 1 Adjust the gain setting to a correct value.

If the APC value is set to the disabled state, the applied gain results from the configuration. Therefore, you must adjust the gain setting to a high value.

Step 2 Check the overall system settings, performance, and the configured EDFA Gain.

If the APC value is set to the enabled state, it may be due to an unexpected long or short span, or due to other measured channels. If the alarm persists, it may indicate an amplifier hardware failure.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

INGRESS-AMPLI-GAIN-LOW

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The INGRESS-AMPLI-GAIN-LOW alarm is raised when the Ingress EDFA module cannot reach the gain setpoint. This condition occurs if the amplifier reaches its range boundaries.

Clear the INGRESS-AMPLI-GAIN-LOW Alarm

Step 1 Adjust the gain setting to a correct value.

If the APC value is set to the disabled state, the applied gain results from the configuration. Therefore, you must adjust the gain setting to a high value.

Step 2 Check the overall system settings, performance, and the configured EDFA Gain.

If the APC value is set to the enabled state, it may be due to an unexpected long or short span, or due to other measured channels. If the alarm persists, it may indicate an amplifier hardware failure.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

INGRESS-AUTO-LASER-SHUT

Default Severity: Not Alarmed (NA), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The INGRESS-AUTO-LASER-SHUT alarm is raised when the ingress amplifier is off for safety Reasons.

Clear the INGRESS-AUTO-LASER-SHUT Alarm

Step 1 For the controller OTS, check the RX-LOC or RX-LOSP alarm.

Step 2 Check if the safety conditions of the Ingress EDFA ALS are active.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

INGRESS-AUTO-POW-RED

Default Severity: Not Alarmed (NA), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The INGRESS-AUTO-POW-RED alarm is raised when the ingress amplifier is in power reduction mode for safety reasons.

Clear the INGRESS-AUTO-POW-RED Alarm

For controller OTS, check if the APR configuration is active. Step 2: Check if the safety conditions of the Ingress EDFA for APR are active.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

RAMAN-AUTO-LASER-SHUT

Default Severity: Not Alarmed (NA), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The RAMAN-AUTO-LASER-SHUT alarm is raised when the raman pumps are off for safety reasons.

Clear the RAMAN-AUTO-LASER-SHUT Alarm

Step 1 For the line OTS controller, check the RX-LOC or RX-LOSP alarm.

Step 2 Check if the safety conditions of the Raman are active.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

RAMAN-AUTO-POW-RED

Default Severity: Not Alarmed (NA), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The RAMAN-AUTO-POW-RED alarm is raised when the Raman amplifier is in power reduction mode for safety reasons.

Clear the RAMAN-AUTO-POW-RED Alarm

Step 1 For the line OTS controllers, check if the APR configuration for Raman is active.

Step 2 Check if the safety conditions of the Raman for APR are active.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

RAMAN-[1-5]-HIGH-PWR

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The RAMAN-[1-5]-HIGH-PWR alarm is raised when the Raman [1-5] pumps have high power.

Clear the RAMAN-[1-5]-HIGH-PWR Alarm

Check the span length and configured Raman pump power for controller OTS.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

RAMAN-[1-5]-LOW-PWR

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The RAMAN-[1-5]-LOW-PWR alarm is raised when the raman [1-5] pumps have low power.

Clear the RAMAN-[1-5]-LOW-PWR Alarm

Check the span length and configured Raman pump power for controller OTS.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

RX-LOC

Default Severity: Critical (CR), Service-Affecting (SA)

Logical Object: Line OTS Controller

The RX-LOC alarm is raised when there is a loss in the fiber connection continuity.

Clear the RX-LOC Alarm

To clear this alarm, check for missing fiber connection or a fiber cut.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

RX-LOS-P

Default Severity: Critical (CR), Service-Affecting (SA)

Logical Object: Controller DFB, Controller OSC, Controller OTS-OCH, Controller OMS, Controller OTS, or Controller OCH

The RX-LOS-P alarm is raised when there is a loss of signal payload.

Clear the RX-LOS-P Alarm

Step 1 Check if the threshold setting is as per the expected system performance.

Step 2 Check if the received power is fine.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

SPAN-TOO-SHORT-RX

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The SPAN-TOO-SHORT-RX alarm is raised when the input of the OTS span is too short.

Clear the SPAN-TOO-SHORT-RX Alarm

Check for fiber damage on the RX fiber or increase the span of the fiber.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

SPAN-TOO-SHORT-TX

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS

The SPAN-TOO-SHORT-TX alarm is raised when the output of the OTS span is too short.

Clear the SPAN-TOO-SHORT-TX Alarm

Check for fiber damage on the TX fiber or increase the span of the fiber.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

TD-FAILED

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS, Controller OMS, or Controller OCH

The TD-FAILED alarm is raised when the Tone Detection fails.

Clear the TD-FAILED Alarm

This alarm can be cleared when the user stops Tone Detection on the corresponding controller.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

TD-INPROGRESS

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS, Controller OMS, or Controller OCH

The TD-INPROGRESS alarm is raised when the Tone Detection is in progress.

Clear the TD-INPROGRESS Alarm

This alarm can be cleared when the user stops the Tone Detection on the corresponding controller.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

TD-SUCCESS

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS, Controller OMS, or Controller OCH

The TD-SUCCESS alarm is raised when the Tone Detection passes.

Clear the TD-SUCCESS Alarm

This alarm can be cleared when the user stops the Tone Detection on the corresponding controller.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

TG-INPROGRES

Default Severity: Minor (MN), Non-Service-Affecting (NSA)

Logical Object: Controller OTS, Controller OMS, or Controller OCH

The TG-INPROGRES alarm is raised when the Tone Generation is in progress.

Clear the TG-INPROGRES Alarm

This alarm can be cleared when the user stops the Tone Generation on the corresponding controller.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

TX-POWER-FAIL-LOW

Default Severity: Critical (CR), Service-Affecting (SA)

Logical Object: Controller DFB, Controller OSC, Controller OTS-OCH, Controller OMS, or Controller OCH

The TX-POWER-FAIL-LOW alarm is raised when the output of the OTS power reading is below the Fail-Low threshold.

Clear the TX-POWER-FAIL-LOW Alarm

- Step 1** Check if the threshold settings are as per the expected system performance.
- Step 2** Check if the corresponding receiving power is correct. For example, an OTS Controller 2 TX receives power from the controller 0 RX.
- Step 3** Check the EDFA gain value.
- Step 4** Check for any hardware failure.

If the alarm does not clear, log into the Technical Support Website at <http://www.cisco.com/c/en/us/support/index.html> for more information or call Cisco TAC (1 800 553-2447).

Clear the TX-POWER-FAIL-LOW Alarm