



APPENDIX **A**

Caveats

The following known caveats are available for consideration accompanied by defect ID's.

1. **Bug ID 1087571**—The commands which have been introduced in neutron client version 2.3.4 may fail.
2. **Bug ID 1087574**—The service openstack-cinder-volume may fail to start automatically after a reboot of the control server. To work around this, start the service manually after every reboot, or use the following command to enable autostart:

```
chkconfig openstack-cinder-volume on
```
3. **Bug ID 1087576**—The snapshot feature may fail with the error `libvirtError: unsupported configuration: block copy is not supported with this QEMU binary`.
4. **Bug ID 1087579**—The feature Boot from image (Create a new volume) may fail with the error `Instance failed block device setup`.

