

Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)



## Cisco MDS 9000 Family Release Notes for Cisco MDS NX-OS Release 4.2(1a)

**Release Date:** September 25, 2009

**Part Number:** OL-19964-02 W0

This document describes the caveats and limitations for switches in the Cisco MDS 9000 Family. Use this document in conjunction with documents listed in the “[Related Documentation](#)” section on page 49.



**Note**

As of Cisco Fabric Manager Release 4.2(1), Fabric Manager information will no longer appear in the Cisco MDS 9000 Family Release Notes for NX-OS releases. Cisco Fabric Manager Release Notes will include information that is exclusive to Fabric Manager as a management tool for Cisco MDS 9000 Family switches and Cisco Nexus 5000 Series switches. Refer to the following website for Release Notes for Cisco Fabric Manager:

[http://www.cisco.com/en/US/products/ps10495/prod\\_release\\_notes\\_list.html](http://www.cisco.com/en/US/products/ps10495/prod_release_notes_list.html)

Release notes are sometimes updated with new information on restrictions and caveats. Refer to the following website for the most recent version of the *Cisco MDS 9000 Family Release Notes*:

[http://www.cisco.com/en/US/products/ps5989/prod\\_release\\_notes\\_list.html](http://www.cisco.com/en/US/products/ps5989/prod_release_notes_list.html)

[Table 1](#) shows the on-line change history for this document.

**Table 1** Online History Change

Revision	Date	Description
A0	09/25/2009	Created release notes.
B0	10/06/2009	Removed NX-OS Release 4.2(1a) from <a href="#">Table 11, FICON Supported Releases</a> .
C0	10/09/2009	Added DDTs <a href="#">CSCta11417</a> .
D0	10/13/2009	Added DDTs <a href="#">CSCtc41865</a> .
E0	10/14/2009	Added DDTs <a href="#">CSCtc41625</a> and updated the “ <a href="#">I/O Accelerator Feature Limitations</a> ” section.
F0	10/15/2009	Changed the state of DDTs <a href="#">CSCta22244</a> to Resolved.



**Americas Headquarters:**  
Cisco Systems, Inc., 170 West Tasman Drive, San Jose, CA 95134-1706 USA

© 2009 Cisco Systems, Inc. All rights reserved.

**[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

**Table 1 Online History Change (continued)**

Revision	Date	Description
G0	10/16/2009	Updated the Symptom description of DDTS <a href="#">CSCta11417</a> .
H0	11/13/2009	Added DDTS <a href="#">CSCtc48338</a> .
I0	11/18/2009	Added DDTS <a href="#">CSCtb77695</a> and <a href="#">CSCtc20849</a> .
J0	12/02/2009	Clarified the wording of the “Support for Generation 1 Modules” section.
K0	12/14/2009	Added DDTS <a href="#">CSCsz59152</a> .
L0	12/23/2009	Added DDTS <a href="#">CSCtc04286</a> and DDTS <a href="#">CSCtd16646</a> .
M0	01/26/2010	Added DDTS <a href="#">CSCsy73212</a> and <a href="#">CSCsz84411</a> .
N0	04/12/2010	Added the “Determining Software Version Compatibility” section.
O0	07/27/2010	Added the “PPRC Not Supported with FCIP Write Acceleration” limitation.
P0	10/12/2010	Added DDTS <a href="#">CSCtc65441</a> . Added the Cisco MDS 9500 Series Supervisor-2A module to <a href="#">Table 2</a> .
Q0	11/09/2010	Added DDTS <a href="#">CSCta28484</a> .
R0	02/09/2011	Updated the “Licensed Cisco NX-OS Software Packages” section.
S0	09/09/2011	Added the “Configuring a Persistent FCID in an IVR Configuration with Brocade Switches” section.
T0	03/11/2012	Updated <a href="#">Table 10</a> and <a href="#">Table 13</a> .
U0	05/03/2012	Updated <a href="#">Table 10</a> . Added open caveat <a href="#">CSCty32238</a> .
V0	05/18/2012	Added the section.
W0	05/18/2012	Added the “Converting Automatically Created PortChannels Before an Upgrade” section.

## Contents

This document includes the following:

- [Introduction, page 3](#)
- [Components Supported, page 3](#)
- [MDS 9000 Chassis and Module Support in Cisco MDS NX-OS 4.x, page 10](#)
- [Migrating from Supervisor-1 Modules to Supervisor-2 Modules, page 12](#)
- [Software Download Process, page 12](#)
- [Upgrading Your Cisco MDS NX-OS Software Image, page 15](#)
- [Downgrading Your Cisco MDS SAN-OS Software Image, page 23](#)
- [New Features in Cisco MDS NX-OS Release 4.2\(1a\), page 26](#)

**[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

- [Licensed Cisco NX-OS Software Packages, page 31](#)
- [Limitations and Restrictions, page 33](#)
- [Caveats, page 40](#)
- [Related Documentation, page 49](#)
- [Obtaining Documentation and Submitting a Service Request, page 52](#)

## Introduction

The Cisco MDS 9000 Family of Multilayer Directors and Fabric Switches provides industry-leading availability, scalability, security, and management, allowing you to deploy high performance storage-area networks with lowest total cost of ownership. Layering a rich set of intelligent features onto a high performance, protocol agnostic switch fabric, the Cisco MDS 9000 Family addresses the stringent requirements of large data center storage environments: uncompromising high availability, security, scalability, ease of management, and seamless integration of new technologies.

Cisco MDS 9000 NX-OS Software powers the award winning Cisco MDS 9000 Series Multilayer Switches. It is designed to create a strategic SAN platform with superior reliability, performance, scalability, and features. Formerly known as Cisco SAN-OS, Cisco MDS 9000 NX Software is fully interoperable with earlier Cisco SAN-OS versions and enhances hardware platform and module support.

## Components Supported

[Table 2](#) lists the NX-OS software part numbers and hardware components supported by the Cisco MDS 9000 Family.



### Note

To use the Cisco Storage Services Enabler package, Cisco MDS SAN-OS Release 1.3(5) or later must be installed on the MDS switch.

**Table 2** *Cisco MDS 9000 Family Supported Software and Hardware Components*

Component	Part Number	Description	Applicable Product
Software	M95S2K9-4.2.1a	MDS 9500 Supervisor/Fabric-2, NX-OS software	MDS 9500 Series only
	M92S2K9-4.2.1a	MDS 9200 Supervisor/Fabric-2, NX-OS software	MDS 9222i Switch only
	M92S1K9-4.2.1a	MDS 9216i Supervisor/Fabric-I, NX-OS software	MDS 9216i Switch only
	M91S2K9-4.2.1a	MDS 9100 Supervisor/Fabric-2, NX-OS software	MDS 9124 Switch and MDS 9134 Switch
SSI Interface	SSI-M9K9-421a	Storage Services Interface for NX-OS Release 4.2(1a)	MDS 9000 Family
Licenses	M9500SSE184K9	Storage Services Enabler License for one MSM-18/4 module	MDS 9500 Series only
	M9222ISSE1K9	Storage Services Enabler License	MDS 9222i Switch only
	M9200SSE184K9	Storage Services Enabler License for one MSM-18/4 module	MDS 9200 Series only
	M95DMM184K9	Data Mobility Manager License for one MSM-18/4 module	MDS 9500 Series only
	M9222IDMMK9	Data Mobility Manager License for Cisco MDS 9222i	MDS 9222i Switch
	M92DMM184K9	Data Mobility Manager License for one MSM-18/4 module	MDS 9200 Series only

**[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

**Table 2 Cisco MDS 9000 Family Supported Software and Hardware Components (continued)**

<b>Component</b>	<b>Part Number</b>	<b>Description</b>	<b>Applicable Product</b>
Licenses (continued)	M95DMM184TSK9	Data Mobility Manager for one MSM-18/4 module — Time Limited to 180 days only	MDS 9500 Series only
	M9222IDMMTSK9	Data Mobility Manager — Time Limited to 180 days only	MDS 9222i Switch only
	M92DMM184TSK9	Data Mobility Manager for one MSM-18/4 module — Time Limited to 180 days only	MDS 9200 Series only
	M92SSESSNK9	Cisco Storage Services Enabler License for SSN-16 (1 engine)	MDS 9200 Series only
	M95SSESSNK9	Cisco Storage Services Enabler License for SSN-16 (1 engine)	MDS 9500 Series only
	M92SMESSNK9	Cisco Storage Media Encryption License for SSN-16 (1 engine)	MDS 9200 Series only
	M95SMESSNK9	Cisco Storage Media Encryption License for SSN-16 (1 engine)	MDS 9500 Series only
	M92IOASSN	Cisco I/O Accelerator License for SSN-16 (1 engine)	MDS 9200 Series only
	M95IOASSN	Cisco I/O Accelerator License for SSN-16 (1 engine)	MDS 9500 Series only
	M92IOA184	Cisco I/O Accelerator License for MSM-18/4	MDS 9200 Series only
	M95IOA184	Cisco I/O Accelerator License for MSM-18/4	MDS 9500 Series only
	M9222HIOA	Cisco I/O Accelerator License for Cisco MDS 9222i base switch	MDS 9222i Switch only
	M92EXTSSNK9	Cisco SAN Extension License for SSN-16 (1 engine)	MDS 9200 Series only
	M95EXTSSNK9	Cisco SAN Extension License for SSN-16 (1 engine)	MDS 9500 Series only
	M9200XRC	Cisco XRC Acceleration	MDS 9200 Series only
	M9500XRC	Cisco XRC Acceleration	MDS 9500 Series only

**[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

**Table 2 Cisco MDS 9000 Family Supported Software and Hardware Components (continued)**

Component	Part Number	Description	Applicable Product
Chassis	DS-C9513	Cisco MDS 9513 Multilayer Director (13-slot multilayer director with 2 slots for Supervisor-2 modules, with 11 slots available for switching modules — SFPs sold separately)	MDS 9513 Switch
	DS-C9509	Cisco MDS 9509 Multilayer Director (9-slot multilayer director with 2 slots for Supervisor modules, with 7 slots available for switching modules — SFPs sold separately)	MDS 9509 Switch
	DS-C9506	Cisco MDS 9506 Multilayer Director (6-slot multilayer director with 2 slots for Supervisor modules, with 4 slots available for switching modules — SFPs sold separately)	MDS 9506 Switch
	DS-C9222i-K9	Cisco MDS 9222i Multilayer Fabric Switch (3-rack-unit (3RU) semimodular multilayer fabric switch with 18 4-Gbps Fibre Channel ports, 4 Gigabit Ethernet ports, and a modular expansion slot for Cisco MDS 9000 Family Switching and Services modules)	MDS 9222i Switch
	DS-C9216i-K9	Cisco MDS 9216i Multilayer Fabric Switch (3RU semi-modular multilayer fabric switch with 14 2-Gbps Fibre Channel ports, 2 Gigabit Ethernet ports, and a modular expansion slot for Cisco MDS 9000 Family Switching and Services modules)	MDS 9216i Switch
	DS-C9134-K9	Cisco MDS 9134 34-Port Multilayer Fabric Switch (1RU fixed-configuration multilayer fabric switch with 32 4-Gbps and 2 10-Gbps Fibre Channel ports)	MDS 9134 Switch
	DS-C9124-K9	Cisco MDS 9124 24-Port Multilayer Fabric Switch (1RU fixed-configuration multilayer fabric switch with 24 4-Gbps Fibre Channel ports)	MDS 9124 Switch
Supervisor Modules	DS-X9530-SF2-K9	Cisco MDS 9500 Series Supervisor-2 Module	MDS 9500 Series
	DS-X9530-SF2A-K9	Cisco MDS 9500 Series Supervisor-2A Module	MDS 9500 Series

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

**Table 2 Cisco MDS 9000 Family Supported Software and Hardware Components (continued)**

Component	Part Number	Description	Applicable Product
Switching Modules	DS-X9016	Cisco MDS 9000 16-Port Fibre Channel Switching Module with Small Form-Factor Pluggable (SFP) LC (16-port, 2-Gbps Fibre Channel switching module with SFP LC connectors for Cisco MDS 9216i and Cisco MDS 9500 Series)	MDS 9500 Series MDS 9216i Switch
	DS-X9032	Cisco MDS 9000 32-Port 2-Gbps Fibre Channel Switching Module with SFP LC connectors	MDS 9500 Series MDS 9216i Switch
	DS-X9112	Cisco MDS 9000 12-port 4-Gbps Fibre Channel Switching Module with SFP LC connectors	MDS 9500 Series MDS 9200 Series
	DS-X9124	Cisco 24-port 4-Gbps Fibre Channel Switching Module with SFP LC connectors	MDS 9500 Series MDS 9200 Series
	DS-X9148	Cisco MDS 9000 48-port 4-Gbps Fibre Channel Switching Module with SFP LC	MDS 9500 Series Mds 9200 Series
	DS-X9704	Cisco MDS 9000 Family 4-Port 10-Gbps Fibre Channel Switching Module with SFP LC	MDS 9500 Series Mds 9200 Series
	DS-X9224-96K9	Cisco MDS 9000 24-Port 8-Gbps Fibre Channel Switching Module with SFP and SFP+ LC connectors	MDS 9500 Series
	DS-X9248-96K9	Cisco MDS 9000 48-Port 8-Gbps Fibre Channel Switching Module with SFP and SFP+ LC connectors	MDS 9500 Series
	DS-X9248-48K9	Cisco MDS 9000 4/44-Port Host-Optimized 8-Gbps Fibre Channel Switching Module with SFP and SFP+ LC connectors	MDS 9500 Series MDS 9222i Switch
Services Modules	DS-X9316-SSNK9	Cisco MDS 9000 Family 16-Port Storage Services Node (SSN-16) — 16 fixed 1-Gbps Ethernet ports, plus 4 service engines that support 4 Gigabit Ethernet IP storage services ports.	MDS 9500 Series MDS 9222i Switch
	DS-X9304-18K9	Cisco MDS 9000 18/4-Port Multiservice Module (MSM-18/4) — 18-port, 4-Gbps Fibre Channel plus 4-port Gigabit Ethernet IP services and switching module with SFP LC connectors	MDS 9500 Series MDS 9200 Series
	DS-X9302-14K9	Cisco MDS 9000 14/2-Port Multiprotocol Services Module — 14-port, 2-Gbps Fibre Channel plus 2-port Gigabit Ethernet IP services and switching module with SFP LC connectors	MDS 9500 Series MDS 9216i Switch
	DS-X9032-SSM	Cisco MDS 9000 32-Port Storage Services Module — 32-port, 2-Gbps storage services module with SFP LC connectors	MDS 9500 Series MDS 9200 Series
External crossbar module	DS-13SLT-FAB1	Cisco MDS 9513 Switching Fabric1 Module	MDS 9513 Switch
	DS-13SLT-FAB2	Cisco MDS 9513 Switching Fabric2 Module	MDS 9513 Switch

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

**Table 2** *Cisco MDS 9000 Family Supported Software and Hardware Components (continued)*

<b>Component</b>	<b>Part Number</b>	<b>Description</b>	<b>Applicable Product</b>
Optics	DS-X2-FC10G-SR	X2 SC optics, 10-Gbps Fibre Channel for short reach	MDS 9500 Series MDS 9200 Series MDS 9134 Switch
	DS-X2-FC10G-LR	X2 SC optics, 10-Gbps Fibre Channel for long reach (10 km)	MDS 9500 Series MDS 9200 Series MDS 9134 Switch
	DS-X2-FC10G-ER	X2 SC optics, 10-Gbps Fibre Channel for extended reach (40 km)	MDS 9500 Series MDS 9200 Series MDS 9134 Switch
	DS-X2-FC10G-CX4	X2 SC optics, 10-Gbps Fibre Channel over copper	MDS 9500 Series MDS 9200 Series MDS 9134 Switch
	DS-X2-E10G-SR	X2 SC optics, 10-Gbps Ethernet for short reach	MDS 9500 Series MDS 9200 Series

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

Table 2 Cisco MDS 9000 Family Supported Software and Hardware Components (continued)

Component	Part Number	Description	Applicable Product
LC-type fiber-optic SFP	DS-SFP-FC8G-SW	SFP+ optics (LC type) for 2-, 4-, or 8-Gbps Fibre Channel for shortwave mode	MDS DS-X9200 Series switching modules
	DS-SFP-FC8G-LW	SFP+ optics (LC type) for 2-, 4-, or 8-Gbps Fibre Channel for longwave mode; supports distances up to 10 km	MDS DS-X9200 Series switching modules
	DS-SFP-FC4G-SW	SFP optics (LC type) for 1-, 2-, or 4-Gbps Fibre Channel for shortwave mode	MDS 9124, MDS 9134, MDS 9222i, DS-X9100, and DS-X9200 Series switching modules
	DS-SFP-FC4G-MR	SFP optics (LC type) for 1-, 2-, or 4-Gbps Fibre Channel for longwave mode; supports distances up to 4 km	MDS 9124, MDS 9134, MDS 9222i, DS-X9100, and DS-X9200 Series switching modules
	DS-SFP-FC4G-LW	SFP optics (LC type) for 1-, 2-, or 4-Gbps Fibre Channel for longwave mode; supports distances up to 10 km	MDS 9124, MDS 9134, MDS 9222i, DS-X9100, and DS-X9200 Series switching modules
	DS-SFP-FC-2G-SW	SFP optics (LC type) for 1- or 2-Gbps Fibre Channel for shortwave mode; not supported for use in 4-Gbps-capable ports	MDS 9000 Series
	DS-SFP-FC-2G-LW	SFP optics (LC type) for 1- or 2-Gbps Fibre Channel for longwave mode for Cisco MDS 9500, MDS 9200, and MDS 9100 Series; not supported for use in 4-Gbps-capable ports	MDS 9000 Series
	DS-SFP-FCGE-SW	SFP optics (LC type) for 1-Gbps Ethernet and 1- or 2-Gbps Fibre Channel for shortwave mode; not supported for use in 4-Gbps-capable ports	MDS 9000 Series
	DS-SFP-FCGE-LW	SFP optics (LC type) for 1-Gbps Ethernet and 1- or 2-Gbps Fibre Channel for longwave mode; not supported for use in 4-Gbps-capable ports	MDS 9000 Series
	DS-SFP-GE-T	SFP (RJ-45 connector) for Gigabit Ethernet over copper	MDS 9000 Series
Cisco Coarse Wavelength-Division Multiplexing (CWDM)	DS-CWDM-xxxx	CWDM Gigabit Ethernet and 1- or 2-Gbps Fibre Channel SFP LC type, where product number xxxx = 1470, 1490, 1510, 1530, 1550, 1570, 1590, or 1610 nm	MDS 9000 Family
	DS-CWDM4Gxxxx	CWDM 4-Gbps Fibre Channel SFP LC type, where product number xxxx = 1470, 1490, 1510, 1530, 1550, 1570, 1590, or 1610 nm	MDS 9000 Family



**[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

**Table 2 Cisco MDS 9000 Family Supported Software and Hardware Components (continued)**

Component	Part Number	Description	Applicable Product
Dense Wavelength-Division Multiplexing (DWDM)	DWDM-X2-xx.xx	DWDM X2 SC optics for 10-Gbps Fibre Channel connectivity to an existing Ethernet DWDM infrastructure, with 15xx.xx nm wavelength, where xx.xx = 60.61, 59.79, 58.98, 58.17, 56.55, 55.75, 54.94, 54.13, 52.52, 51.72, 50.92, 50.12, 48.51, 47.72, 46.92, 46.12, 44.53, 43.73, 42.94, 42.14, 40.56, 39.77, 38.98, 38.19, 36.61, 35.82, 35.04, 34.25, 32.68, 31.90, 31.12, or 30.33	MDS 9500 Series MDS 9200 Series
	DWDM-SFP-xxxx	DWDM Gigabit Ethernet and 1- or 2-Gbps Fibre Channel SFP LC type, where product number xxxx = 3033, 3112, 3190, 3268, 3425, 3504, 3582, 3661, 3819, 3898, 3977, 4056, 4214, 4294, 4373, 4453, 4612, 4692, 4772, 4851, 5012, 5092, 5172, 5252, 5413, 5494, 5575, 5655, 5817, 5898, 5979, or 6061nm	MDS 9000 Family
Add/Drop Multiplexer (ADM)	DS-CWDMOADM4A	4-channel CWDM optical ADM (OADM) module (Cisco CWDM 1470, 1490, 1510, or 1530 NM Add/Drop Module)	MDS 9000 Family
	DS-CWDMOADM4B	4-channel CWDM OADM module (Cisco CWDM 1550, 1570, 1590, or 1610 NM Add/Drop Module)	MDS 9000 Family
	DS-CWDM-MUX8A	ADM for 8 CWDM wavelengths	MDS 9000 Family
CWDM Multiplexer Chassis	DS-CWDMCHASSIS	2-slot chassis for CWDM ADMs	MDS 9000 Family
Power Supplies	DS-CAC-300W	300W AC power supply	MDS 9100 Series
	DS-C24-300AC	300W AC power supply	MDS 9124 Switch
	DS-CAC-845W	845W AC power supply for Cisco MDS 9200 Series	MDS9200 Series
	DS-CAC-3000W	3000W AC power supply for Cisco MDS 9509	MDS 9509 Switch
	DS-CAC-2500W	2500W AC power supply	MDS 9509 Switch
	DS-CDC-2500W	2500W DC power supply	MDS 9509 Switch
	DS-CAC-6000W	6000W AC power supply for Cisco MDS 9513	MDS 9513 Switch
	DS-CAC-1900W	1900W AC power supply for Cisco MDS 9506	MDS 9506 Switch
CompactFlash	MEM-MDS-FLD512M	External 512-MB CompactFlash memory for supervisor module	MDS 9500 Series
Port Analyzer Adapter	DS-PAA-2, DS-PAA	A standalone Fibre Channel-to-Ethernet adapter that allows for simple, transparent analysis of Fibre Channel traffic in a switched fabric	MDS 9000 Family
Smart Card Reader	DS-SCR-K9	Storage Media Encryption (SME) Smart Card Reader	MDS 9000 Family
Smart Card	DS-SC-K9	SME Smart Card	MDS 9000 Family
CD-ROM	M90FM-CD-441	Cisco MDS 9000 Management Software and Documentation CD-ROM for Cisco MDS 9000 NX-OS Software Release 4.1(3a)	MDS 9000 Family

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## MDS 9000 Chassis and Module Support in Cisco MDS NX-OS 4.x

Table 3 lists the MDS hardware chassis supported by Cisco MDS NX-OS 4.x.

**Table 3** Cisco MDS NX-OS 4.x Chassis Support Matrix

Switch	NX-OS 4.x Support
MDS 9513	Yes
MDS 9509	Yes
MDS 9506	Yes
MDS 9222i	Yes
MDS 9216i	Yes
MDS 9134	Yes
MD S 9124	Yes
Cisco Fabric Switch for HP c-Class BladeSystem and Cisco Fabric Switch for IBM BladeCenter	Yes

Table 4 lists the MDS hardware modules supported by Cisco MDS NX-OS 4.x. For the list of MDS hardware modules supported by Cisco MDS SAN-OS 3.x, see Table 5.

**Table 4** Module Support Matrix for Cisco MDS NX-OS 4.x

Module	Description	MDS 9500 Series	MDS 9222i	MDS 9216i
DS-X9530-SF2-K9	MDS 9500 Supervisor-2 Module	Yes	N/A	N/A
DS-X9530-SF1-K9	MDS 9500 Supervisor-1 Module	No	N/A	N/A
DS-X9224-96K9	24-port 8-Gbps Fibre Channel Switching Module	Yes <sup>1</sup>	No	No
DS-X9248-96K9	48-port 8-Gbps Fibre Channel Switching Module	Yes <sup>1</sup>	No	No
DS-X9248-48K9	4/44-port Host Optimized 8-Gbps Fibre Channel Switching Module	Yes	Yes	Yes
DS-X9316-SSNK9	16-port Storage Services Node (SSN-16)	Yes	Yes	No
DS-X9304-18K9	18/4-Port Multiservice Module (MSM-18/4)	Yes	Yes	Yes
DS-X9112	12-port 4-Gbps Fibre Channel Switching Module	Yes	Yes	Yes
DS-X9124	24-port 4-Gbps Fibre Channel Switching Module	Yes	Yes	Yes
DS-X9148	48-port 4-Gbps Fibre Channel Switching Module	Yes	Yes	Yes
DS-X9704	4-port 10-Gbps Fibre Channel Switching Module	Yes	Yes	Yes
DS-X9302-14K9	14/2-port Multiprotocol Services (MPS-14/2) Module	Yes	No	Yes
DS-X9016	16-port 1-, 2-Gbps Fibre Channel Switching Module	Yes	No	Yes
DS-X9032	32-port 1-, 2-Gbps Fibre Channel Switching Module	Yes	No	Yes

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

**Table 4** *Module Support Matrix for Cisco MDS NX-OS 4.x (continued)*

Module	Description	MDS 9500 Series	MDS 9222i	MDS 9216i
DS-X9032-SSM	32-port Storage Services Module (SSM)	Yes	Yes	Yes
DS-X9308-SMIP	8-port 1-, 2-Gbps IP Switching Module	No	No	No
DS-X9304-SMIP	4-port 1-, 2-Gbps IP Switching Module	No	No	No

1. Requires DS-13SLT-FAB2 in the MDS 9513.

Table 5 lists the MDS hardware modules supported by Cisco MDS SAN-OS 3.x.

**Table 5** *Module Support Matrix for Cisco MDS SAN-OS 3.x*

Module	Description	MDS 9500 Series	MDS 9222i	MDS 9216i	MDS 9216A	MDS 9216
DS-X9530-SF2-K9	MDS 9500 Supervisor-2 Module	Yes	N/A	N/A	N/A	N/A
DS-X9530-SF1-K9	MDS 9500 Supervisor-1 Module	Yes	N/A	N/A	N/A	N/A
DS-X9224-96K9	24-port 8-Gbps Fibre Channel Switching Module	No	No	No	No	No
DS-X9248-96K9	48-port 8-Gbps Fibre Channel Switching Module	No	No	No	No	No
DS-X9248-48K9	4/44-port Host Optimized 8-Gbps Fibre Channel Switching Module	No	No	No	No	No
DS-X9316-SSNK9	16-port Storage Services Node (SSN-16)	No	No	No	No	No
DS-X9304-18K9	18/4-Port Multiservice Module (MSM-18/4)	Yes	Yes	Yes	Yes	No
DS-X9112	12-port 4-Gbps Fibre Channel Switching Module	Yes	Yes	Yes	Yes	No
DS-X9124	24-port 4-Gbps Fibre Channel Switching Module	Yes	Yes	Yes	Yes	No
DS-X9148	48-port 4-Gbps Fibre Channel Switching Module	Yes	Yes	Yes	Yes	No
DS-X9704	4-port 10-Gbps Fibre Channel Switching Module	Yes	Yes	Yes	Yes	No
DS-X9302-14K9	14/2-port Multiprotocol Services (MPS-14/2) Module	Yes	No	Yes	Yes	Yes
DS-X9016	16-port 1-, 2-Gbps Fibre Channel Switching Module	Yes	No	Yes	Yes	Yes
DS-X9032	32-port 1-, 2-Gbps Fibre Channel Switching Module	Yes	No	Yes	Yes	Yes
DS-X9032-SSM	32-port Storage Services Module (SSM)	Yes	Yes	Yes	Yes	Yes
DS-X9308-SMIP	8-port 1-, 2-Gbps IP Switching Module	Yes	No	Yes	Yes	Yes
DS-X9304-SMIP	4-port 1-, 2-Gbps IP Switching Module	Yes	Yes	Yes	Yes	Yes

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

# Migrating from Supervisor-1 Modules to Supervisor-2 Modules

As of Cisco MDS SAN-OS Release 3.0(1), the Cisco MDS 9509 and 9506 Directors support both Supervisor-1 and Supervisor-2 modules. Supervisor-1 and Supervisor-2 modules cannot be installed in the same switch, except during migration. Both the active and standby supervisor modules must be of the same type, either Supervisor-1 or Supervisor-2 modules. For Cisco MDS 9513 Directors, both supervisor modules must be Supervisor-2 modules.

**Caution**

---

Migrating your supervisor modules is a disruptive operation.

---

**Note**

---

Migrating from Supervisor-2 modules to Supervisor-1 modules is not supported.

---

To migrate from a Supervisor-1 module to a Supervisor-2 module, refer to the step-by-step instructions in the *Cisco MDS 9000 NX-OS Release 4.1(x) and SAN-OS 3(x) Software Upgrade and Downgrade Guide*.

## Software Download Process

Use the software download procedure to upgrade to a later version, or downgrade to an earlier version, of an operating system. This section describes the software download process for the Cisco MDS NX-OS software and includes the following topics:

- [Determining the Software Version, page 12](#)
- [Determining Software Version Compatibility, page 13](#)
- [Downloading Software, page 13](#)
- [Selecting the Correct Software Image for an MDS 9100 Series Switch, page 14](#)
- [Selecting the Correct Software Image for an MDS 9200 Series Switch, page 14](#)
- [Selecting the Correct Software Image for an MDS 9500 Series Switch, page 14](#)

## Determining the Software Version

To determine the version of Cisco MDS NX-OS or SAN-OS software currently running on a Cisco MDS 9000 Family switch using the CLI, log in to the switch and enter the **show version EXEC** command.

To determine the version of Cisco MDS NX-OS or SAN-OS software currently running on a Cisco MDS 9000 Family switch using the Fabric Manager, view the Switches tab in the Information pane, locate the switch using the IP address, logical name, or WWN, and check its version in the Release column.

**Note**

---

We strongly recommend that you use the latest available software release supported by your vendor for all Cisco MDS 9000 Family products.

---

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

## Determining Software Version Compatibility

Table 6 lists the software versions that are compatible in a mixed SAN environment, and the minimum software versions that are supported. We recommend that you use the latest software release supported by your vendor for all Cisco MDS 9000 Family products.

**Table 6**      **Software Version Compatibility**

<b>NX-OS Release 5.0(x)</b>	<b>Compatible NX-OS 4.x Versions</b>	<b>Compatible SAN-OS 3.x Versions</b>
NX-OS Release 5.0(1a)	Release 4.1(1b), 4.1(1c), 4.1(3), 4.1(3a), 4.2(1a), 4.2(1b), 4.2(3), 4.2(3a), 4.2(5).  Release 4.1(1b) is the minimum supported version.	Release 3.3(1c), 3.3(2), 3.3(3), 3.3(4), 3.3(4a), 3.3(5).  Release 3.3(1c) is the minimum supported version.

## Downloading Software

The Cisco MDS NX-OS software is designed for mission-critical high availability environments. To realize the benefits of nondisruptive upgrades on the Cisco MDS 9500 Directors, we highly recommend that you install dual supervisor modules.

To download the latest Cisco MDS NX-OS software, access the Software Center at this URL:

<http://www.cisco.com/public/sw-center>

See the following sections in this release note for details on how you can nondisruptively upgrade your Cisco MDS 9000 switch. Issuing the **install all** command from the CLI, or using Fabric Manager to perform the downgrade, enables the compatibility check. The check indicates if the upgrade can happen nondisruptively or disruptively depending on the current configuration of your switch and the reason.

Compatibility check is done:

Module	bootable	Impact	Install-type	Reason
1	yes	non-disruptive	rolling	
2	yes	disruptive	rolling	Hitless upgrade is not supported
3	yes	disruptive	rolling	Hitless upgrade is not supported
4	yes	non-disruptive	rolling	
5	yes	non-disruptive	reset	
6	yes	non-disruptive	reset	

At a minimum, you need to disable the default device alias distribution feature using the **no device-alias distribute** command in global configuration mode. The **show incompatibility system bootflash:1.3(x)\_filename** command determines which additional features need to be disabled.



### Note

If you would like to request a copy of the source code under the terms of either GPL or LGPL, please send an e-mail to [mds-software-disclosure@cisco.com](mailto:mds-software-disclosure@cisco.com).

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## Selecting the Correct Software Image for an MDS 9100 Series Switch

The system and kickstart image that you use for an MDS 9100 series switch depends on which switch you use, as shown in [Table 7](#).

**Table 7** Software Images for MDS 9100 Series Switches

Cisco MDS 9100 Series Switch Type	Supervisor Module Type	Naming Convention
9124, 9134, Cisco Fabric Switch for HP c-Class BladeSystem, Cisco Fabric Switch for IBM BladeCenter	Supervisor-2 module	Filename begins with m9100-s2ek9

## Selecting the Correct Software Image for an MDS 9200 Series Switch

The system and kickstart image that you use for an MDS 9200 series switch depends on which switch you use, as shown in [Table 8](#).

**Table 8** Software Images for MDS 9200 Series Switches

Cisco MDS 9200 Series Switch Type	Supervisor Module Type	Naming Convention
9222i	Supervisor-2 module	Filename begins with m9200-s2ek9
9216i		Filename begins with m9200-ek9

## Selecting the Correct Software Image for an MDS 9500 Series Switch

The system and kickstart image that you use for an MDS 9500 Series switch depends on whether the switch is based on a Supervisor-1 module or a Supervisor-2 module, as shown in [Table 9](#).

**Table 9** Software Images for Supervisor Type

Cisco MDS 9500 Series Switch Type	Supervisor Module Type	Naming Convention
9513, 9509, and 9506	Supervisor-2 module	Filename begins with m9500-sf2ek9

Use the **show module** command to display the type of supervisor module in the switch. The following is sample output from the **show module** command on a Supervisor 2 module:

```
switch# show module
Mod  Ports  Module-Type                Model                Status
---  -
...
...
7    0      Supervisor/Fabric-2       DS-X9530-SF2-K9     active *
8    0      Supervisor/Fabric-2       DS-X9530-SF2-K9     ha-standby
```

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

# Upgrading Your Cisco MDS NX-OS Software Image

This section lists the guidelines recommended for upgrading your Cisco MDS NX-OS software image and includes the following topics:

- [General Upgrading Guidelines, page 15](#)
- [Enabling Telnet Required After an Upgrade, page 18](#)
- [Upgrading Effect on VSAN 4079, page 19](#)
- [FICON Supported Releases and Upgrade Paths, page 17](#)
- [Upgrading with IVR Enabled, page 19](#)
- [Reconfiguring SSM Ports Before Upgrading to NX-OS Release 4.2\(1a\), page 20](#)
- [Upgrading the SSI Image on Your SSM, page 21](#)
- [Upgrading a Cisco MDS 9124 or Cisco MDS 9134 Switch, page 22](#)
- [Performing a Disruptive Upgrade on a Single Supervisor MDS Family Switch, page 22](#)
- [Resetting SNMP Notifications Following an Upgrade, page 22](#)
- [Converting Automatically Created PortChannels Before an Upgrade, page 23](#)

**Note**

---

Before you begin the upgrade process, review the list of chassis and modules that Cisco MDS NX-OS Release 4.2(1a) supports. See the “MDS 9000 Chassis and Module Support in Cisco MDS NX-OS 4.x” section on page 10.

---

For detailed instructions for performing a software upgrade using Cisco Fabric Manager, see the *Cisco Fabric Manager Release Notes for Release 4.2(1a)*, which is available from the following website:

[http://www.cisco.com/en/US/products/ps10495/prod\\_release\\_notes\\_list.html](http://www.cisco.com/en/US/products/ps10495/prod_release_notes_list.html)

## General Upgrading Guidelines

**Note**

---

To upgrade to NX-OS Release 4.2(1a) from SAN-OS Release 3.2(3a) or earlier, first upgrade to SAN-OS Release 3.3(x) and then upgrade to NX-OS Release 4.2(1a).

---

Use the following guidelines when upgrading to Cisco MDS NX-OS Release 4.2(1a):

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

- Install and configure dual supervisor modules.
- Issue the **show install all impact upgrade-image** CLI command to determine if your upgrade will be nondisruptive.
- Be aware that you need to enable Telnet following the upgrade. See “[Enabling Telnet Required After an Upgrade](#)” section on page 18.
- Follow the recommended guidelines for upgrading a Cisco MDS 9124 or MDS 9134 Switch as described in “[Upgrading a Cisco MDS 9124 or Cisco MDS 9134 Switch](#)” section on page 22.
- Follow the guidelines for upgrading a single supervisor switch as described in “[Performing a Disruptive Upgrade on a Single Supervisor MDS Family Switch](#)” section on page 22.
- Make note of the information concerning SANTap when performing upgrades on a Cisco MDS 9222i switch, as described in “[Upgrading an MDS 9222i Switch with SANTap or Invista is Provisioned on the SSM](#)” section on page 18.
- Be aware of the impact of an upgrade on VSAN 4079 if you are upgrading from SAN-OS Release 3.x to NX-OS 4.2(1a). See the “[Upgrading Effect on VSAN 4079](#)” section on page 19 for details.
- Be aware that some features impact whether an upgrade is disruptive or nondisruptive:
  - **Fibre Channel Ports:** Traffic on Fibre Channel ports can be nondisruptively upgraded. See [Table 10](#) for the nondisruptive upgrade path for all NX-OS and SAN-OS releases.
  - **SSM:** Intelligent services traffic on the SSM, such as SANTap, NASB, and FC write acceleration, is disrupted during an upgrade. SSM Fibre Channel traffic is not.
  - **Gigabit Ethernet Ports:** Traffic on Gigabit Ethernet ports is disrupted during an upgrade or downgrade. This includes IPS modules and the Gigabit Ethernet ports on the MPS-14/2 module, the MSM-18/4 module, and the MDS 9222i switch. Those nodes that are members of VSANs traversing an FCIP ISL are impacted, and a fabric reconfiguration occurs. iSCSI initiators connected to the Gigabit Ethernet ports lose connectivity to iSCSI targets while the upgrade is in progress.
  - **Inter-VSAN Routing (IVR):** With IVR enabled, you must follow additional steps if you are upgrading from Cisco SAN-OS Release 2.1.(1a), 2.1(1b), or 2.1.(2a). See the “[Upgrading with IVR Enabled](#)” section on page 19 for these instructions.
  - **FICON:** If you have FICON enabled, the upgrade path is different. See the “[FICON Supported Releases and Upgrade Paths](#)” section on page 17.

Use [Table 10](#) to determine your nondisruptive upgrade path to Cisco MDS NX-OS Release 4.2(1a), find the image release number you are currently using in the Current column of the table, and use the path recommended.




---

**Note**

In addition to these guidelines, you may want to review the information in the “[Limitations and Restrictions](#)” section on page 33” section prior to a software upgrade to determine if a feature may possibly behave differently following the upgrade.

---




---

**Note**

The software upgrade information in [Table 10](#) applies only to Fibre Channel switching traffic. Upgrading system software disrupts IP traffic and SSM intelligent services traffic.

---



**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

**Table 10 Nondisruptive Upgrade Path to Cisco MDS NX-OS Release 4.2(1a)**

Current Release	Nondisruptive Upgrade Path and Ordered Upgrade Steps
<b>NX-OS:</b>	
All 1 4.1(x) releases	Upgrade to NX-OS Release 4.2(1a).
<b>SAN-OS:</b>	
Release 3.3(1c), 3.3(2), 3.3(3), 3.3(4x), and 3.3(5x).	Upgrade to NX-OS Release 4.2(1a).
Release 3.2(1a), all 3.2(x), 3.1(x), and 3.0(x) releases, and release 2.1(3), 2.1(2e), 2.1(2d), and 2.1(2b)	<ol style="list-style-type: none"> <li>1. Upgrade to SAN-OS Release 3.3(1c).</li> <li>2. Upgrade to NX-OS Release 4.2(1a).</li> </ol>
Release 2.1(2), 2.1(1b), 2.1(1a), and 2.0(x)	<ol style="list-style-type: none"> <li>1. Upgrade to SAN-OS Release 2.1(2b), 2.1(2d), 2.1(2e), or 2.1(3).</li> <li>2. Upgrade to SAN-OS Release 3.3(1c).</li> <li>3. Upgrade to NX-OS Release 4.2(1a).</li> </ol>
Release 1.x	<ol style="list-style-type: none"> <li>1. Upgrade to SAN-OS Release 1.3(4a).</li> <li>2. Upgrade to SAN-OS Release 2.1(2b).</li> <li>3. Upgrade to SAN-OS Release 3.3(1c).</li> <li>4. Upgrade to NX-OS Release 4.2(1a).</li> </ol>

## FICON Supported Releases and Upgrade Paths

Cisco MDS NX-OS Release 4.2(1a) does not support FICON.

[Table 11](#) lists additional SAN-OS and NX-OS releases that support FICON. Refer to the specific release notes for FICON upgrade path information.

**Table 11 FICON Supported Releases**

<b>FICON Supported Releases</b>	
NX-OS	Release 4.1(1c)
SAN-OS	Release 3.3(1c)
	Release 3.2(2c)
	Release 3.0(3b)
	Release 3.0(3)
	Release 3.0(2)
	Release 2.0(2b)

**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

Use [Table 12](#) to determine your FICON nondisruptive upgrade path to Cisco MDS NX-OS Release 4.1(1c). Find the image release number you are currently using in the Current Release with FICON Enabled column of the table and follow the recommended path.

**Table 12 FICON Nondisruptive Upgrade Path to MDS NX-OS Release 4.1(1c)**

Current Release with FICON Enabled	Upgrade Path
SAN-OS 3.3(1c)	You can nondisruptively upgrade directly to NX-OS Release 4.1(1c).
SAN-OS 3.2(2c)	First upgrade to SAN-OS Release 3.3(1c), and then upgrade to NX-OS Release 4.1(1c).
SAN-OS 3.0(3b)	First upgrade to SAN-OS Release 3.3(1c), and then upgrade to NX-OS Release 4.1(1c).
SAN-OS 3.0(3)	First upgrade to SAN-OS Release 3.3(1c), and then upgrade to NX-OS Release 4.1(1c).
SAN-OS 3.0(2)	First upgrade to SAN-OS Release 3.3(1c), and then upgrade to NX-OS Release 4.1(1c).
SAN-OS 2.0(2b)	Use the <b>interface shutdown</b> command to administratively shut any Fibre Channel ports on Generation 1 modules that are in an operationally down state before nondisruptively upgrading from SAN-OS Release 2.0(2b) to SAN-OS Release 3.0(2) or SAN-OS Release 3.0(3b), and then upgrade to Release 3.3(1c). An operationally down state includes <code>Link failure</code> or <code>not-connected</code> , <code>SFP not present</code> , or <code>Error Disabled</code> status in the output of a <b>show interface</b> command. When an interface is administratively shut it will then show as <code>Administratively down</code> . Interfaces that are currently up or trunking do not need to be shut down.
SAN-OS 1.x	Upgrade to SAN-OS Release 3.0(2). Use the <b>interface shutdown</b> command to shut all the ports operationally down and administratively up on all the Generation 1 modules before nondisruptively upgrading to Release 2.0(2b) and then upgrade to 1.3(4a).

## Upgrading an MDS 9222i Switch with SANTap or Invista is Provisioned on the SSM

On an MDS 9222i switch, if SANTap or Invista is provisioned on a Storage Services Module (SSM) in slot 2, then an In Service Software Upgrade (ISSU) to NX-OS Release 4.2(1a) is not supported. The upgrade to NX-OS Release 4.2(1a) is supported if you set boot variables, save the configuration, and reload the switch. If the switch is running SAN-OS Release 3.3(1a) or earlier, first upgrade to SAN-OS Release 3.3(1c) and then upgrade to NX-OS Release 4.2(1a).

## Enabling Telnet Required After an Upgrade

Following an upgrade from SAN-OS 3.x to NX-OS 4.x, you need to enable the Telnet server if you require a Telnet connection. As of MDS NX-OS Release 4.1(1b), the Telnet server is disabled by default on all switches in the Cisco MDS 9000 Family. In earlier releases, the Telnet server was enabled by default.

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## Upgrading Effect on VSAN 4079

If you are upgrading from a SAN-OS Release 3.x to NX-OS Release 4.2(1a), and you have not created VSAN 4079, the NX-OS software will automatically create VSAN 4079 and reserve it for EVFP use.

If VSAN 4079 is reserved for EVFP use, the **switchport trunk allowed vsan** command will filter out VSAN 4079 from the allowed list, as shown in the following example:

```
switch(config-if)# switchport trunk allowed vsan 1-4080
1-4078,4080
switch(config-if)#
```

If you have created VSAN 4079, the upgrade to NX-OS Release 4.2(1a) will have no affect on VSAN 4079.

If you downgrade after NX-OS Release 4.2(1a) creates VSAN 4079 and reserves it for EVFP use, the VSAN will no longer be reserved.

## Upgrading with IVR Enabled

An Inter-Switch Link (ISL) flap resulting in fabric segmentation or a merge during or after an upgrade from Cisco MDS SAN-OS Release 2.0(x) to a later image where IVR is enabled might be disruptive. Some possible scenarios include the following:

- FCIP connection flapping during the upgrade process resulting in fabric segmentation or merge.
- ISL flap results in fabric segmentation or merge because of hardware issues or a software bug.
- ISL port becomes part of PCP results in fabric segmentation or merge because of a port flap.

If this problem occurs, syslogs indicate a failure and the flapped ISL could remain in a down state because of a domain overlap.

This issue was resolved in Cisco SAN-OS Release 2.1(2b); you must upgrade to Release 2.1(2b) before upgrading to Release 3.3(1c). An upgrade from Cisco SAN-OS Releases 2.1(1a), 2.1(1b), or 2.1(2a) to Release 2.1(2b) when IVR is enabled requires that you follow the procedure below. If you have VSANs in interop mode 2 or 3, you must issue an IVR refresh for those VSANs.

To upgrade from Cisco SAN-OS Releases 2.1(1a), 2.1(1b), or 2.1(2a) to Release 2.1(2b) for all other VSANs with IVR enabled, follow these steps:

- 
- Step 1** Configure static domains for all switches in all VSANs where IVR is enabled. Configure the static domain the same as the running domain so that there is no change in domain IDs. Make sure that all domains are unique across all of the IVR VSANs. We recommend this step as a best practice for IVR-non-NAT mode. Issue the **fcdomain domain id static vsan vsan id** command to configure the static domains.




---

**Note** Complete Step 1 for all switches before moving to Step 2.

---

- Step 2** Issue the **no ivr virtual-fcdomain-add vsan-ranges vsan-range** command to disable RDI mode on all IVR enabled switches. The range of values for a VSAN ID is 1 to 4093. This can cause traffic disruption.




---

**Note** Complete Step 2 for all IVR enabled switches before moving to Step 3.

---

- Step 3** Check the syslogs for any ISL that was isolated.

**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

```
2005 Aug 31 21:52:04 switch %FCDOMAIN-2-EPORT_ISOLATED:
%$VSAN 2005%$ Isolation of interface
PortChannel 52 (reason: unknown failure)
2005 Aug 31 21:52:04 switch %FCDOMAIN-2-EPORT_ISOLATED: %$VSAN 2005%$
Isolation of interface PortChannel 51
(reason: domain ID assignment failure)
```

**Step 4** Issue the following commands for the isolated switches in Step 3:

```
switch(config)# vsan database
switch(config-vsan-db)# vsan vsan-id suspend
switch(config-vsan-db)# no vsan vsan-id suspend
```

**Step 5** Issue the **ivr refresh** command to perform an IVR refresh on all the IVR enabled switches.

**Step 6** Issue the **copy running-config startup-config** command to save the RDI mode in the startup configuration on all of the switches.

**Step 7** Follow the normal upgrade guidelines for Release 2.1(2b). If you are adding new switches running Cisco MDS SAN-OS Release 2.1(2b) or later, upgrade all of your existing switches to Cisco SAN-OS Release 2.1(2b) as described in this workaround. Then follow the normal upgrade guidelines for Release 3.3(1c).




---

**Note** RDI mode should not be disabled for VSANs running in interop mode 2 or interop mode 3.

---

## Reconfiguring SSM Ports Before Upgrading to NX-OS Release 4.2(1a)

Starting with Cisco MDS SAN-OS Release 3.0(1), the SSM front panel ports can no longer be configured in auto mode, which is the default for releases prior to Release 3.0(1).




---

**Note** To avoid any traffic disruption, modify the configuration of the SSM ports as described below, before upgrading a SAN-OS software image prior to Release 3.3(1c) to NX-OS Release 4.2(1a).

---

For more information on upgrading SAN-OS software, see the [“Upgrading Your Cisco MDS NX-OS Software Image” section on page 15](#).

If the configuration is not updated before the upgrade, the installation process for the new image will automatically convert all ports configured in auto mode to Fx mode. This change in mode might cause a disruption if the port is currently operating in E mode.

To upgrade the image on your SSM without any traffic disruption, follow these steps:

**Step 1** Verify the operational mode for each port on the SSM using the **show interface** command:

```
switch# show interface fc 2/1 - 32
fc2/1 is up
  Hardware is Fibre Channel, SFP is short wave laser w/o OFC (SN)
  Port WWN is 20:4b:00:0d:ec:09:3c:00
  Admin port mode is auto <----- shows port is configured in auto mode
  snmp traps are enabled
  Port mode is F, FCID is 0xef0300 <----- shows current port operational mode is F
  Port vsan is 1
  Speed is 2 Gbps
  Transmit B2B Credit is 3
```

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

**Step 2** Change the configuration for the first port of the quad when the admin port mode is auto. (A quad is a group of four ports, supported by a data path processor (DPP). The groups are 1 to 4, 5 to 8, 9 to 12, and so on.) Do not leave the port mode set to auto.

- a. Set the port admin mode to E or Fx if the current operational port mode is E, TE, F or FL.

```
switch# config t
switch(config)# interface fc 2/1
switch(config-if)# switchport mode fx
```

- b. Set the port admin mode to E if the current operational port mode is E:

```
switch# config t
switch(config)# interface fc 2/5
switch(config-if)# switchport mode e
```

**Step 3** Change the configuration for ports 2, 3, and 4 of the quad:

- a. Set the admin port mode to Fx if the admin port mode of these ports is E, TE, or auto.

```
switch# config t
switch(config)# interface fc 2/2
switch(config-if)# switchport mode fx
```

- b. If the first port in the port group has admin mode E or if the port is operational in E port mode, change the admin state of ports 2, 3, and 4 to shutdown.

```
switch# config t
switch(config)# interface fc 2/2
switch(config-if)# shutdown
```

**Step 4** Save the running configuration to the startup configuration before the upgrade procedure to ensure that the changes are preserved during and after the upgrade. To save the configuration, enter the following command:

```
switch# copy running-config startup-config
```

## Upgrading the SSI Image on Your SSM

Use the following guidelines to nondisruptively upgrade the SSI image on your SSM:

- Install and configure dual supervisor modules.
- SSM intelligent services traffic on SSM ports is disrupted during upgrades. Fibre Channel switching traffic is not disrupted under the following conditions:
  - Upgrade the SSI boot images on the SSMs on the switch to a release version supported by your Cisco SAN-OS release. Refer to the [Cisco MDS NX-OS Release Compatibility Matrix for Storage Service Interface Images](#).
  - All SSM applications are disabled. Use the **show ssm provisioning** command to determine what applications are configured. Use the **no ssm enable feature** command to disable these applications.
  - No SSM ports are in auto mode. See the “[Reconfiguring SSM Ports Before Upgrading to NX-OS Release 4.2\(1a\)](#)” section on page 20.

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

- The EPLD version on the SSM is at 0x07 or higher. Use the **show version module slot epld** command to determine your EPLD version. Refer to the [Cisco MDS 9000 Family Release Notes for Cisco MDS 9000 EPLD Images](#) to upgrade your EPLD image.
- Refer to the [Cisco Data Center Interoperability Support Matrix](#) and the “Managing Modules” chapter in the [Cisco NX-OS Fundamentals Configuration Guide](#) <verify in doc> for information on upgrading your SSM.

## Upgrading a Cisco MDS 9124 or Cisco MDS 9134 Switch

If you are upgrading from Cisco MDS SAN-OS Release 3.1(1) to Cisco NX-OS Release 4.2(1a) on a Cisco MDS 9124 or MDS 9134 Switch, follow these guidelines:

- During the upgrade, configuration is not allowed and the fabric is expected to be stable.
- The Fabric Shortest Path First (FSPF) timers must be configured to the default value of 20 seconds; otherwise, the nondisruptive upgrade is blocked to ensure that the maximum down time for the control plane can be 80 seconds.
- If there are any CFS commits in the fabric, the nondisruptive upgrade will fail.
- If there is a zone server merge in progress in the fabric, the nondisruptive upgrade will fail.
- If a service terminates the nondisruptive upgrade, the **show install all failure-reason** command can display the reason that the nondisruptive upgrade cannot proceed.
- If there is not enough memory in the system to load the new images, the upgrade will be made disruptive due to insufficient resources and the user will be notified in the compatibility table.

## Performing a Disruptive Upgrade on a Single Supervisor MDS Family Switch

Cisco MDS SAN-OS software upgrades are disruptive on the Cisco MDS 9216i switch, which has a single supervisor. If you are performing an upgrade on this switch, you should follow the nondisruptive upgrade path shown in [Table 10](#), even though the upgrade is disruptive. Following the nondisruptive upgrade path ensures that the binary startup configuration remains intact.

If you do not follow the upgrade path, (for example, you upgrade directly from SAN-OS Release 2.1(2) or earlier version to NX-OS Release 4.2(x)), the binary startup configuration is deleted because it is not compatible with the new image, and the ASCII startup configuration file is applied when the switch comes up with the new upgraded image. When the ASCII startup configuration file is applied, there may be errors. Because of this, we recommend that you follow the nondisruptive upgrade path.



### Note

You cannot upgrade an MDS 9120 switch or an MDS 9140 switch to Cisco NX-OS 4.x. See [Table 3](#) for the list of switches that support Cisco NX-OS 4.x.

## Resetting SNMP Notifications Following an Upgrade

The SNMP notification configuration resets to the default settings when you upgrade to Cisco NX-OS Release 4.2(1a). Use the **snmp-server enable traps** command to reenable your required SNMP notifications.

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## Converting Automatically Created PortChannels Before an Upgrade

Before upgrading from NX-OS Release 4.1(x) or 4.2(x) to Release 5.x, ensure that you do not have any automatically created PortChannels present in the switch configuration. Use the **port-channel persistent** command to convert an automatically created PortChannel to a persistent PortChannel. Failure to convert automatically created PortChannels prior to the upgrade can result in traffic disruption because Autocreation of PortChannels is a deprecated feature as of NX-OS Release 4.1(1b).

## Downgrading Your Cisco MDS SAN-OS Software Image

This section lists the guidelines recommended for downgrading your Cisco MDS SAN-OS software image and includes the following topics:

- [General Downgrading Guidelines, page 23](#)
- [Downgrading the SSI Image on Your SSM, page 25](#)

### General Downgrading Guidelines

Use the following guidelines to nondisruptively downgrade your Cisco MDS NX-OS Release 4.2(1a):

- Install and configure dual supervisor modules.
- Issue the system **no acl-adjacency-sharing** execute command to disable acl adjacency usage on Generation 2 and Generation 1 modules. If this command fails, reduce the number of zones, IVR zones, TE ports, or a combination of these in the system and issue the command again.
- Disable all features not supported by the downgrade release. Use the **show incompatibility system downgrade-image** command to determine what you need to disable.
- Use the **show install all impact downgrade-image** command to determine if your downgrade will be nondisruptive.
- Be aware that some features impact whether a downgrade is disruptive or nondisruptive:
  - **Fibre Channel Ports:** Traffic on Fibre Channel ports can be nondisruptively downgraded. See [Table 13](#) for the nondisruptive downgrade path for all SAN-OS releases.
  - **SSM:** Intelligent services traffic on the SSM, such as SANTap, NASB, and FC write acceleration, is disrupted during a downgrade. SSM Fibre Channel traffic is not.
  - **Gigabit Ethernet Ports:** Traffic on Gigabit Ethernet ports is disrupted during a downgrade. This includes IPS modules and the Gigabit Ethernet ports on the MPS-14/2 module, the MSM-18/4 module, and the MDS 9222i switch. Those nodes that are members of VSANs traversing an FCIP ISL are impacted, and a fabric reconfiguration occurs. iSCSI initiators connected to the Gigabit Ethernet ports lose connectivity to iSCSI targets while the downgrade is in progress.
  - **IVR:** With IVR enabled, you must follow additional steps if you are downgrading from Cisco SAN-OS Release 2.1.(1a), 2.1(1b), or 2.1.(2a). See the [“Upgrading with IVR Enabled” section on page 19](#) for these instructions.
  - **FICON:** If you have FICON enabled, the downgrade path is different. See the [“FICON Downgrade Paths” section on page 25](#).

**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

**Note**

A downgrade from NX-OS Release 4.2(1a) to SAN-OS Release 3.3(1x) is not supported on MDS switches, when FC-Redirect based applications, such as Data Mobility Manager or Storage Media Encryption, are configured in the fabric if either of the following conditions are satisfied:

1. A target for which FC-Redirect is configured is connected locally and there are Generation 1 modules with ISLs configured in the switch.
2. A host, for which FC-redirect is configured, is connected locally on a Generation 1 module.

If these conditions exist, remove the application configuration for these targets and hosts before proceeding with the downgrade.

Use [Table 13](#) to determine the nondisruptive downgrade path from Cisco NX-OS Release 4.2(1a). Find the SAN-OS image you want to downgrade to in the To SAN-OS Release column of the table and use the path recommended.

**Note**

The software downgrade information in [Table 13](#) applies only to Fibre Channel switching traffic. Downgrading system software disrupts IP and SSM intelligent services traffic.

**Table 13 Nondisruptive Downgrade Path from NX-OS Release 4.2(1a)**

To NX-OS or SAN-OS Release	Nondisruptive Downgrade Path and Ordered Downgrade Steps
<b>NX-OS:</b>	
All 4.1(x) releases	1. Downgrade to NX-OS Release 4.1(x).
<b>SAN-OS:</b>	
All 3.3(x) releases	2. Downgrade to NX-OS Release 4.1(x). 3. Downgrade to SAN-OS Release 3.3(x).
All 3.2(x), 3.1(x), 3.0(x) releases, and all 2.1(x) releases.	1. Downgrade to NX-OS Release 4.1(x). 2. Downgrade to SAN-OS Release 3.3(x). 3. Downgrade to SAN-OS Release 3.2(x), Release 3.1(x), Release 3.0(x), or Release 2.1(x).
All 2.0(x) releases.	1. Downgrade to NX-OS Release 4.1(x). 2. Downgrade to SAN-OS Release 3.3(x). 3. Downgrade to SAN-OS Release 2.1(2x). 4. Downgrade to SAN-OS Release 2.0(x).
Release 1.x	1. Downgrade to NX-OS Release 4.1(x). 2. Downgrade to SAN-OS Release 3.3(x). 3. Downgrade to SAN-OS Release 2.1(2b). 4. Downgrade to SAN-OS Release 1.3(4a). 5. Downgrade to SAN-OS Release 1.x.



[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## FICON Downgrade Paths

Table 14 lists the downgrade paths for FICON releases. Find the image release number that you want to downgrade to in the [To Release with FICON Enabled](#) column of the table and follow the recommended downgrade path.

**Table 14** FICON Downgrade Path from NX-OS Release 4.1(1c)

To Release with FICON Enabled	Downgrade Path
SAN-OS 3.3(1c)	You can nondisruptively downgrade directly from NX-OS Release 4.1(1c).
SAN-OS 3.2(2c)	First downgrade to SAN-OS Release 3.3(1c) and then downgrade to Release 3.2(2c).
SAN-OS 3.0(3b)	First downgrade to SAN-OS Release 3.3(1c) and then downgrade to Release 3.0(3b).
SAN-OS 3.0(2)	First downgrade to SAN-OS Release 3.3(1c) and then downgrade to Release 3.0(2).
SAN-OS 2.0(2b)	Use the <b>interface shutdown</b> command to administratively shut any Fibre Channel ports on Generation 1 modules that are in an operationally down state before nondisruptively downgrading from NX-OS Release 4.1 to SAN-OS Release 3.3(1c) then to SAN-OS Release 3.0(3b) or SAN-OS Release 3.0(2), and then to SAN-OS Release 2.0(2b). An operationally down state includes Link failure or not-connected, SFP not present, or Error Disabled status in the output of a <b>show interface</b> command. When an interface is administratively shut it will then show as Administratively down. Interfaces that are currently up or trunking do not need to be shut down.
SAN-OS 1.3(4a)	Downgrade to SAN-OS Release 3.3(1c) and then to Release 3.0(2). Use the shutdown command to shut all the ports operationally down and administratively up on all the Generation 1 modules before nondisruptively downgrading to Release 2.0(2b) and then downgrade to 1.3(4a).

## Downgrading the SSI Image on Your SSM

Use the following guidelines when downgrading your SSI image on your SSM:

- On a system with at least one SSM installed, the **install all** command might fail on an SSM when you downgrade from Cisco NX-OS Release 4.1(x) to any SAN-OS 2.x release earlier than SAN-OS Release 2.1(2e). Power down the SSM and perform the downgrade. Bring up the SSM with the new bootvar set to the 2.x SSI image.
- Downgrade the SSI boot images on the SSMs on the switch to a release version supported by your Cisco SAN-OS release. Refer to the [Cisco MDS SAN-OS Release Compatibility Matrix for Storage Service Interface Images](#).
- SSM intelligent services traffic switching on SSM ports is disrupted on upgrades or downgrades.
- Fibre Channel switching traffic on SSM ports is not disrupted under the following conditions:
  - All SSM applications are disabled. Use the **show ssm provisioning** command to determine if any applications are provisioned on the SSM. Use the **no ssm enable feature** configuration mode command to disable these features.

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

- The EPLD version on the SSM is at 0x07 or higher. Use the **show version module slot epld** command to determine your EPLD version. Refer to the [Cisco MDS 9000 Family Release Notes for Cisco MDS 9000 EPLD Images](#) to upgrade your EPLD image.
- Refer to the [Cisco Data Center Interoperability Support Matrix](#) and the “Managing Modules” chapter in the [Cisco MDS 9000 Family CLI Configuration Guide, Release 3.x](#), for information on downgrading your SSM.

## Downgrading an MDS 9500 Series Switch with an 8-Gbps Module Installed

If you attempt to perform a nondisruptive software downgrade from NX-OS Release 4.x to SAN-OS Release 3.x on an MDS 9500 Series switch that has an 8-Gbps module installed, the switch should display a message that the module is unsupported and stop the downgrade. Instead, the switch displays a message that the module is unsupported and proceeds with a disruptive downgrade. The following table shows the actual and expected behavior of the switch for a software downgrade.

**Table 15** Downgrade Behavior on an MDS 9500 Series Switch with 8-Gbps Module Installed

Crossbar Fabric Mode	Switch Type	Software Version	Downgrade Software Version	Actual Install Behavior	Expected Install Behavior
DB mode <sup>1</sup>	MDS 9513 with 8-Gbps module	4.2(1a)	3.3(x)	Disruptive	Abort. Disruptive after powerdown of 8-Gbps module
DB mode	MDS 9513 without 8-Gbps module	4.2(1a)	3.3(x)	Disruptive	Disruptive
BM mode <sup>2</sup>	MDS 9513 with 8-Gbps module	4.2(1a)	3.3(x)	Abort	Abort. Nondisruptive after powerdown of 8-Gbps module.
BM mode	MDS 9513 without 8-Gbps module	4.2(1a)	3.3(x)	Nondisruptive	Nondisruptive
BM Mode	MDS 9509 or 9506 with 8-Gbps module	4.2(1a)	3.3(x)	Abort	Abort. Nondisruptive after powerdown of 8-Gbps module.
BM Mode	MDS 9509 or 9506 without 8-Gbps module	4.2(1a)	3.3(x)	Nondisruptive	Nondisruptive

1. DB mode is the fabric mode that supports Generation 3 8-Gbps modules in an MDS 9513 switch chassis.

2. BM mode is the fabric mode that does not support Generation 3 8-Gbps modules in an MDS 9513 switch chassis.

## New Features in Cisco MDS NX-OS Release 4.2(1a)

This section briefly describes the new features introduced in this release. Each feature description includes the name of the Configuration Guide where the feature is documented in detail. The “New and Changed” section of each book provides a list of all new features and includes links to the feature description.

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

This section includes the following topics:

- [Product Documentation Changes, page 27](#)
- [Cisco MDS 9000 NX-OS Release 4.2\(1a\) New Features, page 27](#)
- [NX-OS Feature Descriptions, page 28](#)
- [Hardware Changes, page 30](#)

## Product Documentation Changes

As of Cisco MDS NX-OS Release 4.2(1a), software configuration information is available in new feature-specific configuration guides for the following information:

- System management
- Interfaces
- Fabric
- Quality of service
- Security
- IP services
- High availability and redundancy

The information in these new guides previously existed in the *Cisco MDS 9000 Family CLI Configuration Guide*. That configuration guide remains available on Cisco.com and should be used for all software releases prior to MDS NX-OS Release 4.2(1a). Configuration guides address the features introduced in or available in a particular release. Select and view the configuration guide that pertains to the software installed in your switch.

In addition, Fabric Manager information has been removed from the Cisco MDS NX-OS Release Notes (this document) and placed into standalone Fabric Manager Release Notes that support both Cisco MDS 9000 Family switches and Cisco Nexus 5000 Series switches. Cisco Fabric Manager Release Notes are available from the following website:

[http://www.cisco.com/en/US/products/ps10495/prod\\_release\\_notes\\_list.html](http://www.cisco.com/en/US/products/ps10495/prod_release_notes_list.html)



### Note

These release notes are specific to this release. For the complete list of NX-OS product documentation, see the “[Related Documentation](#)” section.

## Cisco MDS 9000 NX-OS Release 4.2(1a) New Features

Cisco MDS 9000 NX-OS Release 4.2(1a) is a software release that includes new features, enhancements, and bug fixes. It supports the new MDS 9000 Family 16-port Storage Services Node (SSN-16) that offers licensed SAN extension features.

This release includes the following major features:

**[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

- Cisco TrustSec Fibre Channel Link Encryption
- FICON XRC Acceleration
- I/O Accelerator (IOA)
- Enhanced FC ID description
- SAN Extension support on the SSN-16
- SME Tape on the SSN-16
- Port Group Monitoring
- X2 DWDM and X2 GE support on the MDS 9134 switch

## NX-OS Feature Descriptions

This section includes descriptions of the major new features of MDS NX-OS Release 4.2(1a) and indicates where the feature is documented.

### Cisco TrustSec Fibre Channel Link Encryption

Cisco TrustSec Fibre Channel Link Encryption addresses customer needs to ensure data integrity and privacy. Cisco TrustSec FC Link Encryption is an extension of the Fibre Channel-Security Protocol (FC-SP) feature and uses the existing FC-SP architecture. Starting with Cisco MDS NX-OS Release 4.2(1a), Fibre Channel data that is passed between E ports of 8-Gbps modules can be encrypted. The encryption algorithm is a 128-bit Advanced Encryption Standard (AES) and enables either AES-Galois Counter Mode (GCM) or AES-Galois Message Authentication Code (GMAC) for an interface. AES-GCM provides encryption and authentication of the frames and AES-GMAC provides only the authentication of the frames that are being passed between two EP ports. Encryption is done at line rate by encapsulating frames at egress with encryption using the GCM mode of AES 128-bit encryption. At ingress, frames are decrypted and authenticated for an integrity check.

Cisco TrustSec Fibre Channel Link Encryption is enabled on a per-chassis basis by the Enterprise Package license.

#### Where Documented

For documentation on the Cisco TrustSec Fibre Channel Link Encryption feature, see Chapter 11 of the *Cisco MDS 9000 Family NX-OS Security Configuration Guide*.

### FICON XRC Acceleration

eXtended Remote Copy (XRC) is a mainframe-based software replication solution in widespread use in financial institutions worldwide. Cisco previously supported XRC over FCIP at distances up to 200 km on the MSM-18/4 module. As of NX-OS Release 4.2(1a), Cisco supports XRC over virtually unlimited distances.

XRC Acceleration is a licensed feature. The Mainframe package license and the SAN Extension (FCIP) license are prerequisites for XRC Acceleration, as it builds on top of the FICON and FCIP capabilities of the MDS 9000 Family.

#### Where Documented

For documentation on the FICON XRC Acceleration feature, see Chapter 11 of the *Cisco MDS 9000 Family NX-OS Fabric Configuration Guide*.

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

## **I/O Accelerator (IOA)**

Cisco MDS NX-OS 4.2(1a) supports the I/O Accelerator (IOA) on the MDS 900018/4-port Multiservice Module (MSM-18/4) and the 16-port Storage Service Node (SSN-16). IOA accelerates I/Os over MANs and WANs using Cisco SCSI acceleration technology. IOA can be deployed with a disk data replication solution such as SRDF, MirrorView, TrueCopy, and CA EVA to extend the distance between data centers or reduce effects of latency. IOA can also be used to enable remote tape backup or restore operations without significant throughput degradation. IOA includes the following key features:

- Fabric Service – IOA extends acceleration service as a fabric service to any port in the fabric, regardless of where it is attached
- Fibre Channel Write Acceleration (FC-WA) and Fibre Channel Tape Acceleration (FC-TA)
- Fibre Channel over IP Write Acceleration (FCIP-WA) and Fibre Channel over IP Tape Acceleration (FCIP-TA)
- High availability PortChannels, plus acceleration over Fibre Channel and FCIP.
- Transport Agnostic – IOA is a unified solution for disk and tape I/O acceleration over MANs and WANs.
- Speed Independent – IOA accelerates 1-, 2-, 4-, 8-, or 10-Gbps links and consolidates traffic over 8- or 10-Gbps ISLs.
- Transparent Insertion – IOA requires no fabric reconfiguration or rewiring.

The IOA package is licensed per service engine and the IOA license is tied to the chassis. The number of licenses required is equal to the number of service engines on which the intelligent fabric application is used.

### **Where Documented**

For documentation about the IOA feature, see the *Cisco MDS 9000 I/O Accelerator Configuration Guide*.

## **SAN Extension Support on the SSN-16**

Starting with MDS NX-OS Release 4.2(1a), you can deploy Fibre Channel Interface Protocol (FCIP) on the new 16-port Storage Services Node (SSN-16). The performance per slot is four times greater for FCIP on the SSN-16 as compared to the MSM-18/4 module. The SSN-16 provides as many Gigabit Ethernet ports as four MSM-18/4 modules.

SAN Extension support on the SSN-16 requires the SAN Extension over IP license.

In addition, the SSN-16 supports the SME tape feature in MDS NX-OS Release 4.2(1a). The SME tape feature on the SSN-16 requires the SME license.

### **Where Documented**

For information about FCIP on the SSN-16, see the *Cisco MDS 9000 Family NX-OS IP Services Configuration Guide*.

For information about the SME tape feature on the SSN-16, see the *Cisco MDS 9000 Family Storage Media Encryption Configuration Guide*.

For hardware information about the SSN-16, see the *Cisco MDS 9500 Series Hardware Installation Guide* and the *Cisco MDS 9200 Series Hardware Installation Guide*.

**[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

## Port Group Monitoring

The new **port-group-monitor** command allows you to monitor port groups that go above and below a configurable bandwidth threshold. When the traffic for a particular port group reaches 80 percent of the maximum supported bandwidth for that port group (rx and tx), NX-OS generates a syslog message that identifies individual port bandwidth (for rx and tx). A syslog message is generated for a rising threshold and for a falling threshold. When port group monitoring is enabled, monitoring occurs every ten seconds.

### Where Documented

For information about the port group monitoring feature, see the *Cisco MDS 9000 Family NX-OS Interfaces Configuration Guide*.

## X2 Transceiver Support on the MDS 9134 Fabric Switch

Starting with MDS NX-OS Release 4.2(1a), the MDS 9134 Fabric Switch supports the 10-Gbps Ethernet DWDM Transceiver and the 10G-Gbps Ethernet Transceiver X2 pluggable modules.

### Where Documented

For information about the X2 transceiver support on the MDS 9134 Switch, see the *Cisco MDS 9100 Series Hardware Installation Guide*.

## Hardware Changes

This section describes hardware changes associated with NX-OS Release 4.2(1a).

## MDS 9000 16-Port Storage Services Node

The Cisco MDS 9000 16-Port Storage Services Node (SSN-16) provides a high-performance, flexible, unified platform for deploying enterprise-class disaster recovery, business continuance, and intelligent fabric applications. The SSN-16 hosts four independent service engines, which can each be individually and incrementally enabled to scale as business requirements change, or be configured to run separate applications. Based on the single service engine in the Cisco MDS 9000 18/4-Port Multiservice Module, this four-to-one consolidation delivers dramatic hardware savings and frees valuable slots in the Cisco MDS 9500 Series Multilayer Directors chassis.

The Cisco MDS 9000 16-Port Storage Services Node integrates transparently into the Cisco MDS 9500 Series Multilayer Directors and the Cisco MDS 9222i Multiservice Modular Switch. Each of the four service engines supports 4 Gigabit Ethernet IP storage services ports, for a total of 16 ports of Fibre Channel over IP (FCIP) connectivity. Traffic can be switched between an IP port and any Fibre Channel port on a Cisco MDS 9000 Family switch. The SSN-16 supports the full range of services available on other Cisco MDS 9000 Family Fibre Channel switching modules, including virtual SANs (VSANs), security, and traffic management.

For hardware information about the SSN-16, see the *Cisco MDS 9500 Series Hardware Installation Guide* and the *Cisco MDS 9200 Series Hardware Installation Guide*.

## Support for Generation 1 Modules

Cisco MDS 9000 NX-OS Release 4.x is the last release to support the following Generation 1 modules:

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

- DS-X9302-14K9 – 14/2-port Multiprotocol Services (MPS-14/2) Module
- DS-X9016 – 16-port 1-, 2-Gbps Fibre Channel Switching Module
- DS-X9032 – 32-port 1-, 2-Gbps Fibre Channel Switching Module
- DS-X9032SSM – 32-port Storage Services Module (SSM)

Support for these Generation 1 modules will be discontinued in NX-OS Release 5.x.

## Licensed Cisco NX-OS Software Packages

Most Cisco MDS 9000 family software features are included in the standard package. However, some features are logically grouped into add-on packages that must be licensed separately, such as the Cisco MDS 9000 Enterprise package, SAN Extension over IP package, Mainframe package, Fabric Manager Server (FMS) package, Storage Services Enabler (SSE) package, Storage Media Encryption package, and Data Mobility Manager package. On-demand ports activation licenses are also available for the Cisco MDS Blade Switch Series and 4-Gbps Cisco MDS 9100 Series Multilayer Fabric switches.

### Enterprise Package

The standard software package that is bundled at no charge with the Cisco MDS 9000 Family switches includes the base set of features that Cisco believes are required by most customers for building a SAN. The Cisco MDS 9000 family also has a set of advanced features that are recommended for all enterprise SANs. These features are bundled together in the Cisco MDS 9000 Enterprise package. Refer to the Cisco MDS 9000 Enterprise package fact sheet for more information.

### SAN Extension over IP Package

The Cisco MDS 9000 SAN Extension over IP package allows the customer to use FCIP to extend SANs over wide distances on IP networks using the Cisco MDS 9000 family IP storage services. Refer to the Cisco MDS 9000 SAN Extension over IP package fact sheet for more information.

### Mainframe Package

The Cisco MDS 9000 Mainframe package uses the FICON protocol and allows control unit port management for in-band management from IBM S/390 and z/900 processors. FICON VSAN support is provided to help ensure true hardware-based separation of FICON and open systems. Switch cascading, fabric binding, and intermixing are also included in this package. Refer to the Cisco MDS 9000 Mainframe package fact sheet for more information.

### Storage Services Enabler Package

The Cisco MDS 9000 SSE package allows network-based storage applications and services to run on the Cisco MDS 9000 family SSMs, Cisco MDS 9000 18/4-Port Multiservice Module (MSM-18/4), and Cisco MDS 9222i. Intelligent fabric applications simplify complex IT storage environments and help organizations gain control of capital and operating costs by providing consistent and automated storage management. Refer to the Cisco MDS 9000 SSE package fact sheet for more information.

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

## On-Demand Port Activation License

On-demand ports allow customers to benefit from Cisco NX-OS Software features while initially purchasing only a small number of activated ports on 4-Gbps Cisco MDS 9100 Series Multilayer Fabric switches. As needed, customers can expand switch connectivity by licensing additional ports.

## Storage Media Encryption Package

The Cisco MDS 9000 Storage Media Encryption package enables encryption of data at rest on heterogeneous tape devices and virtual tape libraries as a transparent fabric service. Cisco SME is completely integrated with Cisco MDS 9000 Family switches and the Cisco Fabric Manager application, enabling highly available encryption services to be deployed without rewiring or reconfiguring SANs, and allowing them to be managed easily without installing additional management software. Refer to the Cisco MDS 9000 Storage Media Encryption package fact sheet for more information. The Storage Media Encryption package is for use only with Cisco MDS 9000 Family switches.

## Data Mobility Manager Package

The Cisco MDS 9000 Data Mobility Manager package enables data migration between heterogeneous disk arrays without introducing a virtualization layer or rewiring or reconfiguring SANs. Cisco DMM allows concurrent migration between multiple LUNs of unequal size. Rate-adjusted migration, data verification, dual Fibre Channel fabric support, and management using Cisco Fabric Manager provide a complete solution that greatly simplifies and eliminates most downtime associated with data migration. Refer to the Cisco MDS 9000 Data Mobility Manager package fact sheet for more information. The Data Mobility Manager package is for use only with Cisco MDS 9000 Family switches.

## I/O Accelerator Package

The Cisco I/O Accelerator (IOA) package activates IOA on the Cisco MDS 9222i fabric switch, the Cisco MDS 9000 18/4 Multiservice Module (MSM-18/4), and on the SSN-16 module. The IOA package is licensed per service engine and is tied to the chassis. The number of licenses required is equal to the number of service engines on which the intelligent fabric application is used. The SSN-16 requires a separate license for each engine on which you want to run IOA. Each SSN-16 engine that you configure for IOA checks out a license from the pool managed at the chassis level. SSN-16 IOA licenses are available as single licenses.

## XRC Acceleration License

The Cisco Extended Remote Copy (XRC) acceleration license activates FICON XRC acceleration on the Cisco MDS 9222i switch and on the MSM-18/4 in the Cisco MDS 9500 Series directors. One license per chassis is required. You must install the Mainframe Package and the SAN Extension over FCIP Package before you install the XRC acceleration license. The Mainframe Package enables the underlying FICON support, and the FCIP license or licenses enable the underlying FCIP support. XRC acceleration is not supported on the SSN-16.



***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

## Limitations and Restrictions

This section lists the limitations and restrictions for this release. The following limitations are described:

- [IPv6, page 33](#)
- [User Roles, page 33](#)
- [Red Hat Enterprise Linux, page 34](#)
- [Generation 1 Module Limitation, page 34](#)
- [Schedule Job Configurations, page 34](#)
- [Maximum Number of Zones Supported in Interop Mode 4, page 34](#)
- [InterVSAN Routing, page 34](#)
- [Java Web Start, page 35](#)
- [VRRP Availability, page 35](#)
- [VRRP Availability, page 35](#)
- [Using a RSA Version 1 Key for SSH Following an Upgrade, page 35](#)
- [CFS Cannot Distribute All Call Home Information, page 36](#)
- [Availability of F Port Trunking and F Port Channels, page 36](#)
- [Reserved VSAN Range and Isolated VSAN Range Guidelines, page 37](#)
- [Applying Zone Configurations to VSAN 1, page 37](#)
- [Running Storage Applications on the MSM-18/4, page 37](#)
- [RSPAN Traffic Not Supported on CTS Ports on 8-Gbps Switching Modules, page 38](#)
- [I/O Accelerator Feature Limitations, page 38](#)
- [Support for FCIP Compression Modes, page 38](#)
- [Saving Copies of the Running Kickstart and System Images, page 38](#)
- [Configuring Buffer Credits on a Generation 2 or Generation 3 Module, page 38](#)
- [PPRC Not Supported with FCIP Write Acceleration, page 39](#)
- [Configuring a Persistent FCID in an IVR Configuration with Brocade Switches, page 39](#)

### IPv6

The management port on Cisco MDS switches supports one user-configured IPv6 address, but does not support auto-configuration of an IPv6 address.

### User Roles

In SAN-OS Release 3.3(x) and earlier, when a user belongs to a role which has a VSAN policy set to Deny and the role allows access to a specific set of VSANs (for example, 1 through 10), the user is restricted from performing the **configuration**, **clear**, **execute**, and **debug** commands which had a VSAN

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

parameter outside this specified set. Beginning with NX-OS Release 4.1(1b), these users are still prevented from performing **configuration**, **clear**, **execute**, and **debug** commands as before, however, they are allowed to perform **show** commands for all VSANs. This addresses the following:

1. In a network environment, users often need to view information in other VSANs even though they do not have permission to modify configurations in those VSANs.
2. This makes the Cisco MDS behavior consistent with other Cisco products such as Nexus 7000 which exhibits the same behavior for those roles (when they apply to the VLAN policy).

## Red Hat Enterprise Linux

The Linux kernel core dump is not supported in NX-OS Release 4.1(1b) and later versions and therefore the CLI command has been removed. A syntax error message will be displayed if you import configurations from SAN-OS Release 3.3(x) and earlier to NX-OS Release 4.1(1b) and later. These syntax errors do not affect the application of other commands in the configuration and can be safely ignored. To address this, remove the kernel core configuration from the ASCII configuration file before importing the configuration.

## Generation 1 Module Limitation

When a Cisco or other vendor switch port is connected to a Generation 1 module port (ISL connection), the receive buffer-to-buffer credit of the port connected to a Generation 1 module port should not exceed 255.

## Schedule Job Configurations

As of MDS NX-OS Release 4.1(1b) and later, the scheduler job configurations need to be entered in a single line with a semicolon(;) as the delimiter.

Job configuration files created with SAN-OS Release 3.3(1c) and earlier, are not supported. However, you can edit the job configuration file and add the delimiter to support Cisco NX-OS Release 4.1(3a).

## Maximum Number of Zones Supported in Interop Mode 4

In interop mode 4, the maximum number of zones that is supported in an active zone set is 2047, due to limitations in the connected vendor switch.

When IVR is used in interop mode 4, the maximum number of zones supported, including IVR zones, in the active zone set is 2047.

## InterVSAN Routing

When using InterVSAN Routing (IVR), it is recommended to enable Cisco Fabric Services (CFS) on all IVR-enabled switches. Failure to do so may cause mismatched active zone sets if an error occurs during zone set activation.

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## Java Web Start

When using Java Web Start, it is recommended that you do not use an HTML cache or proxy server. You can use the Java Web Start Preferences panel to view or edit the proxy configuration. To do this, launch the Application Manager, either by clicking the desktop icon (Microsoft Windows), or type `./javaws` in the Java Web Start installation directory (Solaris Operating Environment and Linux), and then select **Edit> Preferences**.

If you fail to change these settings, you may encounter installation issues regarding a version mismatch. If this occurs, you should clear your Java cache and retry.

## VRRP Availability

The Virtual Router Redundancy Protocol (VRRP) is not available on the Gigabit Ethernet interfaces on the MSM-18/4 module or module 1 of the MDS 9222i switch, even though it is visible on these modules. The feature is not implemented in the current release.

## Using a RSA Version 1 Key for SSH Following an Upgrade

For security reasons, NX-OS Release 4.2(1a) does not support RSA version 1 keys. As a result, if you upgrade to NX-OS Release 4.2(1a) from an earlier version that did support RSA version 1 keys, and you had configured a RSA version 1 key for SSH, then you will not be able to log in through SSH following the upgrade.

If you have a RSA version 1 key configured for SSH, before upgrading to NX-OS Release 4.1(3a), follow these steps:

- 
- Step 1** Disable SSH.
  - Step 2** Create RSA version 2 DSA keys.
  - Step 3** Enable SSH.
  - Step 4** Delete any RSA version 1 keys on any remote SSH clients and replace the version 1 keys with the new version 2 keys from the switch.

Proceed with the upgrade to NX-OS Release 4.2(1a).

---

If you upgrade before disabling SSH and creating RSA version 2 keys, follow these steps:

- 
- Step 1** Open a Telnet session and log in through the console.
  - Step 2** Issue the **no feature ssh** command to disable SSH.
  - Step 3** Issue the **ssh key rsa 1024** command to create RSA version 2 keys.
  - Step 4** Issue the **feature ssh** command to enable SSH.
-

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

## CFS Cannot Distribute All Call Home Information

In MDS NX-OS Release 4.2(1a), CFS cannot distribute the following Call Home commands that can be configured with the **destination-profile** command:

- **destination-profile** *profile\_name* **transport-method**
- **destination-profile** *profile\_name* **http**

The output of the **show running-config callhome** command shows configured Call Home commands:

```
switch# show running-config callhome
> version 4.1(3)
> callhome
> email-contact abc@cisco.com <mailto:abc@cisco.com>
> phone-contact +14087994089
> streetaddress xyxyx
> distribute
> destination-profile testProfile
> destination-profile testProfile format XML
> no destination-profile testProfile transport-method email
> destination-profile testProfile transport-method http
> destination-profile testProfile http https://xyz.abc.com
> destination-profile testProfile alert-group all
> transport email smtp-server 64.104.140.134 port 25 use-vrf management
> transport email from abc@cisco.com <mailto:abc@cisco.com>
> enable
> commit
```

When you attempt to apply these commands in the ASCII configuration, the following commands fail:

```
> no destination-profile testProfile transport-method email
> destination-profile testProfile transport-method http
> destination-profile testProfile http https://xyz.abc.com
```

To work around this issue, issue these commands after the **commit** command.

## Availability of F Port Trunking and F Port Channels

Trunking F ports and trunking F port channels are not supported on the following MDS 9000 components:

- DS-C9134-K9, Cisco MDS 9134 Multilayer Fabric Switch, if NPIV is enabled and the switch is used as the NPV core switch
- DS-C9124-K9, Cisco MDS 9124 Multilayer Fabric Switch, if NPIV is enabled and the switch is used as the NPV core switch

Trunking F ports, trunking F port channels and regular F port channels are not supported on the following MDS 9000 components:

- DS-C9216i-K9, Cisco MDS 9216i Multilayer Fabric Switch
- DS-X9016, Cisco MDS 9000 2-Gbps 16-Port Fibre Channel Switching Module
- DS-X9032, Cisco MDS 9000 2-Gbps 32-Port Fibre Channel Switching Module
- DS-X9032-14K9, Cisco MDS 9000 14/2-Port Multiprotocol Services Module (MPS-14/2)

For configuration information, refer to the “Configuring Trunking” section in the *Cisco MDS 9000 NX-OS Interfaces Configuration Guide*.

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## Reserved VSAN Range and Isolated VSAN Range Guidelines

On an NPV switch with a trunking configuration on any interface, or on a regular switch where the **feature fport\_channel\_trunk** command has been issued to enable the Trunking F PortChannels feature, follow these configuration guidelines for reserved VSANs and the isolated VSAN:

- If trunk mode is on for any of the interfaces or NP PortChannel is up, the reserved VSANs are 3040 to 4078, and they are not available for user configuration.
- The Exchange Virtual Fabric Protocol (EVFP) isolated VSAN is 4079, and it is not available for user configuration.
- VSAN 4079 will be impacted by an upgrade to NX-OS Release 4.1(3a), depending on whether or not VSAN 4079 was created prior to the upgrade. See the [“Upgrading Effect on VSAN 4079” section on page 19](#) for details.

The following VSAN IDs are assigned in the Fibre Channel Framing and Signaling (FC-FS) interface standard:

VF_ID Value	Value Description
00h	Do not use as a Virtual Fabric Identifier.
001h ... EFFh	Available as a Virtual Fabric Identifier.
F00h ... FEEh	Reserved.
FEFh	Control VF-ID (see Fibre Channel Link Services (FC-LS) and Fibre Channel Switch Fabric Generation 4 (FC-SW-4) standards).
FF0h ... FFEh	Vendor specific.
FFFh	Do not use as a Virtual Fabric Identifier.
FEFh = 4079	

## Applying Zone Configurations to VSAN 1

In the setup script, you can configure system default values for the default-zone to be permit or deny, and you can configure default values for the zone distribution method and for the zone mode.

These default settings are applied when a new VSAN is created. However, the settings will not take effect on VSAN 1, because it exists prior to running the setup script. Therefore, when you need those settings for VSAN 1, you must explicitly issue the following commands:

- **zone default-zone permit** *vsan 1*
- **zoneset distribute full** *vsan 1*
- **zone mode enhanced** *vsan 1*

## Running Storage Applications on the MSM-18/4

The Cisco MDS 9000 18/4-Port Multiservice Module (MSM-18/4) does not support multiple, concurrent storage applications. Only one application, such as SME or DMM, can run on the MSM-18/4 at a time.

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## RSPAN Traffic Not Supported on CTS Ports on 8-Gbps Switching Modules

An inter-switch link (ISL) that is enabled for Cisco TrustSec (CTS) encryption must be brought up in non-CTS mode to support remote SPAN (RSPAN) traffic on the following modules:

- DS-X9248-96K9: Cisco MDS 9000 48-Port 8-Gbps Fibre Channel Switching Module
- DS-X9224-96K9: Cisco MDS 9000 24-Port 8-Gbps Fibre Channel Switching Module
- DS-X9248-48K9: Cisco MDS 9000 4/44-Port Host-Optimized 8-Gbps Fibre Channel Switching Module

If the ISL link is brought up with CTS enabled, random packets drops of both RSPAN traffic and normal traffic will occur on the receiver port switch.

## I/O Accelerator Feature Limitations

In NX-OS Release 4.2(1a), IOA does not support the following NX-OS features:

- IVR flows
- Devices with NPV and NPIV enabled
- F port trunking
- F port channeling
- IOA with compression

## Support for FCIP Compression Modes

In Cisco NX-OS Release 4.2(1a), FCIP compression mode 1 and compression mode 3 are not supported on the Cisco MSM-18/4 module and on the SSN-16 module.

## Saving Copies of the Running Kickstart and System Images

After you upgrade to MDS NX-OS Release 4.2(1a), you are not allowed to delete, rename, move, or overwrite the kickstart and system images that are in the current system bootvar settings on an active or standby MDS Supervisor-2 module on any Cisco MDS 9500 Series switch. This restriction does not apply to the integrated supervisor module on the MDS 9200 and MDS 9100 series switches.

## Configuring Buffer Credits on a Generation 2 or Generation 3 Module

When you configure port mode to auto or E on a Generation 2 module, one of the ports will not come up for the following configuration:

- Port Mode: auto or E for all of the ports
- Rate Mode: dedicated
- Buffer Credits: default value

When you configure port mode to auto or E on a Generation 3 module, one or two of the ports will not come up for the following configuration:

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

- Port Mode: auto or E for the first half of the ports, the second half of the ports, or for all of the ports
- Rate Mode: dedicated
- Buffer Credits: default value

When you configure port mode to auto or E for all ports in the global buffer pool, you need to reconfigure buffer credits on one or more of the ports. The total number of buffer credits configured for all the ports in the global buffer pool should be reduced by 64.

## **PPRC Not Supported with FCIP Write Acceleration**

IBM Peer to Peer Remote Copy (PPRC) is not supported with FCIP Write Acceleration.

## **Configuring a Persistent FCID in an IVR Configuration with Brocade Switches**

The following information is relevant if you have a fabric that consists of Cisco MDS 9000 switches and Brocade switches, and the Cisco MDS switches are running either NX-OS Release 4.x or Release 5.x and Brocade is running FOS higher than 6.x. In an IVR configuration, when IVR NAT is enabled on a Cisco MDS 9000 switch, the device in the native VSAN should be configured with a persistent FCID. Assuming the FCID is 0xAABBCC, AA should be configured with the virtual IVR domain ID of the VSAN that contains the ISLs and BB should be configured in the following range:

- 1 through 64 if the Brocade switch is operating in native interop mode.
- 1 through 30 if the Brocade switch is operating in McData Fabric mode or McData Open Fabric Mode.

This configuration ensures that the devices connected to the Cisco MDS 9000 switch can be seen in the name server database on the Brocade switch.

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

# Caveats

This section lists the open and resolved caveats for this release. Use [Table 16](#) to determine the status of a particular caveat. In the table, “O” indicates an open caveat and “R” indicates a resolved caveat.

**Table 16** *Open Caveats and Resolved Caveats Reference*

DDTS Number	NX-OS Software Release (Open or Resolved)	NX-OS Software Release (Open or Resolved)
	4.1(3a)	4.2(1a)
<b>Severity 1</b>		
<a href="#">CSCtc65441</a>	O	O
<b>Severity 2</b>		
<a href="#">CSCsy74340</a>	—	R
<a href="#">CSCsz21804</a>	O	R
<a href="#">CSCsz53741</a>	O	R
<a href="#">CSCsz59152</a>	O	R
<a href="#">CSCsz84411</a>	O	O
<a href="#">CSCta11417</a>	—	R
<a href="#">CSCta22244</a>	O	R
<a href="#">CSCta47460</a>	O	R
<a href="#">CSCta67430</a>	—	R
<a href="#">CSCtb28442</a>	O	R
<a href="#">CSCtb32209</a>	O	R
<a href="#">CSCtb77695</a>	O	R
<a href="#">CSCtc20849</a>	O	O
<a href="#">CSCtc41625</a>	—	O
<a href="#">CSCtc48338</a>	O	O
<a href="#">CSCtd16646</a>	O	O
<a href="#">CSCty32238</a>	—	O
<b>Severity 3</b>		
<a href="#">CSCsq20408</a>	O	O
<a href="#">CSCsy37951</a>	O	O
<a href="#">CSCsy52780</a>	O	R
<a href="#">CSCsy58106</a>	O	R
<a href="#">CSCsy73212</a>	O	R
<a href="#">CSCsz01738</a>	O	R
<a href="#">CSCsz10089</a>	—	R
<a href="#">CSCsz11613</a>	—	R
<a href="#">CSCsz16768</a>	—	R



**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

**Table 16** Open Caveats and Resolved Caveats Reference (continued)

DDTS Number	NX-OS Software Release (Open or Resolved)	NX-OS Software Release (Open or Resolved)
	4.1(3a)	4.2(1a)
<a href="#">CSCsz40628</a>	—	R
<a href="#">CSCsz74907</a>	O	R
<a href="#">CSCsz75692</a>	—	R
<a href="#">CSCsz84022</a>	—	R
<a href="#">CSCsz95999</a>	O	R
<a href="#">CSCta08796</a>	—	R
<a href="#">CSCta15575</a>	—	R
<a href="#">CSCta28642</a>	—	R
<a href="#">CSCta34629</a>	—	R
<a href="#">CSCtb29470</a>	O	R
<a href="#">CSCtb62488</a>	O	R
<a href="#">CSCtc04286</a>	O	O
<a href="#">CSCtc41865</a>	—	O
<b>Severity 4</b>		
<a href="#">CSCsw87910</a>	—	R
<a href="#">CSCta32005</a>	—	R
<b>Severity 6</b>		
<a href="#">CSCsz22811</a>	O	R
<a href="#">CSCta28484</a>	O	O
<a href="#">CSCtb80346</a>	O	R

## Resolved Caveats

- [CSCsy74340](#)  
**Symptom:** The SCSI Flow Manager (SFM) failed as a result of a link flap of a SCSI-FLOW target configured for IVR.  
**Workaround:** This issue is resolved.
- [CSCsz21804](#)  
**Symptom:** After you perform an in-service software upgrade (ISSU) from SAN-OS Release 3.x to NX-OS Release 4.x, the **show fcs database** command does not display the attached pWWNs.  
**Workaround:** This issue is resolved.
- [CSCsz53741](#)  
**Symptom:** When a crossbar module fails because of sync loss, MDS 9000 switches try to recover the fabric module by power cycling the crossbar. This may result in lost data path connectivity because the recovery may not be complete.  
**Workaround:** This issue is resolved.

**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

- CSCsz59152

**Symptom:** On an MDS 9513 switch, the crossbar ASIC on a Fabric 1 or Fabric 2 module may fail. As a result, some ports may get disabled on the modules that use the crossbar links in the bad fabric module.

**Workaround:** This issue is resolved.
- CSCta11417

**Symptom:** During a non-disruptive software upgrade, the Forwarding Information Base (FIB) process might terminate on the following modules:

  - MDS 9000 48-port 8-Gbps module
  - MDS 9000 24-port 8-Gbps module
  - MDS 9000 4/44-port host optimized 8-Gbps module

You might experience this issue if you upgrade from NX-OS Release 4.1(1b) or Release 4.1(1c) to Release 4.1(3a). However, you will not experience this issue if you upgrade from NX-OS Release 4.1(1b), Release 4.1(1c), or Release 4.1(3a) to Release 4.2(1a).

**Workaround:** This issue is resolved by upgrading to NX-OS Release 4.2(1a) or later.
- CSCta22244

**Symptom:** On MDS switches running NX-OS software earlier than NX-OS Release 4.2(1a), an **fttrace** command or **fcping** command will not show the correct path to the target switch if any of the switches are connected through an ISL using any of the ports of the following modules:

  - DS-X9248-48K9: 4/44-Port 8-Gbps Host-Optimized Fibre Channel Switching Module
  - DS-X9248-96K9: 48-Port 8-Gbps Fibre Channel Switching Module
  - DS-X9224-96K9: 24-Port 8-Gbps Fibre Channel Switching Module

The output of an **fttrace** or **fcping** command will not show any information about the switches connected through the ports of these modules.

**Workaround:** This issue is resolved.
- CSCta47460

**Symptom:** The Online Health Management System (OHMS) did not receive a congestion status when the ports were in a hardware failure state.

**Workaround:** This issue is resolved.
- CSCta67430

**Symptom:** If a host issues a tape read command with the suppress incorrect-length indicator (SILI) bit set, it is possible for the target to return a good status and not send the full read data length requested in the read command. If this occurs, FCIP tape acceleration can leave the exchange entry in an error recovery state on the FCIP target side, and remove the exchange entry on the FCIP host side. As a result, FCIP loss of sync failure can occur.

**Workaround:** This issue is resolved.
- CSCtb28442

**Symptom:** End of sequence is not set for STK drives when the host requests more data than what is written to the tape.

**Workaround:** This issue is resolved.

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

- CSCtb32209
 

**Symptom:** If there are DWDM link failures of less than 100ms, an MDS switch sends a NOS, which results in traffic disruption, especially when there is FICON traffic.

**Workaround:** This issue is resolved.
- CSCtb77695
 

**Symptom:** When a tape reaches its capacity, an IBM TS1120 tape drive send a check condition with eom=1 and asc\_ascq = 0. Because asc\_ascq is not set to End of Medium or Partition, SME continues to send traffic as if the end of the tape has not been reached. As a result, the backup fails when it spans across multiple tapes. This issue is specific only to IBM TS1120 tape drives.

**Workaround:** This issue is resolved.
- CSCsy52780
 

**Symptom:** Occasionally, when you enter the **feature npv** command to enable NPV, or enter the **no feature npv** command to disable NPV, the switch does not reload as expected. Instead, it returns to the Configuration mode prompt.

**Workaround:** This issue is resolved.
- CSCsy58106
 

**Symptom:** When dual supervisor modules are installed on a Cisco MDS switch running Cisco NX-OS Release 4.1(3a), if the feature `fport_channel_trunk` command has been issued to enable the F PortChannel feature and a switchover is performed, new F port trunking and F port channeling configurations cannot be made and the existing links may not come up if they flap after a switchover.

**Workaround:** This issue is resolved.
- CSCsy73212
 

**Symptom:** Under rare conditions, a port may drop data after the port flaps in the presence of congestion. The output of the **show hardware internal packet-flow dropped** command shows the dropped data as RX (receive) frame drops on a module. In such instances, the following type 1, type 2, and possibly type 3 errors may be seen:

  - Type 1 errors are internal ASIC parser CRC errors.
  - Type 2 errors are internal ASIC overflow or ECC parity errors.
  - Type 3 errors may occur when ports on a DS-X9124 or DS-X9148 module are put into a hardware failure state by the software. If all ports fail in this fashion, then the software reloads the module. If only some of the ports fail, the module is not reloaded.

For this issue to occur, the port must have frames held in the port buffer at the time that the port is brought down and up. A port normally has time to empty its buffers when it is shut down. However, in unusual cases, such as if there is congestion on the port at the time of the shutdown, or in rare cases, frames can still be held in the buffers while the port is reinitialized.

**Workaround:** This issue is resolved.
- CSCsz01738
 

**Symptom:** A host that is behind a NPIV F port cannot see the zoned LUNs if the addition of the F port to the zone and the zone set activation occur after an In Service Software Upgrade (ISSU). This issue applies only to an NPIV F port on MDS 9124 and MDS 9134 fabric switches

**Workaround:** This issue is resolved.

**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

- CSCsz10089  
**Symptom:** The IVR over FCIP MSM-18/4 license is not using the FCIP license, but is checking out the Enterprise license.  
**Workaround:** This issue is resolved.
- CSCsz11613  
**Symptom:** The otheridentifyingInfo property on the CIM Server is returning incorrect domain IDs.  
**Workaround:** This issue is resolved.
- CSCsz16768  
**Symptom:** When NPV is enabled, IP access list commands are not accessible.  
**Workaround:** This issue is resolved.
- CSCsz40628  
**Symptom:** An Inter-Switch Link (ISL) does not come up after one switch reloads.  
**Workaround:** This issue is resolved.
- CSCsz74907  
**Symptom:** In very rare circumstances, the zone server might fail due to a heartbeat failure.  
**Workaround:** This issue is resolved.
- CSCsz75692  
**Symptom:** When a Cisco Fabric Switch for HP c-Class BladeSystem or Cisco Fabric Switch for IBM BladeCenter reloads following the **system startup-config init** command, the switch does not auto boot, but remains at the loader prompt. The command erroneously erases the startup configuration from the boot flash.  
**Workaround:** This issue is resolved.
- CSCsz84022  
**Symptom:** The TPC application cannot discover the MDS 9509 switch when it is connected to an MDS 9020 switch.  
**Workaround:** This issue is resolved.
- CSCsz95999  
**Symptom:** A kernel failure in the Mgmt0 driver caused the MDS 9222i switch to reboot  
**Workaround:** This issue is resolved.
- CSCta08796  
**Symptom:** A memory leak caused the port manager to fail and put the ports in a hardware failure state.  
**Workaround:** This issue is resolved.
- CSCta15575  
**Symptom:** The SystemName property on the CIM Server is returning the wrong values for N port and F port.  
**Workaround:** This issue is resolved.
- CSCta28642  
**Symptom:** SNMP should gracefully handle timeouts caused by port initialization.  
**Workaround:** This issue is resolved.

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

- CSCta34629  
**Symptom:** The system manager core server does not clean up the core files on the MDS 9513 switch.  
**Workaround:** This issue is resolved.
- CSCtb29470  
**Symptom:** A large sequence number causes Performance Manager in Web Client to not function properly.  
**Workaround:** This issue is resolved.
- CSCtb62488  
**Symptom:** Port flaps during a zone set activation cause the zone set to get stuck with the status: Activation in progress.  
**Workaround:** This issue is resolved.
- CSCsw87910  
**Symptom:** When running Cisco MDS Release SAN-OS 3.3(2) with DPVM enabled, if a link flaps for a end device with DPVM enabled, you might see the following message in the output of the **show logging log** command:  

```
%DPVM-3-PSS_ERR: Failed to update Login info NPV contextpwnn:
50:00:00:00:aa:99:ee:44, syserr = no such pss key
```

**Workaround:** This issue is resolved.
- CSCta32005  
**Symptom:** Upon receiving an OLS when a link went down, the OLS counter was not incremented.  
**Workaround:** This issue is resolved.
- CSCsz22811  
**Symptom:** Compression throughput on the MSM-18/4 module has been improved.  
**Workaround:** This issue is resolved.
- CSCtb80346  
**Symptom:** When an SFP is removed because a port is Administratively Down or Out of Service, a syslog message should be generated.  
**Workaround:** This issue is resolved.

## Open Caveats

- CSCtc65441  
**Symptom:** A watchdog timeout error may cause a Cisco MDS 9124 switch to fail and reload. This symptom may occur when there is excessive traffic or errors on the mgmt0 port.  
**Workaround:** Avoid overloading the mgmt0 port.
- CSCsz84411  
**Symptom:** An MDS 9124 switch may randomly reboot with a reset reason of unknown. This is a rare event and occurs only in systems that have a single power supply with a serial number beginning with QCS.  
**Workaround:** Install and power up the redundant power supply.

**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

- CSCtc20849

**Symptom:** Following a reboot of an MDS 9513 switch running Cisco SAN-OS Release 3.3(2), both supervisor modules generated core files. The **show cores** command and the **show system reset-reason** command displayed the following output:

```
switch# show cores
Module-num      Process-name    PID      Core-create-time
-----
8               qos            15671    Sep 21 22:16
7               qos            4370     Sep 21 22:17

switch# show system reset-reason
----- reset reason for Supervisor-module 8 (from Supervisor in slot 8) ---
1) At 517868 usecs after Mon Sep 21 22:12:09 2009
   Reason: Reset triggered due to HA policy of Reset
   Service: Service "qos"
   Version: 3.3(2)

----- reset reason for Supervisor-module 7 (from Supervisor in slot 7) ---
1) At 260648 usecs after Mon Sep 21 22:12:37 2009
   Reason: Reset triggered due to HA policy of Reset
   Service: Service "qos"
   Version: 3.3(2)
```

**Workaround:** To mitigate the risk of a QoS failure, configure static persistent FC IDs so that the local logins do not share the same domain or area. There should be no more than 50 logins with the same area.

In addition, you can enter the **show qos internal mem-stats detail | inc fcid** command and then check the current allocation value of the QOS\_MEM\_qos\_fcid in the output. If this value is close to 70000, then there is a high chance of a QoS failure, followed by a system reboot.

- CSCtc41625

**Symptom:** If IOA receives a data stream that cannot be compressed, and if the batch of data accumulated by IOA aligns to an internal buffer size, the IOA service engine will reset.

**Workaround:** None. Because there is no workaround in NX-OS Release 4.2(1a), IOA does not support compression in Cisco NX-OS Release 4.2(1a) and Release 4.2(1b).

- CSCtc48338

**Symptom:** On any of the MDS 9500 Series Director switches that have removable Supervisor 2 modules, a supervisor may reset when any one of the following commands is executed on the switch, or the same information is collected through Cisco Fabric Manager or Device Manager:

- **show hardware internal mgmt0 stats**
- **show hardware internal eobc stats**
- **show tech**
- **show tech details**
- **show tech-support**
- **tac-pac**

In NX-OS Release 4.1(x) and Release 4.2(x), there are two additional commands that may cause this issue:

- **show tech-support sysmgr**
- **show tech-support ha**

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

In a dual supervisor switch, entering one of these commands will force a supervisor switchover. In single supervisor systems, the switch will reload.

This issue does not affect switches with a nonremovable Supervisor 2 module, such as the MDS 9222i or MDS 9124.

**Workaround:** There are three ways that you can work around this issue:

- Do not enter the **show hardware internal mgmt0 stats** command or the **show hardware internal eobc stats** command.
- Upgrade to one of the following software releases when it becomes available:
  - Cisco SAN-OS Release 3.3(4a) or above
  - Cisco NX-OS Release 4.2(3) or above
- Before running the **show tech-support** command, the **show tech-support details** command, or the **tacpac** command from the CLI or from Cisco Fabric Manager or Device manager, download a plug-in from the Software Download Center to patch the commands. Load the plug-in on the active and standby supervisor as described in the following steps. The plug-in is not persistent across switchovers and should be loaded any time a switchover occurs.

To download and install the plug-in, follow these steps:

1. Download the plug-in from  
<http://tools.cisco.com/support/downloads/go/Redirect.x?mdfid=282764109>
2. Select release 1.0.
3. Make a copy of the downloaded gplug by entering the following command:  

```
switch# copy bootflash:m9500-sup2-showtech-FN63288-plugin-1.0.bin  
bootflash:gplug_copy
```
4. Copy the copy of the gplug to the standby supervisor by entering the following command:  

```
switch# copy bootflash:gplug_copy bootflash://sup-remote/
```
5. Load the gplug on the active supervisor by entering the following command:  

```
switch# load bootflash:gplug_copy
```
6. Attach to the standby supervisor by entering the following command:  

```
switch# attach module <standby-sup-slot>
```
7. Load the gplug on the standby supervisor by entering the following command:  

```
switch# load bootflash:gplug_copy
```

For additional information, see the Field Notice FN - 63288 that is available at these links:

Guest: <http://www.cisco.com/en/US/ts/fn/632/fn63288.html>

Customer: <http://www.cisco.com/en/US/customer/ts/fn/632/fn63288.html>

- CSCtd16646

**Symptom:** Bit errors occurred on frames received from the Cisco Fabric Switch for IBM BladeCenter on slots 1 through 4.

**Workaround:** Upgrade to NX-OS Release 4.2(3) where this issue is resolved.

- CSCty32238

**Symptom:** On certain hardware, certain Cisco MDS 9000 Series features and applications do not work. These include IVR, IOA, DMM, SME, fcfllow, and SPAN.

The following devices with hardware revision 1.5 are affected by this issue:

- DS-X9248-96K9, 48-port 8-Gbps Fibre Channel Switching Module

## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

- DS-X9248-48K9, 4/44-port host-optimized 8-Gbps Fibre Channel Switching Module
- DS-X9224-96K9, 24-port 8-Gbps Fibre Channel Switching Module

The following devices with hardware revision 1.0 are affected by this issue:

- DS-X9304-18K9, 18/4-Port Multiservice Module (MSM-18/4)  
For this module, the affected version is 73-14372-01A0 hardware version 1.0 (due to the new 73-number)
- DS-C9222i-K9, Cisco MDS 9222i Multilayer Fabric Switch  
For this switch, the affected version is 73-14373-01A0 hardware version 1.0 (due to the new 73-number)

For the DS-X9248-96K9, DS-X9248-48K9 and DS-X9224-96K9 modules, the output of the **show module** command indicates whether or not the device is affected.

```
switch# sh mod 2
Mod  Ports  Module-Type                Model                Status
---  ---
2    24      1/2/4/8 Gbps FC Module    DS-X9224-96K9       ok

Mod  Sw          Hw      World-Wide-Name(s) (WWN)
---  ---
2    5.2(1)     <B>1.0</B>    20:41:00:0d:ec:24:f4:c0 to
20:58:00:0d:ec:24:f4:c0
```

In the preceding output, the device is hardware revision 1.0 and therefore not affected.

For the DS-X9304-18K9 and the DS-C9222i-K9, the **show module** command might indicate hardware version 1.0 due to new part numbers; however the **show sprom module** command shows the affected parts.

```
switch# sh mod 9
Mod  Ports  Module-Type                Model                Status
---  ---
9    22      4x1GE IPS, 18x1/2/4Gbps FC Module    DS-X9304-18K9       ok

Mod  Sw          Hw      World-Wide-Name(s) (WWN)
---  ---
9    5.2(1)     1.0      22:01:00:0d:ec:25:e9:80 to 22:12:00:0d:ec:25:e9:80

Mod  MAC-Address(es)                Serial-Num
---  ---
9    00-1a-e2-03-4c-5c to 00-1a-e2-03-4c-64    JAE1131SCBW

switch# sh sprom module 9 1 |egrep "Part|Serial"
Serial Number   : JAE1131SCBW
Part Number     : 73-10688-06      <-- Not 73-14372-01 so h/w ver 1.0 is OK
Part Revision   : A0
```

**Workaround:** Upgrade to software release that has the fix for this issue.

- After performing a software upgrade to a Cisco NX-OS release that contains a fix for this issue, it may be necessary to enter the **shut** command followed by the **no shut** command on the affected host ports to regain connectivity.
- If you perform a nondisruptive upgrade or downgrade from a release that contains a fix to a release that does not contain the fix, you need to reload each module affected by this issue.
- If you have a Cisco MDS 9222i switch that is affected by this issue, and you perform a nondisruptive upgrade or downgrade from a release that contains a fix to a release that does not contain the fix, you need to reload the switch.



## Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

- CSCsq20408

**Symptom:** The **show startup** command displays aspects of the running configuration when SANtap is configured and/or SANtap objects are created. When a user creates objects such as a CVT or DVT, the configuration is showing in the running-configuration and in the startup-configuration without copying the configuration into the startup-configuration.

**Workaround:** Issue a copy **running-config startup-config** command whenever you create objects such as a CVT or DVT so that the running-configuration and startup-configuration are synchronized.

- CSCsy37951

**Symptom:** The Trunking F PortChannels feature is not available in NX-OS Release 4.1(1x); however, a downgrade from Release 4.1(3a) or later to Release 4.1(1x) is nondisruptive, even when the Trunking F PortChannels feature is enabled (using the **feature fport-channel-trunk** command) while running Release 4.1(3a) or later.

**Workaround:** If a downgrade to Release 4.1(1x) is performed when the Trunking F PortChannels feature is enabled, the switch will be in an inconsistent state. You must reload the switch after a downgrade to Release 4.1(1x).

- CSCtc04286

**Symptom:** During bring up of the switch port, the port may go into an error disabled state with the reason “excessive interrupts.” This situation can occur if the other end that is connected to the port continuously sends OLS or NOS primitives.

**Workaround:** To recover from the failure, enter the **shut** command, followed by the **no shut** command for the port. The switch will attempt to bring up the port again.

- CSCtc41865

**Symptom:** During a software upgrade or a reload of the Cisco MDS 9000 MSM-18/4 module or the Cisco MDS 9000 SSN-16 module, IOA flows that are bound to the module are migrated to another IOA service engine in the fabric. The migration causes IOA to trigger a re-login of the host to the target. This process takes several seconds to complete. Certain devices do not tolerate the delay and do not re-login to the target. These devices require a manual intervention to re-login.

This issue has been observed only in certain storage arrays involved in remote replication applications. Host drivers involved in tape backup environments do not exhibit this issue.

**Workaround:** Some applications may require manual intervention for the storage arrays to re-login. The manual intervention should be implemented from the storage array software.

- CSCta28484

**Symptom:** On a Cisco MDS 9000 switch that is running Cisco NX-OS Release 4.x software, call home emails are not generated for link failures such as the following:

```
%PORT-5-IF_DOWN_LINK_FAILURE: %$VSAN 36%$ Interface fc2/13 is down (Link failure)
```

**Workaround:** For ports where you wish to receive a call home message for link failures, configure RMON to trigger an alert when a link failure occurs. RMON will in turn generate a call home message, provided that the RMON alert group is part of the call home destination profile.

## Related Documentation

The documentation set for NX-OS for the Cisco MDS 9000 Family includes the following documents. To find a document online, access the following web site:

[http://www.cisco.com/en/US/products/ps5989/tsd\\_products\\_support\\_series\\_home.html](http://www.cisco.com/en/US/products/ps5989/tsd_products_support_series_home.html)

***Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)***

The documentation set for Cisco Fabric Manager appears in the *Cisco Fabric Manager Release Notes for Release 4.2(1)*, which is available from the following website:

[http://www.cisco.com/en/US/products/ps10495/prod\\_release\\_notes\\_list.html](http://www.cisco.com/en/US/products/ps10495/prod_release_notes_list.html)

## Release Notes

- *Cisco MDS 9000 Family Release Notes for Cisco MDS NX-OS Releases*
- *Cisco MDS 9000 Family Release Notes for MDS SAN-OS Releases*
- *Cisco MDS 9000 Family Release Notes for Storage Services Interface Images*
- *Cisco MDS 9000 Family Release Notes for Cisco MDS 9000 EPLD Images*

## Regulatory Compliance and Safety Information

- *Regulatory Compliance and Safety Information for the Cisco MDS 9000 Family*

## Compatibility Information

- *Cisco Data Center Interoperability Support Matrix*
- *Cisco MDS 9000 NX-OS Hardware and Software Compatibility Information and Feature Lists*
- *Cisco MDS NX-OS Release Compatibility Matrix for Storage Service Interface Images*
- *Cisco MDS 9000 Family Switch-to-Switch Interoperability Configuration Guide*
- *Cisco MDS NX-OS Release Compatibility Matrix for IBM SAN Volume Controller Software for Cisco MDS 9000*
- *Cisco MDS SAN-OS Release Compatibility Matrix for VERITAS Storage Foundation for Networks Software*

## Hardware Installation

- *Cisco MDS 9500 Series Hardware Installation Guide*
- *Cisco MDS 9200 Series Hardware Installation Guide*
- *Cisco MDS 9100 Series Hardware Installation Guide*
- *Cisco MDS 9124 and Cisco MDS 9134 Multilayer Fabric Switch Quick Start Guide*

## Software Installation and Upgrade

- *Cisco MDS 9000 NX-OS Release 4.1(x) and SAN-OS 3(x) Software Upgrade and Downgrade Guide*
- *Cisco MDS 9000 Family Storage Services Interface Image Install and Upgrade Guide*
- *Cisco MDS 9000 Family Storage Services Module Software Installation and Upgrade Guide*

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

## Cisco NX-OS

- *Cisco MDS 9000 Family NX-OS Licensing Guide*
- *Cisco MDS 9000 Family NX-OS Fundamentals Configuration Guide*
- *Cisco MDS 9000 Family NX-OS System Management Configuration Guide*
- *Cisco MDS 9000 Family NX-OS Interfaces Configuration Guide*
- *Cisco MDS 9000 Family NX-OS Fabric Configuration Guide*
- *Cisco MDS 9000 Family NX-OS Quality of Service Configuration Guide*
- *Cisco MDS 9000 Family NX-OS Security Configuration Guide*
- *Cisco MDS 9000 Family NX-OS IP Services Configuration Guide*
- *Cisco MDS 9000 Family NX-OS Intelligent Storage Services Configuration Guide*
- *Cisco MDS 9000 Family NX-OS High Availability and Redundancy Configuration Guide*
- *Cisco MDS 9000 Family NX-OS Inter-VSAN Routing Configuration Guide*

## Command-Line Interface

- *Cisco MDS 9000 Family Command Reference*

## Intelligent Storage Networking Services Configuration Guides

- *Cisco MDS 9000 I/O Acceleration Configuration Guide*
- *Cisco MDS 9000 Family SANTap Deployment Guide*
- *Cisco MDS 9000 Family Data Mobility Manager Configuration Guide*
- *Cisco MDS 9000 Family Storage Media Encryption Configuration Guide*
- *Cisco MDS 9000 Family Secure Erase Configuration Guide*
- *Cisco MDS 9000 Family Cookbook for Cisco MDS SAN-OS*

## Troubleshooting and Reference

- *Cisco NX-OS System Messages Reference*
- *Cisco MDS 9000 Family NX-OS Troubleshooting Guide*
- *Cisco MDS 9000 Family NX-OS MIB Quick Reference*
- *Cisco MDS 9000 Family NX-OS SMI-S Programming Reference*

**Send documentation comments to [mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)**

## Obtaining Documentation and Submitting a Service Request

For information on obtaining documentation, submitting a service request, and gathering additional information, see the monthly *What's New in Cisco Product Documentation*, which also lists all new and revised Cisco technical documentation, at:

<http://www.cisco.com/en/US/docs/general/whatsnew/whatsnew.html>

Subscribe to the *What's New in Cisco Product Documentation* as a Really Simple Syndication (RSS) feed and set content to be delivered directly to your desktop using a reader application. The RSS feeds are a free service and Cisco currently supports RSS version 2.0.

---

This document is to be used in conjunction with the documents listed in the “[Related Documentation](#)” section.

CCDE, CCENT, CCSI, Cisco Eos, Cisco HealthPresence, Cisco Ironport, the Cisco logo, Cisco Lumin, Cisco Nexus, Cisco Nurse Connect, Cisco Stackpower, Cisco StadiumVision, Cisco TelePresence, Cisco Unified Computing System, Cisco WebEx, DCE, Flip Channels, Flip for Good, Flip Mino, Flip Video, Flip Video (Design), Flipshare (Design), Flip Ultra, and Welcome to the Human Network are trademarks; Changing the Way We Work, Live, Play, and Learn, Cisco Store, and Flip Gift Card are service marks; and Access Registrar, Aironet, AsyncOS, Bringing the Meeting To You, Catalyst, CCDA, CCDP, CCIE, CCIP, CCNA, CCNP, CCSP, CCVP, Cisco, the Cisco Certified Internetwork Expert logo, Cisco IOS, Cisco Press, Cisco Systems, Cisco Systems Capital, the Cisco Systems logo, Cisco Unity, Collaboration Without Limitation, EtherFast, EtherSwitch, Event Center, Fast Step, Follow Me Browsing, FormShare, GigaDrive, HomeLink, Internet Quotient, IOS, iPhone, iQuick Study, IronPort, the IronPort logo, LightStream, Linksys, MediaTone, MeetingPlace, MeetingPlace Chime Sound, MGX, Networkers, Networking Academy, Network Registrar, PCNow, PIX, PowerPanels, ProConnect, ScriptShare, SenderBase, SMARTnet, Spectrum Expert, StackWise, The Fastest Way to Increase Your Internet Quotient, TransPath, WebEx, and the WebEx logo are registered trademarks of Cisco Systems, Inc. and/or its affiliates in the United States and certain other countries.

All other trademarks mentioned in this document or website are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (0907R)

Any Internet Protocol (IP) addresses used in this document are not intended to be actual addresses. Any examples, command display output, and figures included in the document are shown for illustrative purposes only. Any use of actual IP addresses in illustrative content is unintentional and coincidental.

© 2009 Cisco Systems, Inc. All rights reserved.