



Cisco Nexus 3500 Series NX-OS Release Notes, Release 6.0(2)A8(4a)

This document describes the features, bugs, and limitations for Cisco Nexus 3500 Series switches. Use this document in combination with documents listed in the “Obtaining Documentation and Submitting a Service Request” section.

Note: Release notes are sometimes updated with new information about restrictions and bugs. See the following website for the most recent version of the Cisco Nexus 3500 Series release notes: <http://www.cisco.com/c/en/us/support/switches/nexus-3000-series-switches/products-release-notes-list.html>.

Table 1 shows the online change history for this document.

Table 1. Online History Change

| Date | Description |
|---------------|---|
| June 16, 2017 | Created NX-OS Release 6.0(2)A8(4a) release notes. |

Contents

| | |
|---|----------|
| Introduction | 2 |
| System Requirements | 3 |
| New and Changed Information | 5 |
| Caveats | 6 |
| Upgrade Path to Cisco NX-OS Release 6.x | 8 |
| Limitations | 8 |
| Best Practices | 8 |
| MIB Support | 8 |
| Related Documentation | 9 |
| Documentation Feedback | 9 |
| Obtaining Documentation and Submitting a Service Request | 9 |

Introduction

Several new hardware and software features are introduced for the Cisco Nexus 3548 switch to improve the performance, scalability, and management of the product line. Cisco NX-OS Release 6.0 also supports all hardware and software supported in Cisco NX-OS Release 5.1 and Cisco NX-OS Release 5.0.

Cisco NX-OS offers the following benefits:

- Cisco NX-OS runs on all Cisco data center switch platforms: Cisco Nexus 7000, Nexus 5000, Nexus 4000, Nexus 3000, Nexus 2000, and Nexus 1000V Series switches.
- Cisco NX-OS software interoperates with Cisco products that run any variant of Cisco IOS software and also with any networking operating system that conforms to common networking standards.
- Cisco NX-OS modular processes are triggered on demand, each in a separate protected memory space. Processes are started and system resources are allocated only when a feature is enabled. The modular processes are governed by a real-time preemptive scheduler that helps ensure timely processing of critical functions.
- Cisco NX-OS provides a programmatic XML interface that is based on the NETCONF industry standard. The Cisco NX-OS XML interface provides a consistent API for devices. Cisco NX-OS also provides support for Simple Network Management Protocol (SNMP) Versions 1, 2, and 3 MIBs.
- Cisco NX-OS enables administrators to limit access to switch operations by assigning roles to users. Administrators can customize access and restrict it to the users who require it.

This section includes the following topics:

- Cisco Nexus 3500 Series Switches
- Cisco Nexus 3548 Switch
- Cisco Nexus 3524 Switch

Cisco Nexus 3500 Series Switches

The Cisco Nexus 3500 platform is an extension of the Cisco Nexus 3000 Series of 100M, 1, 10, and 40 Gigabit Ethernet switches built from a switch-on-a-chip (SoC) architecture. Switches in the Cisco Nexus 3500 series include Algorithm Boost (or Algo Boost) technology that is built into the switch application-specific integrated circuit (ASIC). Algo Boost allows the Cisco Nexus 3548 switch to achieve Layer 2 and Layer 3 switching latencies of less than 200 nanoseconds (ns). In addition, Algo Boost contains several innovations for latency, forwarding features, and performance visibility, including two configurable modes for low latency:

- Normal mode: This mode is suitable for environments needing low latency and high scalability.
- Warp mode: This mode consolidates forwarding operations within the switching ASIC, lowering latency by up to an additional 20 percent compared to normal operation.

Active buffer monitoring accelerates the collection of buffer utilization data in hardware, allowing significantly faster sampling intervals. Even on the lowest-latency switches, data packets can incur a millisecond or more of latency during periods of congestion. Previous buffer utilization monitoring techniques were based entirely on software polling algorithms with polling with higher polling intervals that can miss important congestion events.

Cisco Nexus 3548 Switch

The Cisco Nexus 3548 switch is the first member of the Cisco Nexus 3500 platform. As a compact one-rack-unit (1RU) form-factor 10 Gigabit Ethernet switch, the Cisco Nexus 3548 switch provides line-rate Layer 2 and Layer 3 switching at extremely low latency. The switch runs Cisco NX-OS software that has comprehensive features and functions that are widely deployed globally. The Cisco Nexus 3548 contains no physical layer (PHY) chips, which allows low latency and low power consumption. The switch supports both forward and reversed airflow and both AC and DC power inputs.

Cisco Nexus 3524 Switch

The Cisco Nexus 3524 switch is a Cisco Nexus 3548 switch, but with only 24 ports active and can be upgraded to use all 48 ports. As a compact one-rack-unit (1RU) form-factor 10 Gigabit Ethernet switch, the Cisco Nexus 3548 switch is the lowest entry point for main-stream top-of-rack (TOR) data center deployments which offers line-rate Layer 2 and Layer 3 switching with a comprehensive feature set, including Algo Boost technology, and ultra-low latency.

For information about the Cisco Nexus 3500 Series, see the *Cisco Nexus 3500 Series Hardware Installation Guide*.

System Requirements

This section includes the following topic:

- [Hardware Supported](#)

Hardware Supported

Cisco NX-OS Release 6.0(2)A8(4a) supports the Cisco Nexus 3500 Series switches. You can find detailed information about supported hardware in the Cisco Nexus 3500 Series Hardware Installation Guide.

Table 2 shows the hardware supported by Cisco NX-OS Release 6.0(2)A8(4a) software.

Table 2. Hardware Supported by Cisco NX-OS Release 6.0(2)A8(4a) Software.

| Hardware | Part Number | Supported Software Release |
|--|------------------|--------------------------------|
| Cisco Nexus 3500 Series | | |
| Cisco Nexus 3548 switch | N3K-C3548P-10G | 5.0(3)A1(1) and later releases |
| Cisco Nexus 3548x switch, 48 SFP+ | N3K-C3548P-10GX | 6.0(2)A6(1) and later releases |
| Cisco Nexus 3524 switch | N3K-C3524P-10G | 6.0(2)A6(1) and later releases |
| Cisco Nexus 3524 switch, 24 SFP+ | N3K-C3524P-10GX | 5.0(3)A1(1) and later releases |
| Cisco Nexus 2000 or Nexus 3000 individual fan, forward airflow (port side exhaust) | NXA-FAN-30CFM-F | 5.0(3)A1(1) and later releases |
| Cisco Nexus 2000 or Nexus 3000 individual fan, reversed airflow (port side intake) | NXA-FAN-30CFM-B | 5.0(3)A1(1) and later releases |
| Cisco Nexus 2000 or Nexus 3000 400W AC power supply, forward airflow (port side exhaust) | N2200-PAC-400W | 5.0(3)A1(1) and later releases |
| Cisco Nexus 2000 or Nexus 3000 400W AC power supply, reversed airflow (port side intake) | N2200-PAC-400W-B | 5.0(3)A1(1) and later releases |
| Cisco Nexus 2000 or Nexus 3000 400W DC power supply, forward airflow (port side exhaust) | N2200-PDC-400W | 5.0(3)A1(1) and later releases |

| Hardware | Part Number | Supported Software Release |
|--|------------------|--------------------------------|
| Cisco Nexus 2000 or Nexus 3000 350W DC power supply, reversed airflow (port side intake) | N3K-PDC-350W-B | 5.0(3)A1(1) and later releases |
| Transceivers | | |
| 10-Gigabit | | |
| 10GBASE-ZR SFP+ module (single-mode fiber [SMF]) | SFP-10G-ZR | 6.0(2)A3(1) and later releases |
| 10GBASE-CU SFP+ cable 1.5 m (Twinax cable) | SFP-H10GB-CU1-5M | 6.0(2)A3(1) and later releases |
| 10GBASE-CU SFP+ cable 2 m (Twinax cable) | SFP-H10GB-CU2M | 6.0(2)A3(1) and later releases |
| 10GBASE-CU SFP+ cable 2.5 m (Twinax cable) | SFP-H10GB-CU2-5M | 6.0(2)A3(1) and later releases |
| Active optical cable 1 m | SFP-10G-AOC1M | 6.0(2)A3(1) and later releases |
| Active optical cable 3 m | SFP-10G-AOC3M | 6.0(2)A3(1) and later releases |
| Active optical cable 5 m | SFP-10G-AOC5M | 6.0(2)A3(1) and later releases |
| Active optical cable 7 m | SFP-10G-AOC7M | 6.0(2)A3(1) and later releases |
| 10GBASE-DWDM long-range transceiver module 80 km with single mode duplex fiber | DWDM-SFP10G-C | 6.0(2)A3(1) and later releases |
| 10GBASE-DWDM long-range transceiver module 80 km with single mode duplex fiber | DWDM-SFP10G | 6.0(2)A1(1) and later releases |
| 10GBASE-SR SFP+ module (multimode fiber [MMF]) | SFP-10G-SR | 5.0(3)A1(1) and later releases |
| 10GBASE-LR SFP+ module (single-mode fiber [SMF]) | SFP-10G-LR | 5.0(3)A1(1) and later releases |
| Cisco 10GBASE-ER SFP+ Module for SMF | SFP-10G-ER | 5.0(3)A1(1) and later releases |
| 10GBASE-SR SFP+ module (multimode fiber [MMF]) | SFP-10G-SR-S | 6.0(2)A8(2) and later releases |
| 10GBASE-LR SFP+ module (single-mode fiber [SMF]) | SFP-10G-LR-S | 6.0(2)A8(2) and later releases |
| Cisco 10GBASE-ER SFP+ Module for SMF | SFP-10G-ER-S | 6.0(2)A8(2) and later releases |
| 10GBASE-ZR SFP+ module (single-mode fiber [SMF]) | SFP-10G-ZR-S | 6.0(2)A8(2) and later releases |

| Hardware | Part Number | Supported Software Release |
|---|------------------|--------------------------------|
| 10GBASE-CU SFP+ cable 1 m (Twinax cable) | SFP-H10GB-CU1M | 5.0(3)A1(1) and later releases |
| 10GBASE-CU SFP+ cable 3 m (Twinax cable) | SFP-H10GB-CU3M | 5.0(3)A1(1) and later releases |
| 10GBASE-CU SFP+ cable 5 m (Twinax cable) | SFP-H10GB-CU5M | 5.0(3)A1(1) and later releases |
| Active Twinax cable assembly, 7 m | SFP-H10GB-ACU7M | 5.0(3)A1(1) and later releases |
| Active Twinax cable assembly, 10 m | SFP-H10GB-ACU10M | 5.0(3)A1(1) and later releases |
| 1-Gigabit Ethernet | | |
| 1000BASE-T SFP | GLC-TE | 6.0(2)A3(1) and later releases |
| Gigabit Ethernet SFP, LC connector EX transceiver (MMF) | GLC-EX-SMD | 6.0(2)A3(1) and later releases |
| Gigabit Ethernet SFP, LC connector ZX transceiver (MMF) | GLC-ZX-SMD | 6.0(2)A3(1) and later releases |
| 1000BASE-T SFP | GLC-T | 6.0(2)A1(1) and later releases |
| Gigabit Ethernet SFP, LC connector SX transceiver (MMF) | GLC-SX-MM | 5.0(3)A1(1) and later releases |
| Gigabit Ethernet SFP, LC connector SX transceiver (MMF) | GLC-SX-MMD | 5.0(3)A1(1) and later releases |
| Gigabit Ethernet SFP, LC connector LX/LH transceiver (SMF) | GLC-LH-SM | 5.0(3)A1(1) and later releases |
| Gigabit Ethernet SFP, LC connector LX/LH transceiver (SMF) | GLC-LH-SMD | 5.0(3)A1(1) and later releases |
| 100-Megabit Ethernet | | |
| 1000BASE-T SFP transceiver module with extended operating temperature range | SFP-GE-T | 6.0(2)A3(1) and later releases |
| 100BASE-FX SFP module for Gigabit Ethernet ports GLC-GE-100FX | GLC-GE-100FX | 6.0(2)A3(1) and later releases |

New and Changed Information

This section lists the new and changed features in Release 6.0(2)A8(4a).

- New Supported Hardware
- New Software Features

New Supported Hardware

Cisco NX-OS Release 6.0(2)A8(4a) does not include any new hardware.

New Software Features

Cisco NX-OS Release 6.0(2)A8(4a) includes the following new software features:

- USB Support at Loader Prompt:** Starting from Release 6.0(2)A8(4a), you can boot the switch from the USB using BIOS loader prompt. The supported BIOS version for N3K-C3548P-10GX is 2.0.8 and N3K-C3548P-10G is 1.0.11. The *show version* command from NX-OS CLI lists out the BIOS version in your switch.

Caveats

The open and resolved bugs for this release are accessible through the Cisco Bug Search Tool. This web-based tool provides you with access to the Cisco bug tracking system, which maintains information about bugs and vulnerabilities in this product and other Cisco hardware and software products.

Note: You must have a Cisco.com account to log in and access the [Cisco Bug Search Tool](#). If you do not have one, you can [register for an account](#).

For more information about the Cisco Bug Search Tool, see the Bug Search Tool Help & FAQ.

This section includes the following topics:

- Resolved Bugs for this Release
- Open Bugs for this Release

Resolved Bugs for this Release

Table 3 lists descriptions of resolved bugs in Cisco NX-OS Release 6.0(2)A8(4a). You can use the record ID to search [Cisco Bug Search Tool](#) for details about the bug.

Table 3 Cisco NX-OS Release 6.0(2)A8(4a) – Resolved Bugs

| Record Number | Description |
|----------------------------|---|
| CSCuz92666 | Cisco Nexus 3000 Series switches includes a version of NTPD that is affected by the vulnerabilities identified by the Common Vulnerability and Exposures (CVE) IDs: CVE-2016-4957, CVE-2016-4953, CVE-2016-4954, CVE-2016-4955, CVE-2016-4956 |
| CSCva79873 | When you connect a Brocade switch to Cisco Nexus 3548 switch, the link flaps and interface goes into error disabled state. |
| CSCvb59217 | Cisco Nexus 3548 switch refreshes the S,G entry when receives a *,G prune from downstream device. |
| CSCvb89282 | Cisco Nexus 3500 switch running 602A8(2) version shows incorrect out of range latency in 'show hardware profile latency monitor summary interface' output. |
| CSCvb94339 | Cisco Nexus 3500 switch reports the LPM table as full and the hardware is failing to program. However, the <i>show hardware profile status</i> output does not show enough entries to fill the LPM table. |
| CSCvb94380 | Cisco Nexus 3500 switch adding platform information to multicast TS. |
| CSCvc35633 | Multiple (S,G) entries programmed at 10 second interval with many-to-one-enhance enabled. |

| Record Number | Description |
|----------------------------|--|
| CSCvc48330 | <i>sh interface ethx/y trceiver det</i> command displays the DOM details of only the first port in the port group for the N3K ports bundled in 40G. |
| CSCvc53438 | Shared tree takes up to 60 seconds to be pruned after 2nd receiver joins. |
| CSCvc55268 | ARP reply from VIP not forwarded to end host intermittently when in VPC. |
| CSCvc55294 | Cisco Nexus 3548 switch clearing up all ARP entries in a respective VLAN when attempting to clear a single entry. |
| CSCvc59409 | Storm control capability for 1G is not working as expected on a Cisco Nexus 3548 switch. |
| CSCvc65287 | LLDP packets are dropped by controller when break-in command is used on a Cisco Nexus 3548 switch. |
| CSCvc71287 | When issuing different show commands with xml or json option, the parser throws an error or returns invalid values. |
| CSCvc94609 | Address the vulnerabilities as per the OpenSSL Software Foundation advisory identified by CVE(s): CVE-2017-3731 CVE-2017-3730 CVE-2017-3732. |
| CSCvc99747 | Cisco Nexus 3548 switch does not update L2/WARP cache after an interface failure. |
| CSCvd09099 | A Cisco Nexus 3548 switch running version 602A8(3) in WARP mode configured with dynamic NAT with overload or non-overload option does not translate return out->in traffic from from global inside to local inside once NAT hardware entry is installed. |
| CSCvd47646 | show ptp corrections json reports incorrect negative 'correction-val' values |
| CSCvd61529 | Cisco Nexus 3548 switch NAT TS does not include correct VRF specific output. |
| CSCvd64087 | The <i>show ip nat tra vrf default</i> command on a Cisco Nexus 3548 switch does not display static translations. |
| CSCve01370 | Cisco Nexus 3500 Series switch may reload due to the race condition caused by the ISR and the General Purpose Event (GPE) routines. This occurs when PTP is enabled. |
| CSCuw08964 | Address the vulnerabilities as per the OpenSSL Software Foundation advisory identified by CVE(s): CVE-2015-6565, CVE-2015-6564, CVE-2015-6563, CVE-2015-5600. |

Open Bugs for this Release

Table 3 lists descriptions of open bugs in Cisco NX-OS Release 6.0(2)A8(4a). You can use the record ID to search [Cisco Bug Search Tool](#) for details about the bug.

Table 4 Cisco NX-OS Release 6.0(2)A8(4a) – Open Bugs

| Record Number | Description |
|----------------------------|---|
| CSCvc16248 | Openflow flows are not displayed in forward table. |
| CSCvd33413 | Cisco Nexus 3548 switches running 6.0(2)A8(3) code may not send follow-up messages to other nexus devices but respond with del_resp messages. |

Upgrade Path to Cisco NX-OS Release 6.x

Install All is the only option that supports upgrade and downgrade between releases. Upgrade from Releases 6.0(2)A1(1) or later to NX-OS Release 6.0(2)A8(4a) is supported.

If a custom CoPP policy is applied after upgrading to Cisco NX-OS Release 6.0(2)A1(1) or later, and if the Nexus 3548 switch is downgraded to Cisco NX-OS Release 5.0, where changes to the CoPP policy are not permitted, the custom CoPP policy is retained and cannot be modified.

Note: `copy r s` and `reload` is not a supported method for an upgrade.

Limitations

The following are the known limitations for Cisco NX-OS Release 6.0(2)A8(4a):

- PBR and NAT cannot be supported on the same interface.
- `set ip default next hop` cannot be applied in PBR.
- IGMP packets, which are filtered by report policies on the local switch on which IGMP filtering is enabled, will still get forwarded to the peer switch (See [CSCup50141](#)).
- Counters for the warp SPAN destination port do not work. To check these counters, connect another switch to the destination ports (See [CSCuq66372](#)).
- In a vPC setup, because of a hardware limitation, non-RPF traffic for (S,G) that comes in on the RPF interface for (*,G) hits the (*,G) entry instead of being treated as (S,G) non-RPF traffic and dropped. (S,G) non-RPF traffic is then incorrectly forwarded by (*,G) entry, thus causing traffic duplication. To avoid duplication of Layer 3 multicast traffic by sending the (S,G) RP-bit prune, run the `ip pim pre-build-spt` command (See [CSCun34760](#)).
- While performing Online Insertion Removal (OIR) on the cable or optics of a 40G bundle, you must perform the following sequence of steps for the OIR to be successful (See [CSCuq93225](#)):
 - 1 Disable (shut) the 40G port
 - 2 Change the speed from 40G to 10G
 - 3 Perform an OIR on the cable or optics
 - 4 Change the speed from 10G to 40G
 - 5 Re-enable (no shut) the port
- SSH/SCP sessions with Cisco Nexus 3500 series switches running 6.0(2)A8(x) release may fail with a "no matching cipher found" message. This failure is due to the weaker CBC ciphers getting deprecated for security reasons (See [CSCun41202](#)).

Best Practices

The syntax of the `poap_script.py` file should be validated using the python validation tool before using the file for POAP. Otherwise, if the `poap_script.py` file is edited with a syntax error, the POAP process will exit without giving an error.

MIB Support

The Cisco Management Information Base (MIB) list includes Cisco proprietary MIBs and many other Internet Engineering Task Force (IETF) standard MIBs. These standard MIBs are defined in Requests for Comments (RFCs). To find specific MIB information, you must examine the Cisco proprietary MIB structure and related IETF-standard MIBs supported by the Cisco Nexus 3000 Series switch. The MIB Support List is available at the following FTP sites:

<ftp://ftp.cisco.com/pub/mibs/supportlists/nexus3000/Nexus3000MIBSupportList.html>

Related Documentation

Documentation for the Cisco Nexus 3000 Series Switch is available at the following URL:

http://www.cisco.com/en/US/products/ps11541/tsd_products_support_series_home.html

Documentation Feedback

To provide technical feedback on this document, or to report an error or omission, please send your comments to nexus3k-docfeedback@cisco.com. We appreciate your feedback.

Obtaining Documentation and Submitting a Service Request

For information on obtaining documentation, submitting a service request, and gathering additional information, see the monthly What's New in Cisco Product Documentation, which also lists all new and revised Cisco technical documentation, at:

<http://www.cisco.com/en/US/docs/general/whatsnew/whatsnew.html>

Subscribe to the *What's New in Cisco Product Documentation* as a Really Simple Syndication (RSS) feed and set content to be delivered directly to your desktop using a reader application. The RSS feeds are a free service and Cisco currently supports RSS version 2.0.

Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL: www.cisco.com/go/trademarks. Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1110R)

© 2017 Cisco Systems, Inc. All rights reserved.