

NCS5500 SATA FPD no actualiza con la mejora auto FPD

Contenido

[Introducción](#)

[NCS5500 SATA FPD no actualiza con la mejora auto FPD](#)

Introducción

Este documento describe los problemas que ocurren cuando el dispositivo programable del campo de Serial ATA del sistema 5500 de la convergencia de la red (NCS5500) (SATA) (FPD) no actualiza con la mejora auto FPD. Cuando usted actualiza a las versiones 6.3.3/6.5.1/7.0.1 o más alto de una versión anterior y utiliza la característica auto de la mejora, algunas unidades para algunos indicadores luminosos LED amarillo de la placa muestra gravedad menor no pudieron ser actualizadas.

Empieza con el versiones ya mencionadas. La capacidad de la mejora de SATA FPD fue agregada junto con una versión del nuevo firmware para algunos tipos de SATA (micrón). En el caso de estas versiones la nueva versión es 5.00 mientras que 3.00 eran la vieja versión FPD.

NCS5500 SATA FPD no actualiza con la mejora auto FPD

Aquí están los pasos para reproducir el problema y cómo actualizar SATA. Observe que no hay necesidad de recargar el indicador luminoso LED amarillo de la placa muestra gravedad menor después de que usted actualice su FPD.

```
sysadmin-vm:0_RP0(config)# fpd auto-upgrade enable
sysadmin-vm:0_RP0(config)# commit
Wed Sep 12 15:57:26.892 UTC
Commit complete.
sysadmin-vm:0_RP0(config)# exit
Wed Sep 12 15:57:28.187 UTC
sysadmin-vm:0_RP0# exit
Wed Sep 12 15:57:30.101 UTC
RP/0/RP0/CPU0:router#conf t
Wed Sep 12 10:57:32.154 CDT
RP/0/RP0/CPU0:router(config)#fpd auto-upgrade enable
RP/0/RP0/CPU0:router(config)#commit
```

el <after instala activa y reload>

```
RP/0/RP0/CPU0:router#show hw-module fpd
Wed Sep 12 11:51:32.195 CDT
```

					FPD Versions	
					=====	
Location	Card type	HWver	FPD device	ATR Status	Running	Programd

0/0	NC55-36X100G-S	1.2	MIFPGA	CURRENT	0.07	0.07
0/0	NC55-36X100G-S	1.2	Bootloader	CURRENT	1.13	1.13
0/0	NC55-36X100G-S	1.2	IOFPGA	CURRENT	0.11	0.11
0/0	NC55-36X100G-S	1.2	SATA	NEED UPGD	3.00	3.00
0/RP0	NC55-RP	1.1	Bootloader	CURRENT	9.25	9.25
0/RP0	NC55-RP	1.1	IOFPGA	CURRENT	0.09	0.09
0/RP1	NC55-RP	1.1	Bootloader	CURRENT	9.25	9.25
0/RP1	NC55-RP	1.1	IOFPGA	CURRENT	0.09	0.09
0/FC0	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC0	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC1	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC1	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC2	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC2	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC3	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC3	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC5	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC5	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/SC0	NC55-SC	2.0	Bootloader	CURRENT	1.74	1.74
0/SC0	NC55-SC	2.0	IOFPGA	CURRENT	0.10	0.10
0/SC1	NC55-SC	2.0	Bootloader	CURRENT	1.74	1.74
0/SC1	NC55-SC	2.0	IOFPGA	CURRENT	0.10	0.10

RP/0/RP0/CPU0:router# admin
Wed Sep 12 11:51:54.259 CDT

admin connected from 127.0.0.1 using console on router

sysadmin-vm:0_RP1# upgrade hw-module location 0/0 fpd ?

Possible completions:

Bootloader IOFPGA SATA all

sysadmin-vm:0_RP1# upgrade hw-module location 0/0 fpd all

Wed Sep 12 16:52:07.859 UTC

sysadmin-vm:0_RP1# 0/RP1/ADMIN0:Sep 12 11:52:10.861 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT : Upgrade for the following FPDs has been committed:

0/RP1/ADMIN0:Sep 12 11:52:10.861 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :

Location	FPD name	Force
0/RP1/ADMIN0:Sep 12 11:52:10.861 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :		
=====		
0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :		
0/0	SATA	FALSE
0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :		
0/0	IOFPGA	FALSE
0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :		
0/0	Bootloader	FALSE

0/RP1/ADMIN0:Sep 12 11:52:10.861 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :

=====

0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :

0/0 SATA FALSE

0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :

0/0 IOFPGA FALSE

0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpd-serv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :

0/0 Bootloader FALSE

0/0/ADMIN0:Sep 12 11:52:16.876 CDT: sata_fpd[3179]: %INFRA-FPD_Driver-1-UPGRADE_ALERT : FPD SATA@0/0 image programming completed with UPGRADE DONE state Info: [SATA FPD upgrade Complete]

RP/0/RP0/CPU0:Sep 12 11:52:16.871 CDT: fpd-serv[427]: %PKT_INFRA-FM-3-FAULT_MAJOR : ALARM_MAJOR : FPD-NEED-UPGRADE : CLEAR : 0/0:

sysadmin-vm:0_RP1#

sysadmin-vm:0_RP1#

sysadmin-vm:0_RP1#

sysadmin-vm:0_RP1# exit

Wed Sep 12 16:52:27.767 UTC

RP/0/RP0/CPU0:router#show hw-module fpd

Wed Sep 12 11:52:33.810 CDT

					FPD Versions	
					=====	
Location	Card type	HWver	FPD device	ATR Status	Running	Programd

0/0	NC55-36X100G-S	1.2	MIFPGA	CURRENT	0.07	0.07
0/0	NC55-36X100G-S	1.2	Bootloader	CURRENT	1.13	1.13
0/0	NC55-36X100G-S	1.2	IOFPGA	CURRENT	0.11	0.11
0/0	NC55-36X100G-S	1.2	SATA	CURRENT	5.00	5.00
0/RP0	NC55-RP	1.1	Bootloader	CURRENT	9.25	9.25
0/RP0	NC55-RP	1.1	IOFPGA	CURRENT	0.09	0.09
0/RP1	NC55-RP	1.1	Bootloader	CURRENT	9.25	9.25
0/RP1	NC55-RP	1.1	IOFPGA	CURRENT	0.09	0.09
0/FC0	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC0	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC1	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC1	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC2	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC2	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC3	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC3	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC5	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC5	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/SC0	NC55-SC	2.0	Bootloader	CURRENT	1.74	1.74
0/SC0	NC55-SC	2.0	IOFPGA	CURRENT	0.10	0.10
0/SC1	NC55-SC	2.0	Bootloader	CURRENT	1.74	1.74
0/SC1	NC55-SC	2.0	IOFPGA	CURRENT	0.10	0.10