更改SX80、MX700或MX800端點的產品ID

目錄

箇介
必要條件
需求
採用元件
CE9.1及更高版本:
設定
Web介面選項金鑰安裝示例
CLI選項金鑰安裝示例
驗證
疑難排解
CE9.2.X及更高版本 — 免許可證流程
SX80、MX800/700可能的平台ID:
設定
驗證
疑難排解

簡介

本文檔介紹更改或轉換SX80、MX700和MX800端點產品ID的兩個選項。

必要條件

需求

思科建議您瞭解以下主題:

基於TC和CE軟體的終端

已成功安裝SX80、MX700或MX800終結點,並應用了可通過Web介面和/或命令列介面(CLI)訪問的 有效IP地址。

已申請並已收到包含對裝置序列號有效的任何選項或發行金鑰的許可電子郵件。

通過網路介面或命令列介面(CLI)使用管理員帳戶訪問SX80、MX700或MX800端點。

採用元件

本檔案中的資訊是根據以下軟體版本:

CE軟體9.1.X及更低版本

CE軟體8.2.1版本。

TC軟體7.X版本。

SX80端點。

終端軟體

— 或者,您可以使用任何支援安全外殼(SSH)的終端模擬軟體,例如PuTTy、Secure CRT、 TeraTerm等。

具有選項金鑰的許可電子郵件。

Web瀏覽器,如Firefox、Internet Explorer或Chrome。

本文中的資訊是根據特定實驗室環境內的裝置所建立。文中使用到的所有裝置皆從已清除(預設))的組態來啟動。如果您的網路正在作用,請確保您已瞭解任何指令可能造成的影響。

CE9.1及更高版本:

可用於SX80和MX800/700端點的產品ID許可證:

SX80 = SX80許可證 MX700 =許可證 — MX700-D-S MX700揚聲器音軌= MX700-D-D許可證 MX800 =許可證 — MX800-S-S MX800揚聲器音軌= MX800-S-D許可證 MX800D雙螢幕= MX800-D-D許可證

> **附註**:SX80和MX700/800裝置使用相同的物理硬體編解碼器。要更改產品**ID,您**需要應用指 定終**點類**型的選項鍵。

設定

此Web介面示例影片對本文檔進行了補充。

Web介面選項金鑰安裝示例

步驟1。檢視您的許可電子郵件,其中包含您**的正確產**品ID的選**項金鑰。**在本指南中,SX80轉換為 MX800。MX700或MX800轉換為SX80的步驟相同:

電子郵件範例

*** IMPORTANT - DO NOT DISCARD THIS E-MAIL ***

You have received this email because your email address was provided to Cisco Systems during the Serial Number Lookup process for software license activation key/file. Please read this email carefully and forward it with any attachments to the proper system administrator if you are not the correct person.

System Serial Number Hardware Serial Number MAC Address Service Contract SC End Date Software Part Name	: FCZ : FTT : E4C722661F00 : : : : LIC-TB-S52020:
Tandberg Item No Shipped Version Shipped Version Key Shipped Image URL	: : : TC7.1.4 : -
Options Cisco Option Name Tandberg Option Name Option Key	:LIC-MX800-S-D: :: :1P005-1-
Options Cisco Option Name Tandberg Option Name Option Key	:LIC-TC-CRYPTO-K9: :: :1C000-1-

步驟2.使用管理員帳戶登入到Web介面,導航到 維護>選項鍵。

Cisco TelePresence SX80								
A Home	Second Control	🖋 Setup	Security	Maintenance	🔥 Inte	gration		🛔 admin
System Information			Diagnostics System Logs Call Logs		ssues with	n your system. See Dia	gnostics for more info.	
General			User Interface Screenshots					
Product: Last boot: Serial number Software vers	Ci las : FT ion: ce	sco TelePresenc st Thursday at 22 FT 9 8.2.1 Final e9da	e SX80 2:43 af06 2016-06-28	Software Upgrade Option Keys Backup and Restore	9		Inactive - -	
Installed optio	ns: Er Mu Re	ncryption ultiSite emoteMonitoring		System Recovery Restart				
System name IPv4: IPv6:				Status Proxy			Registered	
MAC address Temperature:	E4	4:C7:22:6A:84:B 6.9°C / 152.4°F	0	UKI				

cisco							Cisco TelePresence SX80
📽 Home	💪 Call Cor	ntrol 🎤 Setup	Security	Maintenance	integration		🛔 admir
Option K	eys						
Туре	[Description				Key	Status
Encryption	ryption Enables encryption of media streams. 1C000 Active				Active		
MultiSite	tiSite Enables hosting of meetings with up to four participants 1M003- Active					Active	
RemoteMon	emoteMonitoring Enables snapshots of local and remote video sources in the web interface 1S000- Active					Active	
Add option	key						
:	Serial number						
Option key 1P005-							
		Add option ke	У				

附註:MX800 ST產品ID以代碼1P005開頭。每種編解碼器型別都有其自己的產品ID:LIC-SX80 = 1P001 / LIC-MX700-D-S = 1P002 / LIC-MX700-D-D = 1P003 / LIC-MX800-S-S = 1P004 / LIC-MX800-S-D = 1P005 / LIC-MX800-D D = 1P006。

CLI選項金鑰安裝示例

步驟1.運行終端軟體SSH會話並使用管理員帳戶登入。

步驟2.運行命令: xCommand SystemUnit OptionKey Add Key: [option key]

步驟3.運行命令: xCommand SystemUnit Boot:

附註:通常,輸入選項鍵的**值不需**要重新啟動。輸入產品ID選項鍵**的值時**需要**RESTART**才能 使更改生效。

	😭 luisga — -bash — 124×45
Last login: Sun Apr 23 09:47:22 on ttys000 LUISGA-M-C1VB:~ luisga\$ ssh admin@ Password: Welcome to	
Cisco Codec Release ce 8.2.1 Final e9daf06 2016-06-28 SW Release Date: 2016-06-28 I *r Login successful	
ОК	
xCommand SystemUnit OptionKey Add Key: 1P005-	\leftarrow
OK *r OptionKeyAddResult (status=OK): ** end	
xcommand SystemUnit Boot	
OK *r SystemUnitBootResult (status=OK): ** end CUIL reboot request, restarting tshell: Remote closed connection Connection to closed. LUISGA-M-C1VB:~ luisga\$	

驗證

檢查終端Web介面**首頁**右上角的標語。確保產品型別已更改,並且現在指示正確的裝置型別,在本 指南中為MX800。檢查**產品:Home > System Information > General > Product**下的欄位值:欄位 .確保產**品:**欄位值已更改,指示正確的裝置型別,在本指南中為MX800:

Cisco TelePresence MX800 SpeakerTrack					
👫 Home 💪 Call Cor	ntrol 🖌 Setup 🔒 Security	Maintenance	+ Integration	🚢 admin	
System Information	on			*	
General		H323			
Product: Last boot: Serial number:	Cisco TelePresence MX800 Spea today at 23:38	kerTrack Gatekee	per	Inactive -	
Software version: Installed options:	ce 8.2.1 Final e9daf06 2016-06-2 Encryption	8 ID			
	MultiSite RemoteMonitoring	SIP Pro	oxy 1		
System name: IPv4:		Status		Failed: 485 Ambiguous / Device type mismatch	
IPv6: MAC address: Temperature:	- E4:C7:22:6A:84:B0 67.5°C / 153.5°F	Proxy URI			

疑難排解

產品ID金鑰不會顯示在「選項金鑰」頁中,這是預期行為。

應用系統中已存在的Product ID金鑰,您會遇到錯誤:

Web介面:"新增選項鍵失敗:未指定的錯誤」

CLI SSH:"格式無效,產品錯誤或已安裝。"

附註:新增Product ID 選項鍵後,請始終重新啟動編解碼器。

檢查金鑰中的前5位代碼是否與所需的裝置型別匹配:

LIC-SX80 = 1P001 LIC-MX700-D-S = 1P002 LIC-MX700-D-D = 1P003 LIC-MX800-S-S = 1P004 LIC-MX800-S-D = 1P005 LIC-MX800-D-D = 1P006

如果沒有,您可以請求具有正確代碼的產品ID選項金鑰。

如果在確認本指南和 疑難排解 部分,請聯絡Cisco TAC。

CE9.2.X及更高版本 — 免許可證流程

根據CE軟體9.2.x及更高版本,會新增一個CLI命令,以進行無許可證產品ID更改。

https://www.cisco.com/c/dam/en/us/td/docs/telepresence/endpoint/ce97/collaboration-endpointsoftware-api-reference-guide-ce97.pdf

SX80、MX800/700可能的平台ID:

MX700/MX700ST/MX800/MX800ST/MX800D [SX80/MX700/MX800/MX800D]

設定

逐步影片

組態範例:

首先開啟與裝置的終端會話,然後運行命令「*xCommand SystemUnit ProductPlatform Set Platform:平台*」,其中「平台」是正確的產品ID。

客戶錯誤地擁有MX800ST產品型別

Status		- +
SystemUnit		
		-
Productid	Cisco TelePresence MXB00 SpeakerTrack	
ProductPlatform	MX800ST	
ProductType	Cisco Codec	
Uptime	87125	

我們需要的是MX700,因此我們使用「MX700」作為型別應用命令。

xcommand SystemUnit ProductPlatform Set Platform:MX700



附註:新增Platform命令後,請始終重新啟動編解碼器

您可以在Setup > Status > SystemUnit中轉到裝置的Web介面。確保該值是您配置的產品ID。

Status	
SystemUnit	
Productid	Cisco TelePresence MX700
ProductPlatform	MX700
ProductType	Cisco Codec
Uptime	67

疑難排解

並非每個SX80都可以更改其產品ID,有兩種型別,獨立SX80(CTS-SX80CODEC)和基於MX的SX80(CTS-MXCODEC)。

Hardware		11329	Hardware	
MainBoard SerialNumber		H323	MainBoard SerialNumber	
MonitoringSoftware	64	HttpFeedback	MonitoringSoftware	64
Temperature	52.0	ICE	Temperature	75.9
TemperatureThreshold	90	Logging	TemperatureThreshold	90
LIDI	DISMUROPER V01	Network	LIDI	CTS-SY80CODEC V01
0Di			001	013-3/0000020 001

如果在獨立SX80上設定platform命令,將顯示「不正確的硬體平台」錯誤。

PuTTY ··· PuTTY	PuTTY
	xstatus //product
xstatus //product	*s SystemUnit ProductId: "Cisco TelePresence SX80"
*s SystemUnit ProductId: "Cisco TelePresence SX80"	*s SystemUnit ProductPlatform: "SX80"
*s SystemUnit ProductPlatform: "SX80"	*s SystemUnit ProductType: "Cisco Codec"
*s SystemUnit ProductType: "Cisco Codec"	** end
** end	
	OK
OK	xCommand SystemUnit ProductPlatform Set Platform: MX800ST
xCommand SystemUnit ProductPlatform Set Platform: MX800ST	
	OK
OK	*r ProductPlatformSetResult (status=Error):
*r ProductPlatformSetResult (status=OK):	*r ProductPlatformSetResult Reason: "Incorrect hardware platform"
** end	** end