

Cisco IOS XE Denali 16.3 Migration Guide for Access and Edge Routers

First Published: 2016-08-03 **Last Modified:** 2018-05-24

Cisco IOS XE Denali 16.3 Migration Guide for Access and Edge Routers



Note

This migration guide contains key information and steps that will help ensure a successful migration from the current Cisco IOS XE 3S and Cisco IOS XE 16.2 releases to the Cisco IOS XE 16.3 release. It is critical that you read this information before you begin migration to ensure that you have completed all the prerequisites and that you understand the migration process.

Developed for wide deployment in the world's most demanding enterprise, access, and service provider networks, the Cisco IOS software delivers seamless integration of technology innovation with business applications.

Cisco IOS XE 16 (evolved from Cisco IOS XE) introduces Cisco's next generation of Network Operating System that tightly integrates a broad range of routing and switching portfolio hardware. With features integrated with the earlier releases for each of the platforms, Cisco IOS XE 16 helps you prepare your network to take advantage of new technologies such as, Software Defined Network (SDN) and Network Function Virtualization (NFV), coupled with service integration for hosted applications. This cross-platform integrated model reduces total cost of ownership, helping the organization qualify, deploy, and maintain a single cross-product software.

This document covers migration steps to Cisco IOS XE Denali 16.3 for the following routing platforms:

- Cisco ASR1000
- · Cisco CSR1000v
- Cisco 4000 Series ISR


This document does not describe all the features available for Cisco IOS XE Denali 16.3. For the latest feature list, please see the Release Notes for Cisco ASR 1000 Series, Cisco IOS XE Denali 16.3 at http://www.cisco.com/c/en/us/td/docs/routers/asr1000/release/notes/xe-16/asr1000-rel-notes-xe-16-3.html.

Cisco IOS XE 16 supports the Enterprise Networking products through the following releases:

- 1. Cisco IOS XE Denali 16.1 software release addresses the Catalyst switch products.
- 2. Cisco IOS XE Denali 16.2 software release addresses the access and edge routing products.
- 3. Cisco IOS XE Denali 16.3 is the first extended maintenance release for Cisco IOS XE 16.x.

The following workflow is a guide for customers migrating to Cisco IOS XE Denali 16.3:

Figure 1: Cisco IOS XE Denali 16.3 Workflow

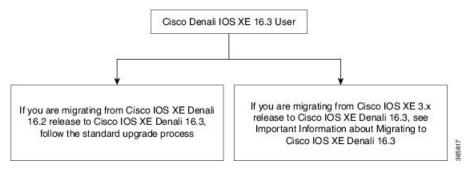

The link to the information mentioned in the image are as follows:

- Standard Upgrade Process
- Important Information about Migrating to Cisco IOS XE Denali 16.3

Feature Parity between Cisco IOS XE 3.17S and Cisco IOS XE Denali 16.3

Cisco IOS XE Denali 16.3 has feature parity with Cisco IOS XE 3.17 release except for the following features:

Unsupported Features	Links and Information
Port Authentication Using 802.1x for MACSec	hp/www.iscoomenUS/beiosentlosic_ur_802b/configurion152m/configure802sqbahtml
Per-Port 802.1x; Multi-Host, Single Host and Port-Based	hp/www.iso.com/nl. Scheibenniloske_ur_8/21x/configurion/152m/configures/22-qbahtml
802.1u (Guest VLAN)	hplwwikaamini. Scheisentloke ur 80bkanig ein 152mkanig ee 80bkbh 1
Multi-Domain Authentication (802.1x)	htp/www.iscnament.Schooloom/losee_ur_8021xtcmfg.urim/152mtsciee802xffhml

Important Information about Migrating to Cisco IOS XE Denali 16.3

This section provides key information that you must keep in mind before migrating to Cisco IOS XE Denali 16.3.

- No additional changes are required for Cisco IOS XE configuration.
- Show commands and debug commands are the same as in the Cisco IOS XE 16.2 release.

Quick Reference for a Successful Migration

This section provides you a quick summary of the actions that you must take for each platform depending on your current ROMMON and IOS image to ensure a successful migration process for:

- Cisco IOS XE 3.x to Cisco XE IOS Denali 16.3
- Cisco IOS XE Denali 16.2 to Cisco IOS XE Denali 16.3

• Cisco IOS XE 3.x to Cisco IOS Denali 16.2 (You can also see Migration Guide for Denali 16.2 for instructions—Upgrading the Cisco ASR 1000 Modular Platforms from Cisco IOS XE 3.x to Cisco IOS XE Denali 16.2)

Platforms	Cisco IOS XE 3.x to16.3		Cisco Denali 16.2 to 16.3		Cisco IOS XE 3.x to 16.2	
	ROMMON	IOS Image	ROMMON	IOS Image	ROMMON	IOS Image
ASR1001-HX (new platform introduced in Cisco IOS Denali 16.3.1)	New platform in 16.3.1	New platform in 16.3.1	New platform in 16.3.1	New platform in 16.3.1	Not supported	Not supported
ASR1002-HX	ASR1002-HX, introduced in Cisco IOS XE Denali 16.2, is not supported in IOS XE 3.x.	ASR1002-HX, introduced in Cisco IOS XE Denali 16.2, is not supported in IOS XE 3.x.	No action required	Image changed from asr1002hx -universalk9 to asr1000- universalk9	ASR1002-HX, introduced in Cisco IOS XE Denali 16.2, is not supported in IOS XE 3.x.	ASR1002-HX, introduced in Cisco IOS XE Denali 16.2, is not supported in IOS XE 3.x.
ASR1001-X ASR1002-X	Migrate to 16.2(1r) or 15.5(3r)S1	Follow the standard Cisco IOS upgrade	No action required	Follow the standard Cisco IOS upgrade	Mandatory ROMMON upgrade required	Follow the standard Cisco IOS upgrade
ASR1006 ASR1006-X ASR1009-X ASR1013 With RP2	No action required	Follow RP2 Upgrade process	No action required	Follow the standard Cisco IOS upgrade	Mandatory ROMMON upgrade required	See: Cisco IOS XE Denali 16.2 Migration Guide for Access and Edge Routers
ASR1006-X ASR1009-X ASR1013 With RP3	New route processor introduced in 16.3.1	New route processor introduced in 16.3.1	New route processor introduced in 16.3.1	New route processor introduced in 16.3.1	Not supported	Not supported
CSR1000v	Follow CSR upgrade process	Follow CSR upgrade process	Not supported in Cisco IOS XE Denali 16.2 release	Not supported in Cisco IOS XE Denali 16.2 release	Not supported in Cisco IOS XE Denali 16.2 release	Not supported in Cisco IOS XE Denali 16.2 release
Cisco 4400 Series ISR	No action required	Follow the standard Cisco IOS upgrade	No action required	Follow the standard Cisco IOS upgrade	ROMMON upgrade required	Follow the standard Cisco IOS upgrade

Platforms	Cisco IOS XE 3.x to16.3		Cisco Denali 16.2 to 16.3		Cisco IOS XE	Cisco IOS XE 3.x to 16.2	
	ROMMON	IOS Image	ROMMON	IOS Image	ROMMON	IOS Image	
Cisco 4300 Series ISR	No action required	Follow the standard Cisco IOS upgrade	ROMMON upgrade required	Follow the standard Cisco IOS upgrade	ROMMON upgrade required	Follow the standard Cisco IOS upgrade	

- For information on Cisco IOS upgrade process, see: Software upgrade process
- For information on ROMMON upgrade process, see: ROMMON upgrade
- For information on RP2 upgrade process, see Cisco ASR 1000 Series Routers ROMmon Upgrade Guide
- For information on CSR1000v Series upgrade process, see: CSR1000v upgrade
- For information on Cisco 4000 Series ROMMON upgrade process, see: Hardware Installation Guide for the Cisco 4000 Series Integrated Services Router

Cisco ASR 1000 Series Aggregation Services Routers

This section provides information about the changes that are introduced in Cisco IOS XE Denali 16.3. For details about upgrading the Cisco IOS XE software, see the Cisco ASR 1000 Series Aggregation Services Routers Software Configuration Guide.

Supported and Unsupported Cisco ASR 1000 Series Hardware

Hardware	Supported	Unsupported
Platforms	ASR1001-X	ASR1001
	ASR1001-HX	ASR1002
	ASR1002-X	
	ASR1002-HX	
	ASR1004	
	ASR1006	
	ASR1006-X	
	ASR1009-X	
	ASR1013	
Route Processors (RP)	ASR1000-RP2, ASR1000-RP3	ASR1000-RP1
Forwarding Processors (ESP)	ASR1000-ESP20	ASR1000-ESP5
	ASR1000-ESP40	ASR1000-ESP10
	ASR1000-ESP100	
	ASR1000-ESP200	

Supported NIMs

NIM	ASR1001-X	ASR1002-HX
T1/E1	Yes	No
SSD	Yes	No

Supported EPAs

EPA	ASR1002-HX	ASR1000-MIP100
EPA-1X100GE	No	Yes
EPA-10X10GE	Yes	Yes
EPA-18X1GE	Yes	Yes
EPA-CPAK-2X40GE	No	Yes

Supported Line Cards

	Supported	Unsupported
Linecards	ASR1000-SIP40	ASR1000-SIP10
	ASR1000-2T+20X1GE	
	ASR1000-6TGE	
	ASR1000-MIP100	

Supported Shared Port Adapters (SPA)

Shared SPA and ATM SPA	Serial and Channelized SPA	Ethernet SPA	Packet Over Sonet SPA (POS)	Circuit Emulation Ov Packet SPA (CEOP)
SPA-DSP	SPA-8XCHT1/E1-V2	SPA-4X1FE-TX-V2	SPA-2XOC3-POS	SPA-1CHOC3-CE-A
SPA-1XOC3-ATM-V2	SPA-4XCT3/DS0-V2	SPA-8X1FE-TX-V2	SPA-4XOC3-POS	SPA-24CHT1-CE-A
SPA-3XOC3-ATM-V2	SPA-2XCT3/DS0-V2	SPA-2X1GE-V2	SPA-2XOC3-POS-V2	SPA-2CHT3-CE-AT
SPA-1XOC12-ATM-V2	SPA-1CHSTM1/OC3V2	SPA-5X1GE-V2	SPA-4XOC3-POS-V2	
	SPA-2XT3/E3-V2	SPA-8X1GE-V2	SPA-8XOC3-POS	
	SPA-4XT3/E3-V2	SPA-10X1GE-V2	SPA-1XOC12-POS	
	SPA-8XT3/E3	SPA-1X10GE-L-V2	SPA-2XOC12-POS	
	SPA-4XT-Serial	SPA-1X10GE-WL-V2	SPA-4XOC12-POS	
	SPA-1XCHOC12/DS0		SPA-8XOC12-POS	

For a list of Cisco ASR 1000 hardware that will End-of-Sale and End-of-Life, see http://www.cisco.com/c/en/us/products/collateral/routers/asr-1000-series-aggregation-services-routers/eos-eol-notice-c51-734572.html.

Upgrading the ROMMON Version on the Cisco ASR 1001-X and ASR1002-X Series Routers

The Cisco ASR1001-X and ASR1002-X require a minimum ROMMON version 15.5(3r)S1 to load the Cisco IOS XE Denali 16.3 image. Later ROMMON versions, for example, 16.2(1r) are also supported.

However, there is no minimum ROMMON version required in order to upgrade to ROMMON 15.5(3r)S1 or 16.2(1r).

For ROMMON upgrade instructions, see the Cisco ASR 1000 Series Routers ROMMON Upgrade Guide.

Cisco IOS XE 3S Versions That Can be Used to Upgrade the ROMMON

The following Cisco IOS XE 3S versions can be used to upgrade the ROMMON to 15.5(3r)S1 or 16.2(1r):

- Cisco IOS XE 3.10S or previous Cisco IOS XE versions
- Cisco IOS XE 3.13.2S and later versions of Cisco IOS XE 3.13S
- Cisco IOS XE 3.14.1S and later versions of Cisco IOS XE 3.14S
- Cisco IOS XE 3.15S and later versions



Note

Do not use the following Cisco IOS XE 3S versions to upgrade the ROMMON to 15.5(3r)S1 or 16.2(1r):

- Cisco IOS XE 3.11.xS (all Cisco IOS XE 3.11S versions)
- Cisco IOS XE 3.12.xS (all Cisco IOS XE 3.12S versions)
- Cisco IOS XE 3.13.0S and Cisco IOS XE 3.13.1S
- Cisco IOS XE 3.14.0S

Cisco ASR 1000 Modular Platforms Require Universal Images and Licenses



Note

Route Processor 2 (RP2) and Route Processor 3 (RP3) share the same universal image.

Universal Images for the Cisco ASR 1000 Modular Platforms

Similar to Cisco ASR 1000 consolidated platforms (ASR 1001-X and ASR 1002-X), the Cisco ASR 1000 modular platforms (ASR 1004, ASR 1006, ASR 1006-X, ASR 1009-X, and ASR 1013) support the following Universal images:

- Cisco ASR 1000-RP IOS XE UNIVERSAL-NO PAYLOAD ENCRYPTION
- Cisco ASR 1000-RP IOS XE UNIVERSAL
- Cisco ASR 1000-RP IOS XE UNIVERSAL W/O Lawful Intercept
- · Cisco ASR 1000-RP IOS XE UNIVERSAL-NO PAYLOAD ENCRYPTION W/O Lawful Intercept

License Package Options for the Cisco ASR 1000 Modular Platforms

The Cisco ASR 1000 modular platforms (ASR 1004, ASR 1006, ASR 1006-X, ASR 1009-X, and ASR 1013) support the following license options:

- Cisco ASR 1000 IP Base License
- Cisco ASR 1000 Advanced IP Services License (AIS)
- Cisco ASR 1000 Advanced Enterprise Services License (AES)

Cisco ASR 1000 Modular Platforms Image Mapping from Cisco IOS XE 3.x to Cisco IOS XE Denali 16.3

The Cisco ASR 1000-RP2 is the route processor supported on the Cisco ASR 1000 modular platforms. The following table shows how the Cisco ASR 1000-RP2 image for modular platforms (ASR 1004, ASR 1006, ASR 1006-X, ASR 1009-X, and ASR 1013) maps from Cisco IOS XE 3.x to Cisco IOS XE Denali 16.3. To enable the required features on the Cisco ASR 1000 modular platforms, you must install the correct Universal image and the required license package.

Description in Cisco IOS XE 3.x	Product ID in Cisco IOS XE 3.x	Maps to	Product ID in Cisco IOS XE 16.3	Description in Cisco IOS XE 16.3	License in Cisco IOS XE 16.3
Cisco ASR 1000 Series RP2 ADVANCED IP SERVICES	SASR1R2- AISK9-316S		SASR1KRPUK9-163	Cisco ASR 1000 Series RPX86 UNIVERSAL	AIS
Cisco ASR 1000 Series RP2 ADVANCED IP SERVICES W/O LI	SASR1R2AI S9NLI316S		SASR1KR PUNLIK9-163	Cisco ASR 1000 Series RPX86 UNIVERSAL W/O LI	AIS
Cisco ASR 1000 Series RP2 ADV ENT SERVICES	SASR1R2- AESK9-316S		SASR1KR PUK9-163	Cisco ASR 1000 Series RPX86 UNIVERSAL	AES
Cisco ASR 1000 Series RP2 ADV ENT SERVICES W/O LI	SASR1R2AE S9NLI316S		SASR1KR PUNLIK9-163	Cisco ASR 1000 Series RPX86 UNIVERSAL W/O LI	AES
Cisco ASR 1000 Series RP2 IP BASE	SASR1R2- IPBK9-316S		SASR1KR PUK9-163	Cisco ASR 1000 Series RPX86 UNIVERSAL	None

Upgrading Cisco ASR 1000 Modular Platforms from Cisco IOS XE 3.x to Cisco IOS XE Denali 16.3

This section provides the basic steps to upgrade the Cisco ASR 1000 modular platforms with RP2 (ASR1004, ASR1006, ASR 1006-X, ASR1009-X, and ASR1013) from Cisco IOS XE 3.x to Cisco IOS XE Denali 16.3.

Before You Begin

- Download the Cisco IOS XE Denali 16.3 Universal image from cisco.com to the router.
- Please back up your existing configuration in the router flash.



Note

If your software version is Cisco IOS XE Denali 16.3.1 and later 16.3.x releases, it is recommended that you upgrade Cisco ASR 1000 modular platforms following the "*Upgrading the Cisco ASR 1000 Modular Platforms Based on Previous Image*" section.

Upgrading Cisco ASR 1000 Modular Platforms Based on Previous Image

It is strongly recommended that you allow the system to auto detect the boot system image based on the previously used image when upgrading to IOS XE 16.3 image. This will automatically enable the license for the based on the previous image. Follow these steps to to automatically select the license for you based on your previous image:

While upgrading Cisco ASR 1000 modular platforms to Cisco IOS XE Denali 16.3 and later 16.3.x releases, choose the **transport preferred none** option on vty or console.

Procedure

Step 1 Backup the running configuration.

Example:

```
Router# copy running-config bootflash:backup.cfg
Destination filename [backup.cfg]?
1834 bytes copied in 0.112 secs (16375 bytes/
```

Step 2 Install the IOS XE 16.3 Universal image, save the configuration, and reload the route processors.

```
Router# configure terminal
Enter configuration commands, one per line. End with CNTL/Z.
Router(config)# no boot system bootflash:asr1000rp2-adventerprisek9. xxxx_xxxx_xxxx.bin <--
Removes the previous boot statement
Router(config)# boot system bootflash:<16.3 RP2 universal image name.bin>
Router(config)# boot system bootflash:asr1000rp2-adventerprisek9. xxxx_xxxx_xxxx.bin <--add
previous image as 2nd boot up image
Router(config)# end

Verify the new 16.3 is the first boot image:
Router# show run | i boot
boot-start-marker
boot system bootflash:<16.3 RP2 universal image name.bin>
boot system bootflash:asr1000rp2-adventerprisek9. xxxx xxxx xxxx.bin
```

```
boot-end-marker
Router# copy running-config startup-config
Destination filename [startup-config]?
Building configuration...
[OK]
Router#
If you have a redundant route processor, copy new 16.3 to stby-bootflash as well
router# copy bootflash: <16.3 RP2 universal image name.bin> stby-bootflash:<16.3 RP2 universal
image name.bin>
Destination filename [<16.3 RP2 universal image name.bin>]?
802453866 bytes copied in 356.569 secs (2250487 bytes/sec)
Verify the 16.3 image in stby-bootflash:
Router# dir stby-bootflash:<16.3 RP2 universal image name.bin>
Directory of stby-bootflash: /<16.3 RP2 universal image name.bin>
             802453866 Jul 26 2016 22:27:29 +00:00 <16.3 RP2 universal image name.bin>
  14 -rw-
1948569600 bytes total (368607232 bytes free)
```

Reload the router.

Note If a Cisco IOS 16.x image has never been run on the router and license never been configured before, router will boot up based on your second image type and prompt you to accept the license. You must log in to the active RP console and the standby RP console to accept the license.

```
Router# reload <---- Reload the from active router and boot the IOS 16.3 Universal image
Proceed with reload? [confirm]
*Jul 26 23:34:13.017: %SYS-5-RELOAD: Reload requested by console. Reload Reason: Reload
Command.Jul 26 23:34:27.930 R0/0: %PMAN-5-EXITACTION: Process manager is exiting: process
exit with reload chassis code
Initializing Hardware ...
Calculating the ROMMON CRC ... CRC is correct
System Bootstrap, Version 12.2(20151215:013128) [xxxx-rommon release xxxx], DEVELOPMENT
SOFTWARE
Copyright (c) 1994-2015 by cisco Systems, Inc.
Compiled Mon 14-Dec-15 17:32 by xxxx-rommon release xxxx
Current image running: Boot ROM1
Last reset cause: LocalSoft
ASR1000-RP2 platform with 8388608 Kbytes of main memory
File size is 0x2fd4796a
Located :<16.3 RP2 universal image name.bin>
Image size 802453866 inode num 278537, bks cnt 195912 blk size 8*512
Boot image size = 802453866 (0x2fd4796a) bytes
```

```
Package header rev 1 structure detected
Calculating SHA-1 hash...done
validate package cs: SHA-1 hash:
        calculated fd8f5566:751f15e7:3ae75e9f:adf99aa8:7b987de7
        expected fd8f5566:751f15e7:3ae75e9f:adf99aa8:7b987de7
Validating main package signatures
RSA Signed DEVELOPMENT Image Signature Verification Successful.
Image validated
%IOSXEBOOT-4-BOOT SRC: (rp/0): HD Boot
              Restricted Rights Legend
Use, duplication, or disclosure by the Government is
subject to restrictions as set forth in subparagraph
(c) of the Commercial Computer Software - Restricted
Rights clause at FAR sec. 52.227-19 and subparagraph
(c) (1) (ii) of the Rights in Technical Data and Computer
Software clause at DFARS sec. 252.227-7013.
           cisco Systems, Inc.
           170 West Tasman Drive
           San Jose, California 95134-1706
Cisco IOS Software [Denali], ASR1000 Software (X86 64 LINUX IOSD-UNIVERSALK9-M), Experimental
Version 16.3.20160717:092907 [v163 throttle-BLD-BLD V163 THROTTLE LATEST 20160717 090647
1181
Copyright (c) 1986-2016 by Cisco Systems, Inc.
Compiled Sun 17-Jul-16 03:35 by mcpre
Cisco IOS-XE software, Copyright (c) 2005-2016 by cisco Systems, Inc.
All rights reserved. Certain components of Cisco IOS-XE software are
licensed under the GNU General Public License ("GPL") Version 2.0. The
software code licensed under GPL Version 2.0 is free software that comes
with ABSOLUTELY NO WARRANTY. You can redistribute and/or modify such
GPL code under the terms of GPL Version 2.0. For more details, see the
documentation or "License Notice" file accompanying the IOS-XE software,
or the applicable URL provided on the flyer accompanying the IOS-XE
This product contains cryptographic features and is subject to United
States and local country laws governing import, export, transfer and
use. Delivery of Cisco cryptographic products does not imply
third-party authority to import, export, distribute or use encryption.
Importers, exporters, distributors and users are responsible for
compliance with U.S. and local country laws. By using this product you
agree to comply with applicable laws and regulations. If you are unable
to comply with U.S. and local laws, return this product immediately.
A summary of U.S. laws governing Cisco cryptographic products may be found at:
http://www.cisco.com/wwl/export/crypto/tool/stqrg.html
If you require further assistance please contact us by sending email to
export@cisco.com.
cisco ASR1004 (RP2) processor (revision RP2) with 4140504K/6147K bytes of memory.
Processor board ID FXS172504PL
8 Gigabit Ethernet interfaces
32768K bytes of non-volatile configuration memory.
8388608K bytes of physical memory.
1884159K bytes of eUSB flash at bootflash:.
```

78085207K bytes of SATA hard disk at harddisk:.

OK bytes of at webui:.

YOU HAVE CHOSEN TO BOOT WITH adventerprise GLOBAL EULA* FOLLOWS NEXT <----selected license type

*http://www.cisco.com/c/en/us/td/docs/routers/asr1000/configuration/guide/chassis/asrswcfg/csa rtu.html#pgfId-1059908

PLEASE READ THE FOLLOWING TERMS CAREFULLY. INSTALLING THE LICENSE OR LICENSE KEY PROVIDED FOR ANY CISCO PRODUCT FEATURE OR USING SUCH PRODUCT FEATURE CONSTITUTES YOUR FULL ACCEPTANCE OF THE FOLLOWING TERMS. YOU MUST NOT PROCEED FURTHER IF YOU ARE NOT WILLING TO BE BOUND BY ALL THE TERMS SET FORTH HEREIN.

Use of this product feature requires an additional license from Cisco, together with an additional payment. You may use this product feature on an evaluation basis, without payment to Cisco, for 60 days. Your use of the product, including during the 60 day evaluation period, is subject to the Cisco end user license agreement http://www.cisco.com/en/US/docs/general/warranty/English/EU1KEN_.html

If you use the product feature beyond the 60 day evaluation period, you must submit the appropriate payment to Cisco for the license. After the 60 day evaluation period, your use of the product feature will be governed solely by the Cisco end user license agreement (link above), together with any supplements relating to such product feature.

The above applies even if the evaluation license is not automatically terminated and you do not receive any notice of the expiration of the evaluation period. It is your responsibility to determine when the evaluation period is complete and you are required to make payment to Cisco for your use of the product feature beyond the evaluation period.

Your acceptance of this agreement for the software features on one product shall be deemed your acceptance with respect to all such software on all Cisco products you purchase which includes the same software. (The foregoing notwithstanding, you must purchase a license for each software feature you use past the 60 days evaluation period, so that if you enable a software feature on 1000 devices, you must purchase 1000 licenses for use past the 60 day evaluation period.)

Activation of the software command line interface will be evidence of your acceptance of this agreement.

*Jul 26 23:42:16.869: The default license boot level has been set to adventerprise

*Jul 26 23:42:16.869: %LICENSE-6-EULA_ACCEPT_ALL: The Right to Use End User License Agreement is accepted

*Jul 26 23:42:17.840: %IOS_LICENSE_IMAGE_APPLICATION-6-LICENSE_LEVEL: Module name = asr1001 reboot level = adventerprise and License = adventerprise

The router will boot with license.

Once the router boots back, the router has the new Cisco IOS XE Denali 16.3 image with the same type license as second boot image. To verify the license:

Example:

```
Router# show run | i lic
license udi pid ASR1004 sn FXS XXXXX
license accept end user agreement
license boot level adventerprise <=====
```

Step 4 Restore the backup configuration to the running configuration.

Example:

```
Router> enable
Router# copy bootflash:backup.cfg running-config
back to running configuration
Router# configure terminal
Enter configuration commands, one per line. End with {\tt CNTL/Z.}
Router(config) # no boot system bootflash:asr1000rp2-adventerprisek9. xxxx xxxx xxxx.bin <--
Removes the previous boot statement
Router(config) # boot system bootflash:<16.3 RP2 universal image name.bin>
Router(config)# end
Save configuration
Router# copy running-config startup-config
Warning . . .
Overwrite the previous NVRAM configuration? [confirm?]
Building configuration .....
[OK]
```

Upgrading the Cisco ASR 1000 Modular Platforms by Choosing License Based on System Prompts

Follow this procedure if you want to choose the license based on the system prompts:

Procedure

Step 1 Backup the running configuration.

Example:

```
Router# copy running-config bootflash:backup.cfg
Destination filename [backup1.cfg]?
1834 bytes copied in 0.112 secs (16375 bytes/sec
```

Step 2 Install the IOS XE 16.3 Universal image, save the configuration, and reload the route processors.

Example:

```
Router# configure terminal
Enter configuration commands, one per line. End with CNTL/Z.
Router(config)# no boot system bootflash: asr1000rp2-adventerprisek9. xxxx_xxxx_xxxx.bin
<-- Removes the previous boot statement
Router(config)# boot system bootflash:<16.3 RP2 universal image name.bin>
Router(config)# end
```

Verify the new 16.3 is the first boot image:

```
Router# show run | i boot
boot-start-marker
boot system bootflash:<16.3 RP2 universal image name.bin>
boot-end-marker

Router# copy running-config startup-config
Destination filename [startup-config]?
Building configuration...
```

```
[OK]
Router#
```

If you have a redundant route processor, copy new 16.3 to stby-bootflash as well.

Example:

Then reload the router. You must log in to the active RP console and the standby RP console to input license type and accept license.

Example:

```
Router# reload <-- Reload the from active router and boot the IOS 16.3 Universal image
```

Step 3 If the router has never run 16.x image and a license has never been configured before, the router will boot up and prompt to select the license type as shown below.

The options displayed to choose the license boot level during the upgrade are swapped. The options displayed on the router are: 1) adventerprise (AES), 2) advipservices (AIS), and 3) ipbase (IPB), whereas the correct options are: 1) advipservices (AIS), 2) ipbase (IPB), and 3) adventerprise (AES). After you choose an license boot level option, do not press the **Enter** key.

```
Cisco ASR1006 (RP2) processor (revision RP2) with 4140504K/6147K bytes of memory.
Processor board ID FXXXXXX
8 Gigabit Ethernet interfaces
32768K bytes of non-volatile configuration memory.
8388608K bytes of physical memory.
1884159K bytes of eUSB flash at bootflash:.
78085207K bytes of SATA hard disk at harddisk:.
OK bytes of at webui:.
To configure proper license boot level, please select one of following:
  1) adventerprise (AES)
  2) advipservices (AIS)
  3) ipbase (IPB)
Please input 1, 2 or 3: 1 <----select the license type you need, this example is AIS
*****************
YOU HAVE CHOSEN TO BOOT WITH adventerprise GLOBAL EULA* FOLLOWS NEXT
*****
*http://www.cisco.com/c/en/us/td/docs/routers/asr1000/configuration/guide/chassis/asrswcfg/csa rtu.html#pgfId-1059908
PLEASE READ THE FOLLOWING TERMS CAREFULLY. INSTALLING THE LICENSE OR
LICENSE KEY PROVIDED FOR ANY CISCO PRODUCT FEATURE OR USING SUCH
PRODUCT FEATURE CONSTITUTES YOUR FULL ACCEPTANCE OF THE FOLLOWING
TERMS. YOU MUST NOT PROCEED FURTHER IF YOU ARE NOT WILLING TO BE BOUND
BY ALL THE TERMS SET FORTH HEREIN.
```

Use of this product feature requires an additional license from Cisco, together with an additional payment. You may use this product feature on an evaluation basis, without payment to Cisco, for 60 days. Your use of the product, including during the 60 day evaluation period, is subject to the Cisco end user license agreement

http://www.cisco.com/en/US/docs/general/warranty/English/EU1KEN_.html If you use the product feature beyond the 60 day evaluation period, you must submit the appropriate payment to Cisco for the license. After the 60 day evaluation period, your use of the product feature will be governed solely by the Cisco end user license agreement (link above), together with any supplements relating to such product feature. The above applies even if the evaluation license is not automatically terminated and you do not receive any notice of the expiration of the evaluation period. It is your responsibility to determine when the evaluation period is complete and you are required to make payment to Cisco for your use of the product feature beyond the evaluation period.

Your acceptance of this agreement for the software features on one product shall be deemed your acceptance with respect to all such software on all Cisco products you purchase which includes the same software. (The foregoing notwithstanding, you must purchase a license for each software feature you use past the 60 days evaluation period, so that if you enable a software feature on 1000 devices, you must purchase 1000 licenses for use past the 60 day evaluation period.)

Activation of the software command line interface will be evidence of your acceptance of this agreement.

Step 4 Once the router boots up the second time, it has the new 16.3 image with the selected license. To verify the license, do the following:

Example:

```
Router# show run l i lic
License udi pid ASR1006 sn FXS XXXXX
License accept end user agreement
License boot level adventerprise
```

Step 5 Restore the backup configuration to the running configuration.

```
Router> enable
Router# copy bootflash:backup.cfg running-config
back to running configuration
Configure the right boot image:
Router# configure terminal
Enter configuration commands, one per line. End with CNTL/Z.
Router(config) # no boot system bootflash: xxxx_xxxx_xxxx.bin <-- Removes the previous boot
statement
Router(config) # boot system bootflash:<16.3 RP2 universal image name.bin>
Router(config)#^Z
Save configuration:
Router# copy running-config startup-config
Warning . . .
Overwrite the previous NVRAM configuration? [confirm?]
Building configuration ....
[OK]
```

ISSU and Trace Logs

ISSU Incompatibility Between Cisco IOS XE Release 3.x and Cisco IOS XE Denali 16.3

The Cisco IOS XE 16.3 is an ISSU-break release.

The ISSU super-package software upgrade and the sub-package software upgrade from Cisco IOS XE Release 3S or Cisco IOS Denali 16.2 to Cisco IOS XE Denali 16.3 is not supported.

In addition, the ISSU downgrade from Cisco IOS XE Denali 16.3 to Release XE 3S or Cisco IOS Denali 16.2 is not supported.

Trace Logs

For information about Trace Logs, see the Tracing Commands document.

Cisco CSR 1000v Series Cloud Services Routers

This section provides information about the changes that are introduced in Cisco IOS XE Denali 16.3.

For details about upgrading the Cisco IOS XE software, see the Cisco CSR 1000V Series Cloud Services Router Software Configuration Guide.

Supported and Unsupported Hypervisors and CSR 1000v Drivers

The following hypervisors/versions are supported by Cisco CSR 1000v on Cisco IOS XE Denali 16.3.1 or later. If you are using other versions of Cisco IOS XE, see Cisco CSR 1000V Series Cloud Services Router Software Configuration Guide.

VMware ESXi

- Server 6.0 update2 (instance running vm11) recommended. Fully tested and meets performance benchmarks
- Server 5.5 update3 (instance running vm10)

Although 5.5 update 3 is supported for Cisco IOS XE Denali 16.3.1, VMware ESXi Server 6.0 update 2 is recommended.

Kernel Based Virtual Machine (KVM)

- RHEL 7.2 recommended
- RHEL 7.1

Citrix XenServer

- 6.5 recommended
- 6.2

Microsoft Hyper-V

Windows Server 2012-R2, Hyper-V Mgr 6.3.9600.16384 recommended

Amazon Web Services

- C3, C4 and T2 instance types recommended
- M3 and C3

Microsoft Azure

- Standard D2 and Standard D3 recommended
- Standard D4-supported

Installing the Cisco IOS XE Denali 16.3 Software Image on an Existing VM Instance

To install the Cisco IOS XE Denali 16.3 software image on an existing VM instance, you must update the boot loader (Grub). To update the boot loader, do the following:



Note

You do not need to update the boot loader if you are installing the Cisco IOS XE Denali 16.3 software image on a brand new VM instance.

Procedure

- **Step 1** Install either the Cisco IOS XE 3.16.2 or the Cisco IOS XE 3.17S software image. After you install the image, the boot loader gets automatically updated.
- **Step 2** Install the Cisco IOS XE Denali 16.3 software image.

Cisco 4000 Series Integrated Services Routers

This section provides information about the changes that are introduced in Cisco IOS XE Denali 16.2 for Cisco 4000 Series Integrated Services Routers.

For details about upgrading the Cisco IOS XE software, see the Cisco 4000 Series ISRs Software Configuration Guide.

Supported and Unsupported Cisco 4000 Series ISR Hardware

Hardware	Supported
Platforms	Cisco 4321 ISR
	Cisco 4331 ISR
	Cisco 4351 ISR
	Cisco 4431 ISR
	Cisco 4451-X ISR
	For details, see the "Overview of the Cisco 4000 Series ISR" section in the Hardware Installation Guide for the Cisco 4000 Series Integrated Services Router.
NIMs and SMs	NIM-ES2-8, NIM-ES2-8P, and NIM-ES2-4 are now supported in Cisco IOS XE Denali 16.3 release.
	See Cisco 4000 Series Integrated Services Routers Interfaces and Modules.

Upgrading to Cisco IOS XE Denali 16.3 for the First Time

During the image upgrade of the Cisco ISR4000 Series to Cisco IOS XE Denali 16.3 for the first time, the installed version of ROMMON is automatically checked and upgraded if the system is running an older version. During the upgrade, it is important not to power cycle the router. The system will automatically be power cycled after the new ROMMON is installed in order for it to take effect, after which the system can boot up to IOS as normal. During the first boot if an upgrade is required, the entire boot process may take several minutes longer than a typical boot due to the ROMMON upgrade.

The following illustrates an example of what will happen during a boot of a Consolidated Package:

```
Router# configure terminal
Enter configuration commands, one per line. End with CNTL/Z.
Router(config)# boot system tftp://10.81.116.4/rtp-isr4400-54/isr4400.bin <----16.3 universal image
Router(config)# config-register 0x2102
```

```
Router(config)# exit
Router# show run | include boot
boot-start-marker
boot system tftp://10.81.116.4/rtp-isr4400-54/isr4400.bin
boot-end-marker
license boot level adventerprise
Router# copy running-config startup-config
Destination filename [startup-config]?
Building configuration...
[OK]
Router# reload
Proceed with reload? [confirm]
Sep 13 17:42:54.445 R0/0: %PMAN-5-EXITACTION: Process manager is exiting: process exit with
reload chassis code
Initializing Hardware ...
System integrity status: c0000600
Key Sectors:(Primary, GOOD), (Backup, GOOD), (Revocation, GOOD)
Size of Primary = 2288 Backup = 2288 Revocation = 300
ROM:RSA Self Test Passed
ROM: Sha512 Self Test Passed
Self Tests Latency: 58 msec
System Bootstrap, Version 12.2(20120618:163328) [username-ESGROM 20120618 GAMMA 101],
DEVELOPMENT SOFTWARE
Copyright (c) 1994-2014 by cisco Systems, Inc.
Compiled Mon 05/27/2014 12:39:32.05 by username
Current image running: Boot ROMO
Last reset cause: LocalSoft
Cisco ISR 4400 platform with 4194304 Kbytes of main memory
IP ADDRESS: 172.18.42.119
IP SUBNET MASK: 255.255.25.0
DEFAULT GATEWAY: 172.18.42.1
TFTP SERVER: 10.81.116.4
TFTP FILE: rtp-isr4400-54/isr4400.bin
TFTP MACADDR: a4:4c:11:9d:ad:97
TFTP VERBOSE: Progress
TFTP_RETRY_COUNT: 18
TFTP TIMEOUT: 7200
TFTP CHECKSUM: Yes
ETHER PORT: 0
ETHER SPEED MODE: Auto Detect
link up...
Receiving rtp-isr4400-54/isr4400.bin from 10.81.116.4
File reception completed.
Boot image size = 504063931 (0x1e0b67bb) bytes
ROM:RSA Self Test Passed
ROM: Sha512 Self Test Passed
Self Tests Latency: 58 msec
```

```
Package header rev 1 structure detected
Calculating SHA-1 hash...done
validate package: SHA-1 hash:
calculated 7294dffc:892a6c35:a7a133df:18c032fc:0670b303
expected 7294dffc:892a6c35:a7a133df:18c032fc:0670b303
Signed Header Version Based Image Detected
Using FLASH based Keys of type = PRIMARY KEY STORAGE
Using FLASH based Keys of type = ROLLOVER KEY STORAGE
RSA Signed DEVELOPMENT Image Signature Verification Successful.
Package Load Test Latency: 5116 msec
Image validated
Detected old ROMMON version 12.2(20150910:184432), upgrade required
Upgrading to newer ROMMON version required by this version of IOS-XE, do not power cycle
the system. A reboot will automatically occur for the new ROMMON to take effect.
selected: 1
Booted: 1
Reset Reason: 1
Info: Upgrading entire flash from the rommon package
Switching to ROM 0
Upgrade image MD5 signature is b702a0a59a46a20a4924f9b17b8f0887
Upgrade image MD5 signature verification is b702a0a59a46a20a4924f9b17b8f0887
Switching back to ROM 1
ROMMON upgrade complete.
To make the new ROMMON permanent, you must restart the RP.
ROMMON upgrade successful. Rebooting for upgrade to take effect.
Initializing Hardware ...
System integrity status: 00300610
Key Sectors:(Primary,GOOD), (Backup,GOOD), (Revocation,GOOD)
Size of Primary = 2288 Backup = 2288 Revocation = 300
ROM: RSA Self Test Passed
Expected hash:
ddaf35a193617abacc417349ae204131
12e6fa4e89a97ea20a9eeee64b55d39a
2192992a274fc1a836ba3c23a3feebbd
454d4423643ce80e2a9ac94fa54ca49f
Obtained hash:
ddaf35a193617abacc417349ae204131
12e6fa4e89a97ea20a9eeee64b55d39a
2192992a274fc1a836ba3c23a3feebbd
454d4423643ce80e2a9ac94fa54ca49f
ROM:Sha512 Self Test Passed
Self Tests Latency: 418 msec
Rom image verified correctly
System Bootstrap, Version 12.2(20120618:163328) [username-ESGROM 20120618 GAMMA 101],
DEVELOPMENT SOFTWARE
Copyright (c) 1994-2014 by cisco Systems, Inc.
Compiled Mon 05/27/2014 12:39:32.05 by username
CPLD Version: 33 (MM/DD/YY): 06/23/14 Cisco ISR4351/K9 Slot:0
```

```
Current image running: Boot ROM1
Last reset cause: ResetRequest
Reading confreg 0x2102
Reading monitor variables from NVRAM
Enabling interrupts...done
Checking for PCIe device presence...done
Cisco ISR4351/K9 platform with 16777216 Kbytes of main memory
autoboot entry: NVRAM VALUES: bootconf: 0x0, autobootstate: 0
autobootcount: 0, autobootsptr: 0x0
Rommon upgrade requested
Flash upgrade reset 0 in progress
Initializing Hardware ...
Checking for PCIe device presence...done
Reading confreg 2102
System integrity status: 0x300610
Key Sectors:(Primary, GOOD),(Backup,GOOD),(Revocation,GOOD)
Size of Primary = 2288 Backup = 2288 Revocation = 288
RSA Self Test Passed
Expected hash:
DDAF35A193617ABACC417349AE204131
12E6FA4E89A97EA20A9EEEE64B55D39A
2192992A274FC1A836BA3C23A3FEEBBD
454D4423643CE80E2A9AC94FA54CA49F
Obtained hash:
DDAF35A193617ABACC417349AE204131
12E6FA4E89A97EA20A9EEEE64B55D39A
2192992A274FC1A836BA3C23A3FEEBBD
454D4423643CE80E2A9AC94FA54CA49F
Sha512 Self Test Passed
Rom image verified correctly
System Bootstrap, Version 16.2(1r), RELEASE SOFTWARE
Copyright (c) 1994-2016 by cisco Systems, Inc.
Current image running: *Upgrade in progress* Boot ROMO
Last reset cause: BootRomUpgrade
ISR4351/K9 platform with 16777216 Kbytes of main memory
Cisco ISR 4400 platform with 4194304 Kbytes of main memory
IP ADDRESS: 172.18.42.119
IP SUBNET_MASK: 255.255.25.0
DEFAULT GATEWAY: 172.18.42.1
TFTP SERVER: 10.81.116.4
TFTP FILE: rtp-isr4400-54/isr4400.bin
TFTP MACADDR: a4:4c:11:9d:ad:97
TFTP VERBOSE: Progress
TFTP_RETRY COUNT: 18
TFTP TIMEOUT: 7200
TFTP CHECKSUM: Yes
ETHER PORT: 0
```

```
ETHER SPEED MODE: Auto Detect
link up...
Receiving rtp-isr4400-54/isr4400.bin from 10.81.116.4
File reception completed.
Boot image size = 504063931 (0x1e0b67bb) bytes
Image Base is: 0x56834018
Image Size is: 0x1E089706
Package header rev 1 structure detected
Package type:30000, flags:0x0
IsoSize = 503874534
Parsing package TLV info:
000: 00000009000001D4B45595F544C565F -
                                              KEY TLV
010: 5041434B4147455F434F4D5041544942 - PACKAGE COMPATIB
020: 494C495459000000000000090000000B - ILITY
030: 4652555F52505F545950450000000009 - FRU RP TYPE
040: 000000184B45595F544C565F5041434B - KEY TLV PACK
050: 4147455F424F4F544152434800000009 - AGE BOOTARCH
060: 0000000E415243485F693638365F5459 - ARCH_i686_TY
070: 5045000000000000900000144B45595F - PE
                                                  KEY
080: 544C565F424F4152445F434F4D504154 - TLV BOARD COMPAT
090: 0000000900000012424F4152445F6973 -
                                           BOARD is
0A0: 72343330305F5459504500000000000 - r4300 TYPE
OBO: 000000184B45595F544C565F43525950 - KEY TLV CRYP
OCO: 544F5F4B4559535452494E4700000009 - TO KEYSTRING
TLV: T=9, L=29, V=KEY TLV PACKAGE COMPATIBILITY
TLV: T=9, L=11, V=FRU RP TYPE
TLV: T=9, L=24, V=KEY TLV PACKAGE BOOTARCH
TLV: T=9, L=14, V=ARCH_i686_TYPE
TLV: T=9, L=20, V=KEY TLV BOARD COMPAT
TLV: T=9, L=18, V=BOARD isr4300 TYPE
TLV: T=9, L=24, V=KEY TLV CRYPTO KEYSTRING
TLV: T=9, L=10, V=EnCrYpTiOn
TLV: T=9, L=11, V=CW_BEGIN=$$
TLV: T=9, L=19, V=CW_FAMILY=$isr4300$
TLV: T=9, L=59, V=CW IMAGE=$isr4300-universalk9.2016-06-29 23.31 paj.SSA.bin$
TLV: T=9, L=19, V=CW VERSION=$16.3.1$
TLV: T=9, L=52, V=CW DESCRIPTION=$Cisco IOS Software, IOS-XE Software$
TLV: T=9, L=9, V=CW END=$$
Found DIGISIGN TLV type 12 length = 392
RSA Self Test Passed
Expected hash:
DDAF35A193617ABACC417349AE204131
12E6FA4E89A97EA20A9EEEE64B55D39A
2192992A274FC1A836BA3C23A3FEEBBD
454D4423643CE80E2A9AC94FA54CA49F
Obtained hash:
DDAF35A193617ABACC417349AE204131
12E6FA4E89A97EA20A9EEEE64B55D39A
2192992A274FC1A836BA3C23A3FEEBBD
454D4423643CE80E2A9AC94FA54CA49F
Sha512 Self Test Passed
Found package arch type ARCH i686 TYPE
Found package FRU type FRU RP TYPE
Calculating SHA-1 hash...Validate package: SHA-1 hash:
 calculated 8B082C48:35C23C9E:8A091441:D6FACEE6:B5111533
 expected 8B082C48:35C23C9E:8A091441:D6FACEE6:B5111533
Image validated
```

