

目录

[简介](#)

[开始使用前](#)

[规则](#)

[先决条件](#)

[使用的组件](#)

[说明](#)

[CMTS 上的 Cisco IOS 动态主机配置协议 \(DHCP\) 服务](#)

[进一步的 DHCP 服务器功能](#)

[Cisco IOS 时间 \(ToD\) 服务](#)

[Cisco IOS 简单文件传输协议 \(TFTP\) 服务](#)

[内部 DOCSIS 配置文件生成器](#)

[示例图](#)

[配置](#)

[基本一体化配置](#)

[基本配置验证提示](#)

[高级一体化配置](#)

[高级配置验证提示](#)

[相关信息](#)

简介

本文显示作为动态主机配置协议(DHCP)、ToD和TFTP server在思科的有线调制解调器终端系统(CMTS)的一配置。使用在CMTS的CLI它也解释如何创建了DOCSIS配置文件。此配置叫作“思科的CMTS的一体化配置”。

开始使用前

规则

有关文档规则的详细信息，请参阅 [Cisco 技术提示规则](#)。

先决条件

读者应该有DOCSIS协议和Cisco IOS line命令的基本的了解在UBR系列路由器。

使用的组件

在本文的硬件使用是从思科uBR7200、ubr7100或者ubr10k CMTS和DOCSIS兼容的有线调制解调器。

说明

DOCSIS兼容的有线调制解调器要求对服务器的三种类型的访问为了顺利地来联机。

- 第一是DHCP服务器，提供有线调制解调器IP地址、子网掩码和其他IP相关参数。
- 第二是告诉调制解调器的RFC868兼容每日定时(ToD)服务器什么当前时间是。有线调制解调器需要认识时间为了能适当地添加准确时间戳到其事件日志。
- 第三是有线调制解调器能下载包含有线调制解调器特定操作参数的DOCSIS配置文件的简单文件传输协议(TFTP)服务器。

大多有线电视运营商使用[Cisco网络认证\(CNR\)](#)作为DHCP、DNS和TFTP服务器。ToD服务器不作为CNR的部分。使用的ToD服务器取决于平台他们的系统。ToD应该是兼容的RFC868。对于UNIX系统，确保文件在Solaris只包括，它是必要的“inetd.conf”该在“/etc”目录的寿命包含以下线路：

对于Windows，使用的最普通的软件是[灰色软体](#)。

下表显示不同的服务器功能被添加了到CMTS的Cisco IOS软件版本版本。

服务器功能	Cisco IOS 软件版本
DHCP	12.0(1)T
ToD	12.0(4)XI
TFTP	11.0 (所有平台)

本文将解释这些功能中的每一个。包含所有这些功能在CMTS的配置是什么我们称“cmts的一体化配置”。使用此配置您不需要任何另外的服务器测试您的电缆装置提供高速互联网访问。

配置驻留在CMTS的DOCSIS配置文件而不是TFTP server也是可能的。根据[版本注释](#)，您需要至少Cisco IOS软件版本12.1(2)ec1使用此功能。

虽然此“一体化配置”为实验室环境、初始测试，小部署和排除故障是非常方便的，不是可扩展支持一个非常大数目的电缆调制解调器。不因此推荐在可操作的电缆装置中使用此配置与电缆调制解调器的大部署。

TAC工程师经常使用此配置能排除变量，当排除故障电缆问题时。

[CMTS 上的 Cisco IOS 动态主机配置协议 \(DHCP\) 服务](#)

运行Cisco IOS软件12.0(1)T或以上版本的Cisco路由器有行动能力作为DHCP服务器。此DHCP服务可能配置提供DHCP租约给电缆调制解调器和用户预定设备(CPE)例如PCs和 workstation。

有一最小值设置电缆调制解调器在线路典型地要求为了来的DHCP选项。即：

- IP地址(DHCP信息包头的yiaddr字段)
- 子网掩码(DHCP选项1)
- 从GMT抵消的本地时间以秒钟(DHCP选项2)
- 默认路由器(DHCP选项3)
- ToD服务器(DHCP选项4)的IP地址
- 日志服务器(DHCP选项7)
- TFTP server (DHCP信息包头的siaddr字段的) IP地址
- DOCSIS配置文件(DHCP信息包头的文件字段的)名称
- DHCP租用时光以秒钟(DHCP选项51)

在路由器中这可以配置如下：

每命令的说明如下：

- **dhcp pool**命令定义了含义(电缆调制解调器的白金服务)范围的名称(cm-platinum)。
- 网络提供IP地址和子网掩码(DHCP选项1)。
- bootfile提供在这种情况下是platinum.cm的引导程序文件名。
- next-server命令指定TFTP服务器IP地址(在这种情况下是在接口c4/0的主IP地址)。
- 默认路由器是默认网关，在这种情况下是主要接口IP地址c4/0 (option3)。
- 选项7是日志服务器DHCP选项。
- 选项4是ToD服务器IP地址(主要接口IP地址c4/0)。
- 选项2是GMT -8hr的(-8hr时间偏移选项= -28800在十六进制的秒= ffff.8f80)。
- 租用时间是7天0个小时10分钟。

注意：要得知更多如何变换抵销时间十进制值到十六进制，请读技术提示[如何计算DHCP选项的2\(时间偏移\)十六进制值](#)。

对于CPE设备以下选项最低为了能顺利地运行。

- IP地址(DHCP信息包头的yiaddr字段)
- 子网掩码(DHCP选项1)
- 默认路由器(DHCP选项3)
- 一个或更多域名服务器(DHCP选项6)的IP地址
- 域名(DHCP选项15)
- DHCP租用时光以秒钟(DHCP选项51)

当配置DHCP池时，在电缆接口配置里包括cable dhcp-giaddr policy命令是重要的。此命令有处理DHCP服务器分配租期对电缆调制解调器与主网络号相应地在电缆接口和租期效果对CPE与附属网络号相应地在电缆接口。如果此命令那么未命中所有DHCP租约将来自池与在电缆接口的主网络号相应。并且，因为我们在下面的接口的部分配置里将看到，范围cm-platinum关联与在接口电缆定义的主要地址4/0，并且范围pcs-c4在备用地址的网络。

注意没有cable helper-address或ip helper-address命令在电缆接口下。这是因为DHCP请求不需要转发到外部服务器，当使用时内部IOS DHCP服务器。如果此命令在接口下被添加，并且有配置的一个外部DHCP服务器，电缆调制解调器将注册与外部DHCP的配置。

进一步的 DHCP 服务器功能

可以使用使用Cisco IOS DHCP服务器的其它特性包括：

- **IP DHCP ping**：在保证的租期功能前的Ping DHCP服务器不发出已经是在使用中的IP地址的租期。
- **IP DHCP数据库**：存储DHCP捆绑在外部数据库中，为了在CMTS重新通电期间维护MAC地址到IP地址的关系。
- **显示IP DHCP**：可以用于监控DHCP服务器的操作的命令组。
- debug ip dhcp server：可以用于排除故障DHCP服务器的操作的命令组。

所有这些额外的功能和功能在Cisco IOS DHCP服务功能版本注释描述查找在[Cisco IOS DHCP服务器文档](#)。

Cisco IOS 时间 (ToD) 服务

在有线调制解调器成功地获取一DHCP租用后然后继续对尝试联系ToD服务器。运行Cisco IOS软件版本12.0(4)XI的Cisco CMTS产品或以后能提供RFC868 ToD服务。

常见的误解是电缆调制解调器需要使用的ToD服务，因为联机来的部分是同在Cisco路由器通常配置的网络时间协议(NTP)服务一样。NTP服务和ToD服务是不兼容的。电缆调制解调器不能与Ntp server对话。当电缆调制解调器必须尝试联系时间服务器作为联机时的进程的部分来，调制解调器兼容与DOCSIS 1.0 RFI规格的最新的版本将进行来联机，即使ToD服务器不可能被到达。

根据规格的多数最近版本，如果有线调制解调器无法联系ToD服务器然后它可以继续联机的进程来。然而它应该周期地继续设法联系ToD服务器，直到是成功的。DOCSIS 1.0 RFI规格的更旧的版本要求，如果有线调制解调器不可能联系ToD服务器然后调制解调器不可能来联机。知道是重要的运行老固件的电缆调制解调器可能遵照规格的此早版本。

注意：某些供应商的电缆调制解调器与Cisco IOS时间服务不兼容。如果这些调制解调器与DOCSIS 1.0 RFI规格的多数最新版本是兼容的那么他们应该继续来联机尽管。此互操作性问题由Cisco Bug ID CSCdt24107解决。

注意：要配置在思科的CMTS只两global命令的ToD请是需要的：

[Cisco IOS 简单文件传输协议 \(TFTP\) 服务](#)

在有线调制解调器尝试联系ToD服务器后，继续与TFTP server联系为了下载DOCSIS配置文件。如果一个二进制DOCSIS配置文件可以复制到在Cisco CMTS的一个闪存设备那么路由器能作为该文件的一TFTP server。

下载DOCSIS配置文件的步骤到闪存下列：

首先，请确保CMTS能到达DOCSIS配置文件居住的服务器：

```
7246VXR#ping 172.16.30.2Type escape sequence to abort.Sending 5, 100-byte ICMP Echos to
172.16.30.2, timeout is 2 seconds:!!!!Success rate is 100 percent (5/5), round-trip min/avg/max
= 1/1/4 ms
```

其次，请复制文件，它在这种情况下呼叫silver.cm到CMTS的闪存。

```
7246VXR#copy tftp flashAddress or name of remote host []? 172.16.30.2Source filename []?
silver.cmDestination filename [silver.cm]? Accessing tftp://172.16.30.2/silver.cm...Loading
silver.cm from 172.16.30.2 (via Ethernet2/0): ![OK - 76/4096 bytes]76 bytes copied in 0.152 secs
最后，它总是一个好想法检查闪存和验证文件的大小正确。对于此请执行show flash。
```

```
7246VXR#show flash-#- ED --type-- --crc--- -seek-- nlen -length- -----date/time----- name1 ..
unknown 2D6C7818 200CC 9 74 Feb 28 2001 7:39:09 silver.cm2 .. unknown 1CB785DC
20258 7 62 Feb 20 2001 15:44:11 test.cm3 .. image 4350A04F 7A0CC8 24 7866864
Feb 27 2001 09:36:40 ubr7200-ik1s-mz.121-4.EC4 .. unknown 36E5D6D3 7A0D94 7 76 Feb
28 2001 07:23:12 gold.cm8516204 bytes available (7867796 bytes used)
```

启用在那里CMTS的TFTP服务我们只需要包括以下in命令全局配置模式。

```
7246VXR#show flash-#- ED --type-- --crc--- -seek-- nlen -length- -----date/time----- name1 ..
unknown 2D6C7818 200CC 9 74 Feb 28 2001 7:39:09 silver.cm2 .. unknown 1CB785DC
20258 7 62 Feb 20 2001 15:44:11 test.cm3 .. image 4350A04F 7A0CC8 24 7866864
Feb 27 2001 09:36:40 ubr7200-ik1s-mz.121-4.EC4 .. unknown 36E5D6D3 7A0D94 7 76 Feb
28 2001 07:23:12 gold.cm8516204 bytes available (7867796 bytes used)
```

一旦此命令被输入，下列以后在配置里将显示：

```
7246VXR#show flash-#- ED --type-- --crc--- -seek-- nlen -length- -----date/time----- name1 ..
unknown 2D6C7818 200CC 9 74 Feb 28 2001 7:39:09 silver.cm2 .. unknown 1CB785DC
```

```
20258 7 62 Feb 20 2001 15:44:11 test.cm3 .. image 4350A04F 7A0CC8 24 7866864
Feb 27 2001 09:36:40 ubr7200-ik1s-mz.121-4.EC4 .. unknown 36E5D6D3 7A0D94 7 76 Feb
28 2001 07:23:12 gold.cm8516204 bytes available (7867796 bytes used)
```

关于TFTP server的配置的更多信息在路由器的请参阅本文[其他文件传输命令](#)。

内部 DOCSIS 配置文件生成器

运行Cisco IOS软件版本12.1(2)EC的Cisco CMTS产品或以后(在EC版本系列)可以配置生成和内部地存储DOCSIS配置文件。因为拿走需求访问一个外部[DOCSIS配置文件生成工具](#)，这是有用的。使用内部配置工具时，当DOCSIS配置文件创建，文件通过TFTP自动地变为联机。另外在直接地连接的线缆接口的仅电缆调制解调器能下载这些配置文件。

以下配置示例显示两个DOCSIS配置文件的创建。

允许有线调制解调器来联机的第一呼叫disable.cm，但是终止从访问服务提供商的网络的连接的CPE设备。在这种情况下我们看到命令“拒绝访问”。注意下行和上行速度在这种情况下是1Kbps，最大突发大小是1600个字节。

```
7246VXR#show flash-#- ED --type-- --crc--- -seek-- nlen -length- -----date/time----- name1 ..
unknown 2D6C7818 200CC 9 74 Feb 28 2001 7:39:09 silver.cm2 .. unknown 1CB785DC
20258 7 62 Feb 20 2001 15:44:11 test.cm3 .. image 4350A04F 7A0CC8 24 7866864
Feb 27 2001 09:36:40 ubr7200-ik1s-mz.121-4.EC4 .. unknown 36E5D6D3 7A0D94 7 76 Feb
28 2001 07:23:12 gold.cm8516204 bytes available (7867796 bytes used)
```

有线电视运营商会此“disable.cm” DOCSIS配置文件的原因是，因为他或她要拒绝对CPE的访问在电缆调制解调器背后，当让有线调制解调器来联机时。这是更有效的方式拒绝使用“请排除”在CNR的选项不会允许有线调制解调器来联机的CPE服务并且将浪费带宽的有线调制解调器将设法多次获得联机。

获得此DOCSIS配置文件的电缆调制解调器将看起来象在show cable modem命令下：


```
Cable4/0/U0 10 online(d) 2287 0.50 6 0 10.1.4.65 0010.7bed.9b45
(当联机)如下给予在此输出时的更多详细信息请添加链路。联机的状态“(d)”意味着电缆调制解调器只是，但是访问拒绝。
```

在第二示例中，DOCSIS配置文件名是创建的呼叫的“platinum.cm”。在这种情况下最大上行值是1Mbps，保证的上行是100Kpbs，最大下行是10Mbps，并且允许将连接的30个CPE设备对此。

```
Cable4/0/U0 10 online(d) 2287 0.50 6 0 10.1.4.65 0010.7bed.9b45
注意，当配置在我们不需要语句“TFTP server slot0:platinum.cm别名platinum.cm”的CMTS的DOCSIS配置文件，因为没有在内存时存储的“.cm”文件，它在配置内驻留。在内部DOCSIS配置文件工具的更详细的资料可以在本文Cable modem终端系统命令找到。
```

示例图

一典型的实验室设置拓扑在图片描述。

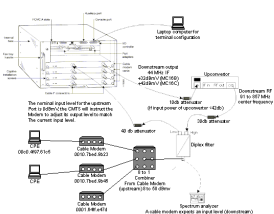

配置

所有思科的CMTS平台支持此配置。这包括uBR7200、uBR7246VXR、ubr7100和uBR10000。

在一配置方面支持所有，包括DOCSIS配置文件的配置的Cisco IOS软件版本，是Cisco IOS软件版本12.1(2)EC和随后的EC培训版本。

以下配置在uBR7246VXR使用Cisco IOS软件版本12.1(4)EC和有被执行了NPE300。首先提交基本配置更多高级配置然后将显示。

基本一体化配置

下面的配置汇总我们在本文解释的所有片段。它有两个DHCP范围，一电缆调制解调器的和人一个主机的在电缆调制解调器背后。

一个DOCSIS配置文件创建呼叫platinum.cm。此文件应用对呼叫的DHCP池cm-platinum。呼叫disabled.cm的另一个DOCSIS配置文件当时没有应用对任何东西。

有在本例中，一个电缆调制解调器的和另一个配置的两个DHCP池PC的在电缆调制解调器背后。

注意：一体化配置命令在**粗体**。

基本“一体化配置” 7246VXR

```
7246VXR#show run
version 12.1
no service pad
service timestamps debug datetime msec localtime! -- provides nice timestamps on all log messages
service timestamps log datetime localtime
no service password-encryption
service line numbers
service udp-small-servers max-servers no-limit! -- supports a large number of modems / hosts attaching quickly!
hostname 7246VXR
logging buffered 1000000 debugging enable
password cable
cable qos profile 8
cable qos profile 10 grant-size 1500
cable qos profile 12 guaranteed-upstream 10000
no cable qos permission create
no cable qos permission update
cable qos permission modems
cable time-server! -- permits cable modems to obtain Time of Day (ToD) from uBR7246VXR!
cable config-file disable.cm access-denied
service-class 1 max-upstream 1
service-class 1 max-downstream 1600
cpe max 1 timestamp
cable config-file platinum.cm
service-class 1 max-upstream 128
service-class 1 guaranteed-upstream 10
service-class 1 max-downstream 10000
service-class 1 max-burst 1600
cpe max 10 timestamp
clock timezone PDT -8
clock summer-time PDT recurring
clock calendar-valid
ip subnet-zero
ip cef! -- Turn on cef switching / routing, anything but process switching (no ip route-cache)
ip cef accounting per-prefix
no ip finger
ip tcp synwait-time 5
no ip domain-lookup! -- Prevents cmts from looking up domain names / attempting ! -- to connect to machines when mistyping commands
ip host vxr 172.16.26.103
ip domain-name cisco.com
ip name-server 171.68.10.70
ip name-server 171.69.2.132
ip name-server 171.68.200.250
no ip dhcp relay information check
!!! ip dhcp pool cm-platinum! -- name of the dhcp pool. This scope is for the cable modems attached ! -- to interface cable 4/0 network 10.1.4.0 255.255.255.0! --
```



```

pool of addresses for scope modems-c4/0 bootfile
platinum.cm! -- DOCSIS config file name associated with
this pool next-server 10.1.4.1! -- IP address of TFTP
server which sends bootfile default-router 10.1.4.1! -
- default gateway for cable modems, necessary to get
DOCSIS files option 7 ip 10.1.4.1! -- Log Server DHCP
option option 4 ip 10.1.4.1! -- ToD server IP
address option 2 hex ffff.8f80! -- Time offset for
ToD, in seconds, HEX, from GMT, -28,000 = PST =
ffff.8f80 lease 7 0 10! -- lease 7 days 0 hours 10
minutes! ip dhcp pool pcs-c4! -- name of the dhcp pool.
This scope is for the CPEs attached ! -- the cable
modems that are connected to interface cable 4/0
network 172.16.29.0 255.255.255.224! -- pool of
addresses for scope pcs-c4 (associated with the
secondary address) next-server 172.16.29.1 default-
router 172.16.29.1 dns-server 172.16.30.2 domain-
name cisco.com lease 7 0 10 !!interface
Ethernet2/0 ip address 172.16.30.4 255.255.255.192 no ip
mroute-cache half-duplex!interface Cable4/0 ip address
172.16.29.1 255.255.255.224 secondary! -- used for the
scope pcs-c4 so that PC's get an ip address on this
network ip address 10.1.4.1 255.255.255.0! -- used for
the scope modems-c4/0 so that cable modems get an ip
address from this network no ip route-cache cef no
keepalive cable downstream rate-limit token-bucket
shaping cable downstream annex B cable downstream
modulation 64qam cable downstream interleave-depth
32 cable downstream frequency 555000000 cable upstream 0
frequency 40000000 cable upstream 0 power-level 0 no
cable upstream 0 shutdown cable upstream 1
shutdown cable upstream 2 shutdown cable upstream 3
shutdown cable upstream 4 shutdown cable upstream 5
shutdown cable dhcp-giaddr policy! -- Used to modify
the GIADDR field of DHCPDISCOVER and DHCPREQUEST packets
with a ! -- Relay IP address before they are forwarded
to the DHCP server ! ! router eigrp
202 redistribute connected redistribute static network
10.0.0.0 network 172.16.0.0 no auto-summary no eigrp
log-neighbor-changes! router rip version
2 redistribute connected redistribute static network
10.0.0.0 network 172.16.0.0 no auto-summary! ip
default-gateway 172.16.30.1ip classlessip route 0.0.0.0
0.0.0.0 172.16.30.1ip route 172.16.30.0 255.255.255.0
Ethernet2/0ip http serverip http authentication
local! snmp-server engineID local
00000009020000E01ED77E40snmp-server community public
ROsnmp-server community private RWtftp-server server! --
enable the cmts to act as a tftp servertftp-server
slot0:silver.cm alias silver.cm! -- get the DOCSIS
config file called silver.cm that is pre-downloaded to
flash. ! -- this DOCSIS config file is built using
DOCSIS CPE Configurator. ! line con 0 exec-
timeout 0 0 transport input noneline aux 0 speed
19200line vty 0 4 session-timeout 60 login!ntp clock-
period 17179977ntp server 172.16.135.51end

```

基本配置验证提示

首先我们必须确保，Cisco IOS软件版本支持命令。对于此我们能执行show version。

```

7246VXR#show versionCisco Internetwork Operating System Software IOS (tm) 7200 Software
(UBR7200-IK1S-M), Version 12.1(4)EC, EARLY DEPLOYMENT RELEASE SOFTWARE (fc1)Copyright (c) 1986-
2000 by cisco Systems, Inc.Compiled Fri 08-Dec-00 17:35 by ninahungImage text-base: 0x60008950,
data-base: 0x612AA000ROM: System Bootstrap, Version 12.0(19990210:195103) [12.0XE 105],
DEVELOPMENT SOFTWAREBOOTFLASH: 7200 Software (UBR7200-BOOT-M), Version 12.0(7)T, RELEASE
SOFTWARE (fc2)7246VXR uptime is 9 minutesSystem returned to ROM by reload at 09:47:00 PDT Tue
Feb 27 2001System restarted at 09:48:26 PDT Tue Feb 27 2001System image file is "slot0:ubr7200-
iks-mz.121-4.EC"
cisco uBR7246VXR (NPE300) processor (revision C) with 253952K/40960K bytes of
memory.Processor board ID SAB03500058R7000 CPU at 262Mhz, Implementation 39, Rev 1.0, 256KB L2,
2048KB L3 Cache6 slot VXR midplane, Version 2.0Last reset from power-onBridging software.X.25
software, Version 3.0.0.4 Ethernet/IEEE 802.3 interface(s)1 FastEthernet/IEEE 802.3
interface(s)5 Cable Modem network interface(s)125K bytes of non-volatile configuration
memory.16384K bytes of Flash PCMCIA card at slot 0 (Sector size 128K).4096K bytes of Flash
internal SIMM (Sector size 256K).Configuration register is 0x2102

```

我们需要验证DOCSIS配置文件在闪存。

```

7246VXR#show flash-#- ED --type-- --crc--- -seek-- nlen -length- ----date/time----- name1 ..
unknown 2D6C7818 200CC 9 74 Feb 28 2001 7:39:09 silver.cm2 .. unknown 1CB785DC
20258 7 62 Feb 20 2001 15:44:11 test.cm3 .. image 4350A04F 7A0CC8 24 7866864
Feb 27 2001 09:36:40 ubr7200-iks-mz.121-4.EC4 .. unknown 36E5D6D3 7A0D94 7 76 Feb
28 2001 07:23:12 gold.cm8516204 bytes available (7867796 bytes used)

```

注意使用[DOCSIS CPE配置工具](#)，文件“silver.cm”被创建了。对于在CMTS配置里被创建您不需要语句“TFTP server slot0:platinum.cm别名platinum.cm”的platinum.cm文件，因为没有“Cm”文件，它在配置内驻留。

下一步是验证电缆调制解调器联机。我们能达到此与show cable modem命令。

```

7246VXR#show cable modemInterface Prim Online Timing Rec QoS CPE IP address MAC
address Sid State Offset PowerCable4/0/U0 75 online 2290 0.00 5 1
10.1.4.2 0010.7bed.9b23Cable4/0/U0 76 online 2809 0.00 5 0 10.1.4.3
0002.fdfa.0a63Cable4/0/U0 77 online 2288 0.25 5 1 10.1.4.5
0010.7bed.9b45Cable4/0/U0 78 online 2810 0.50 5 0 10.1.4.4
0004.2752.ddd5Cable4/0/U0 79 online 2813 0.25 5 0 10.1.4.6
0002.1685.b5dbCable4/0/U0 80 online 2812 -0.50 5 0 10.1.4.7 0001.64ff.e47d

```

注意所有电缆调制解调器联机。那个连接对接口电缆4/0/U0在网络10.1.4.0。我们能从配置看到他们的IP地址从呼叫的DHCP池被采取“cm-platinum”。

并且请注意有MAC地址的0010.7bed.9b23各自电缆调制解调器和0010.7bed.9b45，有CPE后边。那些电缆调制解调器来联机与默认桥接配置。那些PCs配置与DHCP，以便他们能从网络获得他们的IP地址。

```


7246VXR#show interface cable 4/0 modem 0SID Priv bits Type State IP address
method MAC address75 00 host unknown 172.16.29.2 static
00c0.4f97.61c575 00 modem up 10.1.4.2 dhcp 0010.7bed.9b2376
00 modem up 10.1.4.3 dhcp 0002.fdfa.0a6377 00 host
unknown 172.16.29.3 dhcp 00a0.243c.eff577 00 modem up
10.1.4.5 dhcp 0010.7bed.9b4578 00 modem up 10.1.4.4
dhcp 0004.2752.ddd579 00 modem up 10.1.4.6 dhcp
0002.1685.b5db80 00 modem up 10.1.4.7 dhcp 0001.64ff.e47d

```

以下图片显示那些PCs从池获得IP地址呼叫“pcs-c4.”



我们能从此PC也看到TCP/IP设置是自动获取IP地址。

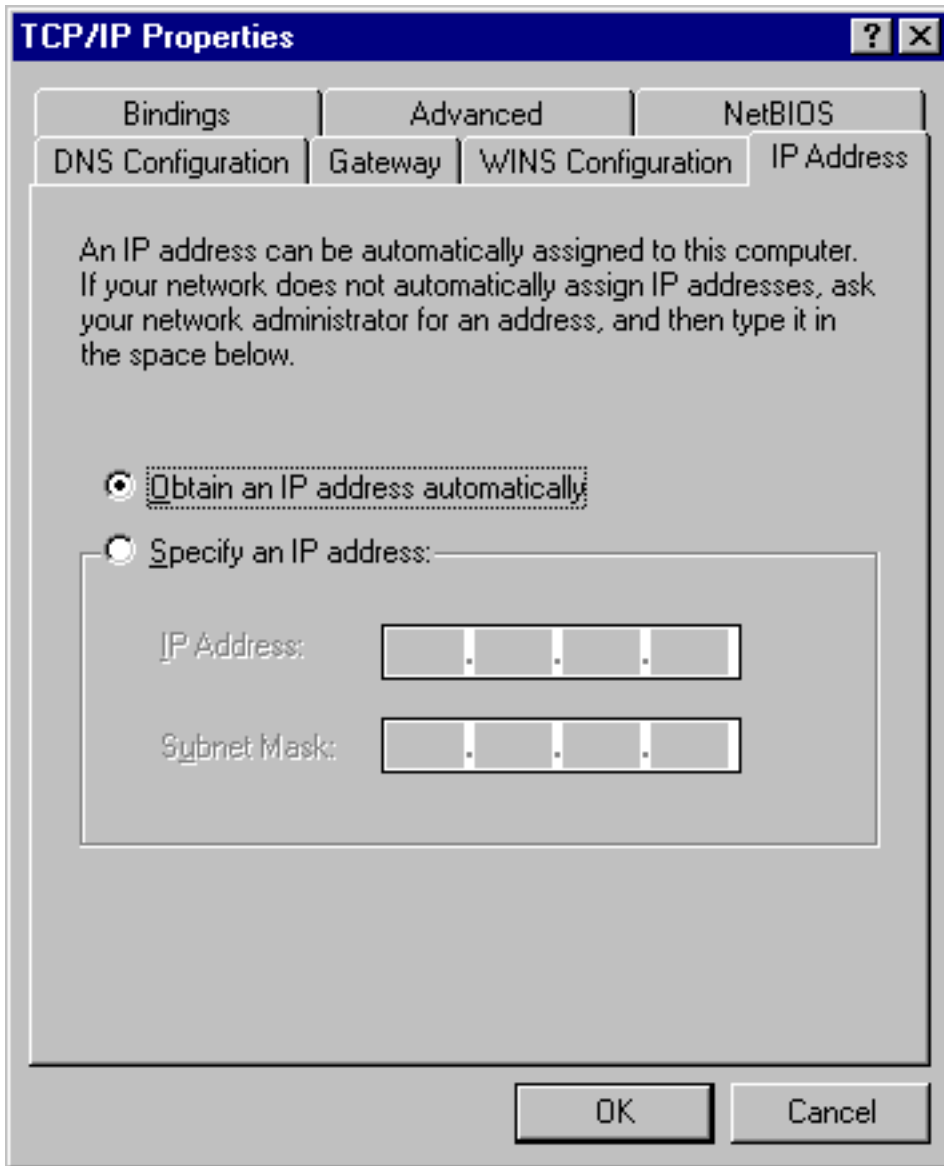

高级一体化配置

此部分提供介入DHCP池的层级功能的更加复杂的配置示例。方式DHCP池层级工作是所有DHCP池用是另一个池的网络号的一子集的网络号继承该其他池所有特性。这保存在DHCP服务器配置的重复。然而，如果同一个项目用一个不同的参数完成然后参数将覆盖。此示例将显示有呼叫platinum.cm的bootfile的一个常规池，并且此池的一子集将有呼叫disable.cm的bootfile。

除在基本示例创建的DHCP池之外，我们两电缆调制解调器的特殊需求。

有线调制解调器0010.7bed.9b45将是拒绝访问。这意味着有线调制解调器将授权IP地址，但是不会来联机。对于此我们将创建以下池：

```
7246VXR#show interface cable 4/0 modem 0SID Priv bits Type State IP address
method MAC address75 00 host unknown 172.16.29.2 static
00c0.4f97.61c575 00 modem up 10.1.4.2 dhcp 0010.7bed.9b2376
00 modem up 10.1.4.3 dhcp 0002.fdfa.0a6377 00 host
unknown 172.16.29.3 dhcp 00a0.243c.eff577 00 modem up
10.1.4.5 dhcp 0010.7bed.9b4578 00 modem up 10.1.4.4
dhcp 0004.2752.dd579 00 modem up 10.1.4.6 dhcp
0002.1685.b5db80 00 modem up 10.1.4.7 dhcp 0001.64ff.e47d
```

此配置示例多数显著的特点是与单个有线调制解调器MAC地址相应的特殊DHCP池指定的部分。这

是，以便DHCP服务器能发送唯一DHCP选项到这些调制解调器。为了指定特定有线调制解调器使用“client-identifier”参数。“client-identifier”必须设置到条目对应设备的MAC地址跟随的01。01对应于以太网硬件类型DHCP的。

注意：当更改调制解调器的时配置文件执行以下是必要的，以便有线调制解调器手工获得配置的参数：

- 收拾IP DHCP绑定表使用clear ip dhcp binding <ip address>命令”。
- 重置有线调制解调器有问题的使用clear cable modem <mac address > res命令。

有线调制解调器0010.7bed.9b23也有一个特殊需求。这将获得一个不同的服务质量。所以不同的bootfile关联对范围。请参阅下面部分配置：

```
7246VXR#show interface cable 4/0 modem 0SID Priv bits Type State IP address
method MAC address75 00 host unknown 172.16.29.2 static
00c0.4f97.61c575 00 modem up 10.1.4.2 dhcp 0010.7bed.9b2376
00 modem up 10.1.4.3 dhcp 0002.fdfa.0a6377 00 host
unknown 172.16.29.3 dhcp 00a0.243c.eff577 00 modem up
10.1.4.5 dhcp 0010.7bed.9b4578 00 modem up 10.1.4.4
dhcp 0004.2752.ddd579 00 modem up 10.1.4.6 dhcp
0002.1685.b5db80 00 modem up 10.1.4.7 dhcp 0001.64ff.e47d
```

当配置特定电缆调制解调器的时DHCP池它总是良好的做法给予一相关名称。并且，因为一个特定IP地址分配到使用host命令的池，我们需要global命令IP DHCP排除10.1.4.60 10.1.4.70的添加。此命令告诉DHCP不实施属于此范围的地址。

先进的“一体化配置” 7246VXR

```
7246VXR# show runversion 12.1no service padservice
timestamps debug datetime msec localtime service
timestamps log datetime localtimeno service password-
encryption service line numbers service udp-small-servers
max-servers no-limit!hostname 7246VXR!logging buffered
1000000 debugging!cable qos profile 8cable qos profile
10cable qos profile 10 grant-size 1500cable qos profile
12 guaranteed-upstream 100000no cable qos permission
create no cable qos permission updatecable qos permission
modemscable time-server!cable config-file
disable.cm access-denied service-class 1 max-upstream
1 service-class 1 max-downstream 1600 cpe max
1 timestamp!cable config-file platinum.cm service-class
1 max-upstream 128 service-class 1 guaranteed-upstream
10 service-class 1 max-downstream 10000 service-class 1
max-burst 1600 cpe max 10 timestamp!clock timezone PDT -
8clock summer-time PDT recurringclock calendar-validip
subnet-zero no ip fingerno ip domain-lookupip host vxr
172.16.26.103ip domain-name cisco.comip name-server
171.68.10.70ip name-server 171.69.2.132ip name-server
171.68.200.250ip dhcp excluded-address 10.1.4.60
10.1.4.70!ip dhcp pool cm-platinum network 10.1.4.0
255.255.255.0 bootfile platinum.cm next-server
10.1.4.1 default-router 10.1.4.1 option 7 ip
10.1.4.1 option 4 ip 10.1.4.1 option 2 hex
ffff.8f80 lease 7 0 10!ip dhcp pool pcs-c4 network
172.16.29.0 255.255.255.224 next-server 172.16.29.1
default-router 172.16.29.1 dns-server 172.16.30.2
domain-name cisco.com lease 7 0 10!ip dhcp pool cm-
0010.7bed.9b45 host 10.1.4.65 255.255.255.0 client-
identifier 0100.107b.ed9b.45 bootfile disable.cm!ip
dhcp pool cm-0010.7bed.9b23 host 10.1.4.66
255.255.255.0 client-identifier 0100.107b.ed9b.23
bootfile silver.cm!!interface Ethernet2/0 ip address
```

```

172.16.30.4 255.255.255.192 no ip mroute-cache half-
duplex!interface Cable4/0 ip address 172.16.29.1
255.255.255.224 secondary ip address 10.1.4.1
255.255.255.0 no keepalive cable downstream rate-limit
token-bucket shaping cable downstream annex B cable
downstream modulation 64qam cable downstream interleave-
depth 32 cable downstream frequency 555000000 cable
upstream 0 frequency 400000000 cable upstream 0 power-
level 0 no cable upstream 0 shutdown cable upstream 1
shutdown cable upstream 2 shutdown cable upstream 3
shutdown cable upstream 4 shutdown cable upstream 5
shutdown cable dhcp-giaddr policy!router eigrp
202 redistribute connected redistribute static network
10.0.0.0 network 172.16.0.0 no auto-summary no eigrp
log-neighbor-changes!router rip version 2 redistribute
connected redistribute static network 10.0.0.0 network
172.16.0.0 no auto-summary!ip default-gateway
172.16.30.1ip classlessip route 0.0.0.0 0.0.0.0
172.16.30.1ip route 172.16.30.0 255.255.255.0
Ethernet2/0ip http serverip http authentication
local!access-list 188 permit tcp any any eq www
logaccess-list 188 permit ip any anyroute-map docsis
permit 10!snmp-server engineID local
00000009020000E01ED77E40snmp-server community public
ROsnmp-server community private RWtftp-server
slot0:silver.cm alias silver.cmtftp-server serverline
con 0 exec-timeout 0 0 transport input noneline aux
0 speed 19200line vty 0 4 session-timeout 60 exec-
timeout 0 0 login!ntp clock-period 17179973end

```

高级配置验证提示

此配置的验证着重电缆调制解调器获得的服务，特别0010.7bed.9b45和0010.7bed.9b23。我们需要肯定他们获得手工配置的地址和服务。

测试的第一件事是0010.7bed.9b45将来联机，但是服务将拒绝。对于此我们请看一看在show cable modem命令：

```

7246VXR#show cable modemInterface Prim Online Timing Rec QoS CPE IP address MAC
address Sid State Offset PowerCable4/0/U0 7 online 2813 0.00 7 0
10.1.4.7 0002.1685.b5dbCable4/0/U0 8 online 2809 0.25 7 0 10.1.4.10
0002.fdfa.0a63Cable4/0/U0 9 online 2288 -0.25 5 1 10.1.4.66
0010.7bed.9b23Cable4/0/U0 10 online(d) 2287 0.50 6 0 10.1.4.65
0010.7bed.9b45Cable4/0/U0 11 online 2809 -0.50 7 0 10.1.4.6
0001.64ff.e47dCable4/0/U0 12 online 2812 -0.50 7 0 10.1.4.9 0004.2752.ddd5

```

有注意的几个点此处：

- 有线调制解调器0010.7bed.9b23获得了IP地址10.4.1.66在范围cm-0010.7bed.9b23上指定。有计算机附加对它，并且从池pcs-c4获得其IP地址。
- 有线调制解调器0010.7bed.9b23有不同的QoS。
- 有线调制解调器0010.7bed.9b45获得了IP地址10.1.4.65在范围cm-0010.7bed.9b45上指定。有计算机附加对它，然而CPE值是0。原因是服务拒绝。
- 意味着0010.7bed.9b45的在线状态联机(d)有线调制解调器来联机，但是对有线网络的访问拒绝。请参阅debug cable mac log verbose输出从有线调制解调器的。

```

21:52:16: 78736.550 CMAC_LOG_RESET_RANGING_ABORTED 21:52:16: 78736.554
CMAC_LOG_STATE_CHANGE reset_interface_state21:52:16: 78736.558
CMAC_LOG_STATE_CHANGE reset_hardware_state21:52:17: 78737.024

```

```

CMAC_LOG_STATE_CHANGE          wait_for_link_up_state21:52:17: 78737.028
CMAC_LOG_DRIVER_INIT_IDB_RESET 0x082B9CA821:52:17: 78737.032
CMAC_LOG_LINK_DOWN             21:52:17: 78737.034
CMAC_LOG_LINK_UP               21:52:17: 78737.040
CMAC_LOG_STATE_CHANGE          ds_channel_scanning_state21:52:17: %LINEPROTO-5-
UPDOWN: Line protocol on Interface cable-modem0, changed state to down21:52:18: 78738.386
CMAC_LOG_UCD_MSG_RCVD          121:52:19: 78739.698
CMAC_LOG_DS_64QAM_LOCK_ACQUIRED 74700000021:52:19: 78739.702
CMAC_LOG_DS_CHANNEL_SCAN_COMPLETED 21:52:19: 78739.704
CMAC_LOG_STATE_CHANGE          wait_ucd_state21:52:20: 78740.368
CMAC_LOG_UCD_MSG_RCVD          121:52:22: 78742.396
CMAC_LOG_UCD_MSG_RCVD          121:52:22: 78742.398
CMAC_LOG_ALL_UCDS_FOUND        21:52:22: 78742.402
CMAC_LOG_STATE_CHANGE          wait_map_state21:52:22: 78742.406
CMAC_LOG_FOUND_US_CHANNEL      121:52:24: 78744.412
CMAC_LOG_UCD_MSG_RCVD          121:52:24: 78744.416
CMAC_LOG_UCD_NEW_US_FREQUENCY 3998400021:52:24: 78744.420
CMAC_LOG_SLOT_SIZE_CHANGED     821:52:24: 78744.500
CMAC_LOG_UCD_UPDATED           21:52:24: 78744.560
CMAC_LOG_MAP_MSG_RCVD          21:52:24: 78744.564
CMAC_LOG_INITIAL_RANGING_MINISLOTS 4121:52:24: 78744.566
CMAC_LOG_STATE_CHANGE          ranging_1_state21:52:24: 78744.570
CMAC_LOG_RANGING_OFFSET_SET_TO 961021:52:24: 78744.574
CMAC_LOG_POWER_LEVEL_IS        55.0 dBmV (commanded)21:52:24: 78744.578
CMAC_LOG_STARTING_RANGING      21:52:24: 78744.580
CMAC_LOG_RANGING_BACKOFF_SET   021:52:24: 78744.586
CMAC_LOG_RNG_REQ_QUEUED        021:52:24: 78744.622
CMAC_LOG_RNG_REQ_TRANSMITTED   21:52:24: 78744.626
CMAC_LOG_RNG_RSP_MSG_RCVD      21:52:24: 78744.628
CMAC_LOG_RNG_RSP_SID_ASSIGNED  1021:52:24: 78744.632
CMAC_LOG_ADJUST_RANGING_OFFSET 228621:52:24: 78744.636
CMAC_LOG_RANGING_OFFSET_SET_TO 1189621:52:24: 78744.638
CMAC_LOG_STATE_CHANGE          ranging_2_state21:52:24: 78744.644
CMAC_LOG_RNG_REQ_QUEUED        1021:52:25: 78745.654
CMAC_LOG_RNG_REQ_TRANSMITTED   21:52:25: 78745.658
CMAC_LOG_RNG_RSP_MSG_RCVD      21:52:25: 78745.660
CMAC_LOG_RANGING_SUCCESS       21:52:25: 78745.680
CMAC_LOG_STATE_CHANGE          dhcp_state21:52:25: 78745.820
CMAC_LOG_DHCP_ASSIGNED_IP_ADDRESS 10.1.4.6521:52:25: 78745.824
CMAC_LOG_DHCP_TFTP_SERVER_ADDRESS 10.1.4.121:52:25: 78745.826
CMAC_LOG_DHCP_TOD_SERVER_ADDRESS 10.1.4.121:52:25: 78745.830
CMAC_LOG_DHCP_SET_GATEWAY_ADDRESS 21:52:25: 78745.834
CMAC_LOG_DHCP_TZ_OFFSET        -2880021:52:25: 78745.836
CMAC_LOG_DHCP_CONFIG_FILE_NAME disable.cm21:52:25: 78745.840
CMAC_LOG_DHCP_ERROR_ACQUIRING_SEC_SVR_ADDR 21:52:25: 78745.846
CMAC_LOG_DHCP_COMPLETE         21:52:25: 78745.968
CMAC_LOG_STATE_CHANGE          establish_tod_state21:52:25: 78745.978
CMAC_LOG_TOD_REQUEST_SENT      21:52:26: 78746.010
CMAC_LOG_TOD_REPLY_RECEIVED    319252521721:52:26: 78746.018
CMAC_LOG_TOD_COMPLETE          21:52:26: 78746.020
CMAC_LOG_STATE_CHANGE          security_association_state21:52:26: 78746.024
CMAC_LOG_SECURITY_BYPASSED     21:52:26: 78746.028
CMAC_LOG_STATE CHANGE configuration_file_state21:52:26: 78746.030
CMAC_LOG_LOADING_CONFIG FILE disable.cm21:52:26: %LINEPROTO-5-UPDOWN: Line
protocol on Interface cable-modem0, changed state to up21:52:27: 78747.064
CMAC_LOG_CONFIG_FILE_PROCESS_COMPLETE 21:52:27: 78747.066
CMAC_LOG_STATE_CHANGE          registration_state21:52:27: 78747.070
CMAC_LOG_REG_REQ_MSG_QUEUED    21:52:27: 78747.076
CMAC_LOG_REG_REQ_TRANSMITTED   21:52:27: 78747.080
CMAC_LOG_REG_RSP_MSG_RCVD      21:52:27: 78747.082
CMAC_LOG_COS_ASSIGNED_SID      1/1021:52:27: 78747.088
CMAC_LOG_RNG_REQ_QUEUED        1021:52:27: 78747.090
CMAC_LOG_NETWORK ACCESS DENIED 21:52:27: 78747.094
CMAC_LOG_REGISTRATION_OK       21:52:27: 78747.096

```

```

CMAC_LOG_STATE_CHANGE          establish_privacy_state21:52:27: 78747.100
CMAC_LOG_PRIVACY_NOT_CONFIGURED 21:52:27: 78747.102
CMAC_LOG_STATE_CHANGE          maintenance_state21:52:31: 78751.122
CMAC_LOG_RNG_REQ_TRANSMITTED    21:52:31: 78751.124
CMAC_LOG_RNG_RSP_MSG_RCVD       21:52:37: 78757.164
CMAC_LOG_RNG_REQ_TRANSMITTED    21:52:37: 78757.168
CMAC_LOG_RNG_RSP_MSG_RCVD       21:52:43: 78763.206
CMAC_LOG_RNG_REQ_TRANSMITTED    21:52:43: 78763.210
CMAC_LOG_RNG_RSP_MSG_RCVD       21:52:49: 78769.250
CMAC_LOG_RNG_REQ_TRANSMITTED    21:52:49: 78769.252 CMAC_LOG_RNG_RSP_MSG_RCVD

```

此调试输出显示网络访问拒绝。

```

7246VXR#show cable modem detail
Interface  SID  MAC address  Max CPE  Concatenation  Rx
SNRCable4/0/U0 7  0002.1685.b5db 10  yes  33.52Cable4/0/U0 8  0002.fdfa.0a63
10  yes  33.24Cable4/0/U0 9  0010.7bed.9b23 1  no
33.29Cable4/0/U0 10 0010.7bed.9b45 1  no  33.23Cable4/0/U0 11
0001.64ff.e47d 10  yes  33.20Cable4/0/U0 12 0004.2752.ddd5 10
yes  33.44

```

注意电缆调制解调器的最大数量CPE有特殊范围的是1和其余是10。如果看到范围platinum.cm的配置，安排10个CPE指定，另一方面，范围disable.cm有only1 CPE。预先配置的DOCSIS配置文件silver.cm只也有指定的一个CPE。

```

7246VXR#show interface cable 4/0 modem 0
SID  Priv bits  Type  State  IP address
method  MAC address7  00  modem  up  10.1.4.7  dhcp
0002.1685.b5db8  00  modem  up  10.1.4.10  dhcp  0002.fdfa.0a639
00  host  unknown  172.16.29.2  static  00c0.4f97.61c59  00  modem
up  10.1.4.66  dhcp  0010.7bed.9b2310  00  modem  up
10.1.4.65  dhcp  0010.7bed.9b4511  00  modem  up  10.1.4.6
dhcp  0001.64ff.e47d12  00  modem  up  10.1.4.9  dhcp
0004.2752.ddd5

```

要验证电缆调制解调器获得正确级别服务，我们看到show cable qos profile命令的输出。

```

7246VXR#show cable qos profile
ID  Prio Max  Guarantee Max  Max  TOS  TOS  Create
B  IP prec.  upstream upstream downstream tx  mask value by  priv
rate  bandwidth bandwidth bandwidth burst  enab enabl  0
0  0  0  0  0x0 0x0  cmts(r) no  no  2  0  64000
0  1000000  0  0x0 0x0  cmts(r) no  no  3  7  31200  31200
0  0  0x0 0x0  cmts  yes  no  4  7  87200  87200  0  0
0x0 0x0  cmts  yes  no  5  4  64000  0  512000  0  0x0 0x0
cm  no  no  6  0  1000  0  1600000  0  0x0 0x0  cm  no
no  7  0  128000  10000  10000000  1600 0x0 0x0  cm  no  no  8  0
0  0  0  0  0x0 0x0  mgmt  no  no  10  0  0
0  0  0  0x0 0x0  mgmt  no  no  12  0  0  100000000
0  0  0x0 0x0  mgmt  no  no

```

注意qos ID 7配比与在platinum.cm的配置：

```

cable config-file platinum.cm service-class 1 max-upstream 128 service-class 1 guaranteed-
upstream 10 service-class 1 max-downstream 10000 service-class 1 max-burst 1600 cpe max
10 timestamp

```

同样发生与disable.cm DOCSIS配置。

```

7246VXR#show ip dhcp binding
IP address  Hardware address  Lease expiration
Type10.1.4.6  0100.0164.ffe4.7d  Mar 08 2001 07:58 AM  Automatic10.1.4.7
0100.0216.85b5.db  Mar 08 2001 07:58 AM  Automatic10.1.4.9
0100.0427.52dd.d5  Mar 08 2001 07:58 AM  Automatic10.1.4.10
0100.02fd.fa0a.63  Mar 08 2001 08:36 AM  Automatic10.1.4.65
0100.107b.ed9b.45  Infinite  Manual10.1.4.66  0100.107b.ed9b.23
Infinite  Manual

```

相关信息

- [故障排除 UBR 电缆调制解调器不上线的问题](#)
- [DOCSIS CPE Configurator \(仅限注册用户\)](#)
- [Cisco IOS DHCP 服务器](#)
- [其他文件传输命令](#)
- [技术支持 - Cisco Systems](#)