

Rehost autorise entre les linecards MC3GX60V dans un routeur uBR10012

Contenu

[Introduction](#)

[Composants utilisés](#)

[Conditions requises](#)

[Procédure](#)

[Étape 1 : Obtenez le laisser-passer de périphérique](#)

[Étape 2 : Transfert de permis de demande sur le portail de permis](#)

[Étape 2.1 Spécifiez la source pour le transfert de permis](#)

[Étape 2.2 Spécifiez la cible pour le transfert de permis](#)

[Étape 2.3 Générez le ticket d'autorisation pour le transfert de permis](#)

[Étape 3 : Retirez le permis sur la source LC](#)

[Étape 4 : Obtenez le nouveau permis pour la cible LC sur le portail de permis](#)

[Étape 4.1 : Écrivez les informations de rehost](#)

[Étape 4.2 : Générez le fichier de licence pour la cible LC](#)

[Étape 5 : Installez le nouveau permis sur la cible LC.](#)

[Étape 5.1 : fichier de licence de copie à CMTS](#)

[Étape 5.2 : Vérifiez l'état en cours de permis avant d'installer le nouveau permis sur la cible LC](#)

[Étape 5.3 : Installez le nouveau permis sur la cible LC](#)

[Étape 5.4 : Vérifiez l'état de permis après installation](#)

Introduction

Ce document décrit la procédure pour rehosting, ou en d'autres termes, le processus de transférer les permis entre 2 linecards (LC) d'un uBR1002. Dans cet exemple, 2 DS X 2 permis des USA de l'emplacement de carte de ligne 8/1 (qui a initialement 72x60) sont transférés vers l'emplacement de carte de ligne 8/0 (qui a initialement 60x16) sur le linecard de Cisco uBR-MC3GX60V.

Contribué par : Shawn Dashuai Zhang et Andy Lau

Édité par : Kumar Sridhar

Composants utilisés

Routeur haut débit universel Cisco uBR10012

Linecards MC3GC60V

Conditions requises

Un compte de procédure de connexion avec [Cisco.com](https://www.cisco.com)

Access au permis <https://slexui.cloudapps.cisco.com/SWIFT/LicensingUI/Quickstart> portail de Cisco #

Procédure

Être les les étapes impliquées dans rehosting les permis de la carte de source, dans l'emplacement 8/1 de viser la carte, dans l'emplacement 8/0 :

Étape 1 : Obtenez le laisser-passer de permis de la source LC.

Étape 2 : Transfert de permis de demande sur le portail de permis.

Étape 3 : Retirez le permis sur la source LC.

[Étape 4 :](#) Obtenez le nouveau permis pour la cible LC sur le portail de permis.

[Étape 5 :](#) Installez le nouveau permis sur la cible LC.

Étape 1 : Obtenez le laisser-passer de périphérique

Utilisant les commandes affichées ci-dessous, sauvegardez le laisser-passer de périphérique de LC 8/1 à disk0 en tant que "81_cred.txt". Vous pouvez afficher le contenu du fichier utilisant **plus de** commande suivie du nom du fichier :

```
ubr10012-1#show license udi
```

SlotID	PID	SN	UDI
7/0	UBR-MC20X20V	CAT1441E0L2	UBR-MC20X20V:CAT1441E0L2
7/1	UBR-MC20X20V	CAT1441E0KH	UBR-MC20X20V:CAT1441E0KH
8/0	UBR-MC3GX60V	CAT1616E015	UBR-MC3GX60V:CAT1616E015

```
8/1 UBR-MC3GX60V CAT1435E0TZ UBR-MC3GX60V:CAT1435E0TZ ubr10012-1#license save credential
disk0:81_cred.txt subslot ?8/1 Device credential saved . . . . to disk0:81_cred.txt ubr10012-
1#more disk0:81_cred.txt <?xml version="1.0" encoding="UTF-8" ?><CISCO_WT_ARTIFACTS
version="1.0"><CISCO_WT_REHOST_ARTIFACT version="1.0"><HEADER><ARTIFACT_TYPE>Device
Credentials</ARTIFACT_TYPE><ARTIFACT_VERSION>1.0</ARTIFACT_VERSION><TRANSACTION_ID>T and I trans
id</TRANSACTION_ID><UDI><PID>UBR-
MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Device</SOURCE><CREATE_DATE>2013-07-
04T13:25:25.307Z</CREATE_DATE><ARTIFACT_INFO>T and art
info</ARTIFACT_INFO></HEADER><CONTENT><DECIPHER_INFO
encoding="BASE64">AAEAAgAOAA4AhQEBgABlBM8UMnw+NZxYfVWqIFuiUq7aqRoKmf06/hOkQuoe706yxkteiCMZrEE592
0+SxD6TTEHBqlf9YHxgv6yguQ9hM+JXLasZRP5i jSyTfHc0eATvmwltxEv17kMmI jpxMlZ7/tKd4AAAAAAAAAAAAAAAA
AAAAAAAAAAAAAAAA=</DECIPHER_INFO><CORE_DATA><CIPHER_DATA
encoding="BASE64">AAEAAgAPAA8DhAAPABAN/1bTrMxBGdHYqWuzbUD5rFvGVudf1BuINdnRKipAksB00Vs96Zw5U5tYt
xK0nixv1lz1UtTvJhxzyK2r+1HG1UcZhn4ZPLIYWcJTMSPqPAnPeI6rE324hkaT+NveeQxfDVAp+uGu3/CKesJbfa3x0qyqM
cevT2mUfC2aZY21Lbga9mv8dhNlSUTKN0uDGpChaHNw+VKXfLh0Y/rGurwVb63UsRkoIglef5Iw5bDHmZ6y2RiJy+VR7LvBZ
MZialAouROg7XiRwFjqGOMsahKrkTF+aMFBNBdHiOgZAYP7QnaiKNwsFHnU0Wky1EzqbCByce6CBrMMWDWLE30z68j/5roX1
m2cUHYEJAmGUBmCHreBeEa44SHyQkTKQ1pv2213nhKv4PZ5cL5JIQS6xZMY6mcNj1f0uuUXIKswWrRj7TOgnQJCSB+cP9POu
JIz8cQrXopc1P+McA/TdNv9K0usJOnUJZVCC2ZvS2B6XaLdAGssGbL0W3dlqyKpcushbLZ6s1F7h0vuQ4N56pScxO+PiE4VF
rz4G1U9JfWgt/G1hF359yNtaBBikxml37A5uwoDT5cmfLpJLJ48kWSi/9qunQ2mvmxxgRI+tmY3SxQtcx2GgmiPGNVTX8W1
hheo1DMRiLNYxmfrMP9vK27rcpsS4fEN2bk0hkaPDMQDzx+/MsNS/38vSrHWkWRoe9xM0cAybyYJgX7jr4hYed0F0g6QD+9U
vm8Ski0UMbMCAAZJHZJcgaC8BGvhZvbnDVPBoHq1+8P1t129YSFCg8GfJ1XHamTqRB+kxZihVcRmD5eG6o70s2h/kt9oZteq
jMVraDEURxFY4SSr7Wym1Oa0e7WAP0rrCBUnMV18bkNW22Ju5OeytNGHvKz9mjDfEfQmZegHrQJSQeMQD0h+UrRlS9qzpls8
5FL1sb6J7S1HvGMFdkTq3ITuqcmxMdgukZLP3prfWYc5ZaMtZ256B/ZdGiNowePzbvaFwUAYwQsLYDBrPmT80Bfm4SVekA6
ZSyexnkJevGipqW0Qom9ATZqplm60Lfwl0NpNTBVvv3Izin8M7h4SnAsRq59Kw5E4RgsraIgyhtbDbEn6109MegKb/hwErF
l0541z4DSfPdWUeiBrGziv9/D9fiK6NZ2/v1vOePYZTRehZlUkOJPlZwi817qRKZtBcHLXonc95q01w==</CIPHER_DATA>
</CORE_DATA><SIGNATURE_INFO
encoding="BASE64">AAEAAgALAAAsAVAECAQnYWA7F1UKowplFYRGINxVef2ThwAAAAAAAAAAAAAAAAABImmNxd3wiI3ESvX6T
CYfl8ffm9kRCY+zaQAc3leY0iCVh5/4qa2t4Ns1iS+icrxrw==</SIGNATURE_INFO></CONTENT></CISCO_WT_REHOST_A
RTIFACT></CISCO_WT_ARTIFACTS> ubr10012-1#
```

Étape 2 : Transfert de permis de demande sur le portail de permis

Allez à <https://slexui.cloudapps.cisco.com/SWIFT/LicensingUI/Quickstart#au> site Web, sélectionnez le devce des « périphériques », cliquez sur le bleu « > » pour sélectionner le « permis de Rehost... » et collez le laisser-passer de périphérique (de plus de sortie de commande comme dans étape 1) pour enregistrer et demander un transfert de permis :

Product License Registration Help Settings

Show: All Licenses for Yuen Tak Lau

PAKs or Tokens | Licenses | **Devices** | Transactions History

Get Licenses | Move Licenses | Add Devices | Download Licenses | Email Selected Licenses | Export to CSV | Show Filters

Device	Family	Features	Quantity
<input type="checkbox"/> UDI Product ID:UBR-MC3GX60V UDI Serial Number:	UBR MC20x20/3G60/PRE5/3GSPA	DS_License	123
		US_License	35
<input type="checkbox"/> UDI Product ID:UBR-MC20X20V UDI Serial Number:		US_License	20
		DS_License	20
		DS_License	+1 120
		MEM-8XX-512U1GB	1
<input type="checkbox"/> UDI Product ID:C891FW-E-K9 UDI Serial Number:	800 Fixed	advipservices	1

Download License...

Email License...

Rehost license...

Rehost license from failed device(RMA)...

Get device information...

Si vous ne voyez pas le périphérique dans votre profil CCO, le clic « ajoutent des périphériques » et ajoutent le périphérique à votre profil CCO.

Initiate a Rehost ?

On this page, you can transfer specific licenses from one device to another that were previously registered with your Cisco.com profile or by others in your organization.
How do I ...

1. Specify License Source | 2. Specify Target & Options | 3. Review

Source Device Selection

Select the product type: Device Credential

Credentials:

```

/hwErFI054lz4DSfPdWUeiBrGziv9/D9fIK6NZ2
/1vOePYZTRehZlUkOJPlEzWi8l7qRKZiBcHLXonc95qO1w==</CIPHER_DATA>
</CORE_DATA><SIGNATURE_INFO
encoding="BASE64">AAEAAgALAAAsAVAECAQnwYWA7F1UKowpIFYRGInxVEf2ThwAA
AAAAAAAAAAAAABImmNxd3wI3ESvX6TCYfl8ffm9kRCY+zaQAc3leY0iCVh5/4qa2t4Ns1i
S+icrxrw==</SIGNATURE_INFO></CONTENT><CISCO_WT_REHOST_ARTIFACT>
<CISCO_WT_ARTIFACTS>
  
```


OK Cancel

Après avoir ajouté le périphérique, vous verrez le permis associé dans la page Web.

Étape 2.1 Spécifiez la source pour le transfert de permis

Sélectionnez le permis que vous voulez transférer :

Remplissez zone de texte de laisser-passer de périphérique que vous avez obtenu dans l'étape 2.

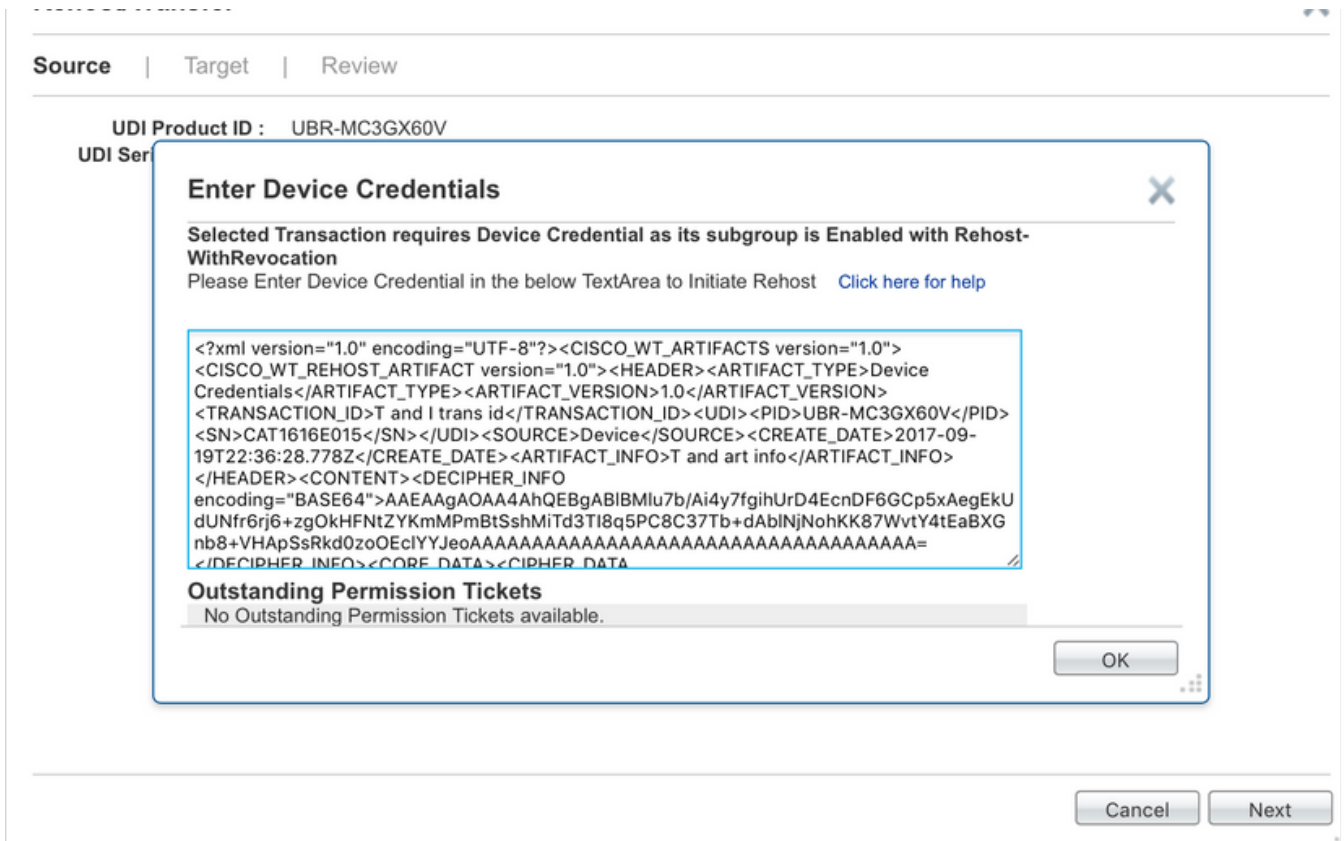


Clic « ensuite »

Étape 2.2 Spécifiez la cible pour le transfert de permis

Dans la « quantité à assigner », remplissez dedans permis vous compte veulent transférer du linecard de source.

Dans cet exemple, il y a les permis 72DSX60US pour le subslot 8/1. Nous transférerons les permis 2DSx2US vers le subslot 8/0. Après avoir transféré, les permis 70DSx58US resteront sur le subslot 8/1.

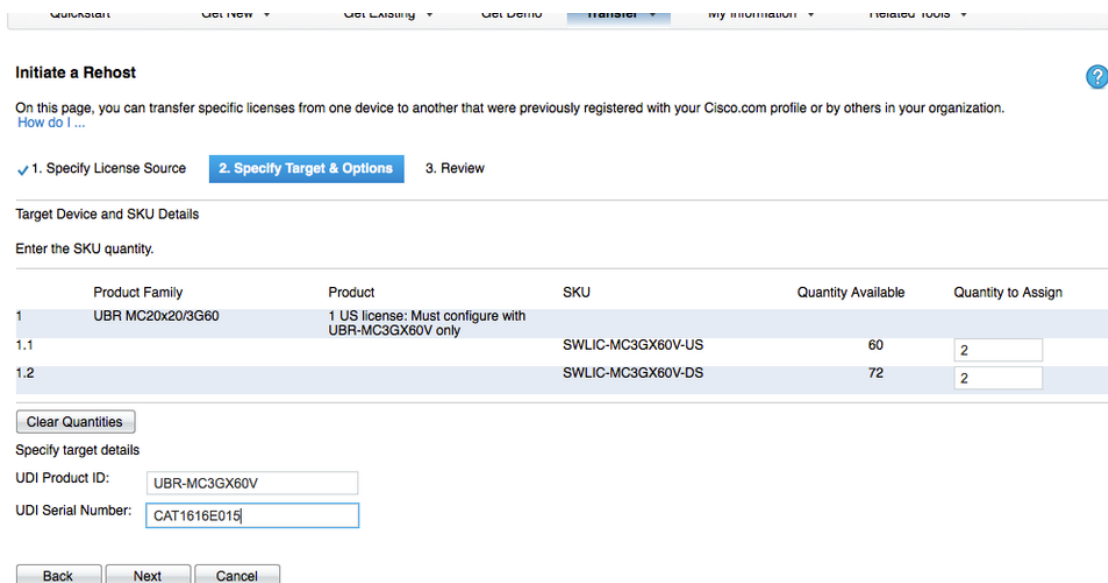

Clic « ensuite »

Étape 2.3 Générez le ticket d'autorisation pour le transfert de permis

Initiate a Rehost ?

On this page, you can transfer specific licenses from one device to another that were previously registered with your Cisco.com profile or by others in your organization.
[How do I ...](#)

✓ 1. Specify License Source ✓ 2. Specify Target & Options **3. Review**

	Serial Number	Product ID
1 Source	CAT1435E0TZ	UBR-MC3GX60V
Target	CAT1616E015	UBR-MC3GX60V

	Sku Name	Quantity
1.1	SWLIC-MC3GX60V-DS	2
1.2	SWLIC-MC3GX60V-US	2

Your License Key will be emailed within the hour to these email addresses and connected with the specified end user.

* Send To: +

* End User: ✎

* License Agreement: I agree with the Terms of the License [View License Agreement...](#)

Une autorisation a fait tic tac est émise après que vous cliquez sur « soumettez » le bouton. Il obtient envoyé par mail à votre adresse e-mail.

Copiez le fichier de licence de ticket d'autorisation, de votre email, sur CMTS utilisant le TFTP ou tous les autres moyens disponibles :

```
ubr10012-1#copy tftp://10.66.94.155/CAT1435E0TZ_20130704171351238.lic disk0:
```

```
Destination filename [CAT1435E0TZ_20130704171351238.lic]?
```

```
Accessing tftp://10.66.94.155/CAT1435E0TZ_20130704171351238.lic...
```

```
Loading CAT1435E0TZ_20130704171351238.lic from 10.66.94.155 (via GigabitEthernet1/1/0): !
```

```
[OK - 8872 bytes]
```

Étape 3 : Retirez le permis sur la source LC

Employez ce ticket d'autorisation pour commencer le processus de rehost à l'aide des commandes Cisco IOS.

Appliquez le ticket d'autorisations au périphérique de source à l'aide de la commande de licence revoke.

Le périphérique de source fournit alors un ticket de rehost indiquant la preuve de la révocation. Un permis de délai de grâce de soixante-jour est également installé sur le périphérique d'accorder assez de temps de transférer les permis vers le périphérique de destination.

Le ticket de Rehost sera utilisé pour générer le nouveau fichier de licence pour la cible.

Au cas où vous perdriez le ticket de rehost (« **disk0:rt** » dans ce cas), vous pouvez répéter la procédure ci-dessus de « license revoke » pour obtenir le ticket de rehost.

```
ubr10012-1#license revoke disk0:CAT1435E0TZ_20130704171351238.lic disk0:rt ? Following Permanent license(s) will be revoked from this device Feature Name: DS_License : Count = 72 Feature Name: US_License : Count = 60 Following Permanent license(s) will be installed on this device Feature Name: US_License : Count = 58 Feature Name: DS_License : Count = 70 Following Extension license(s) will be installed on this device Feature Name: US_License : Count = 60 Feature Name: DS_License : Count = 72 PLEASE READ THE FOLLOWING TERMS CAREFULLY. INSTALLING THE LICENSE OR LICENSE KEY PROVIDED FOR ANY CISCO PRODUCT FEATURE OR USING SUCH PRODUCT FEATURE CONSTITUTES YOUR FULL ACCEPTANCE OF THE FOLLOWING TERMS. YOU MUST NOT PROCEED FURTHER IF YOU ARE NOT WILLING TO BE BOUND BY ALL THE TERMS SET FORTH HEREIN. You hereby acknowledge and agree that the product
```

feature license is terminable and that the product feature enabled by such license may be shut down or terminated by Cisco after expiration of the applicable term of the license (e.g., 30-day trial period). Cisco reserves the right to terminate or shut down any such product feature electronically or by any other means available. While alerts or such messages may be provided, it is your sole responsibility to monitor your terminable usage of any product feature enabled by the license and to ensure that your systems and networks are prepared for the shut down of the product feature. You acknowledge and agree that Cisco will not have any liability whatsoever for any damages, including, but not limited to, direct, indirect, special, or consequential damages related to any product feature being shutdown or terminated. By clicking the "accept" button or typing "yes" you are indicating you have read and agree to be bound by all the terms provided herein. ACCEPT? (yes/[no]): yes Rehost ticket saved to disk0:rt ubr10012-1#show license detail subslot 8/1 Index: 1 Feature: DS_License Version: 1.0 License Type: Evaluation License State: Active, In Use Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 3 days Expiry date: Sep 02 2013 06:41:34 License Count: 72/72/0 (Active/In-use/Violation) License Priority: High Store Index: 3 Store Name: Primary License Storage Index: 2 Feature: DS_License Version: 1.0 License Type: Permanent License State: Inactive License Count: 70/0/0 (Active/In-use/Violation) License Priority: Medium Store Index: 1 Store Name: Primary License Storage Index: 3 Feature: DS_License Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 1 week 2 days License Count: 72/0/0 (Active/In-use/Violation) License Priority: Low Store Index: 1 Store Name: Evaluation License Storage Index: 4 Feature: US_License Version: 1.0 License Type: Evaluation License State: Active, In Use --More-- % RPC failed to slot 17????????? ?????????? Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 3 days Expiry date: Sep 02 2013 06:46:34 License Count: 60/60/0 (Active/In-use/Violation) License Priority: High Store Index: 2 Store Name: Primary License Storage Index: 5 Feature: US_License Version: 1.0 License Type: Permanent License State: Inactive License Count: 58/0/0 (Active/In-use/Violation) License Priority: Medium Store Index: 0 Store Name: Primary License Storage Index: 6 Feature: US_License Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days License Count: 60/0/0 (Active/In-use/Violation) License Priority: Low Store Index: 0 Store Name: Evaluation License Storage ubr10012-1#

Étape 4 : Obtenez le nouveau permis pour la cible LC sur le portail de permis

Entrez dans le ticket de rehost dans l'outil portail de transfert de permis en choisissant les « permis de périphériques > de mouvement > se terminent le rehost sécurisé... » avec le périphérique de destination UDI. Référez-vous à l'image ci-dessous :

The screenshot shows a web interface with four main tabs: 'PAKs or Tokens', 'Licenses', 'Devices', and 'Transactions History'. Under the 'Licenses' tab, there are four sub-sections: 'Get Licenses', 'Move Licenses', 'Add Devices', and 'Download Licenses'. A table displays license information with columns for 'Device', 'UDI Serial', and 'UDI Product'. A context menu is open over the table, showing options: 'Rehost selected licenses...', 'Rehost from failed device(RMA)...', 'Complete secure rehost...' (highlighted in blue), and 'Share licenses...' with a right-pointing arrow.

Extrayez le texte du ticket de Rehost :

```
ubr10012-1#more disk0:rt <?xml version="1.0" encoding="UTF-8"?><CISCO_WT_ARTIFACTS
version="1.0"><CISCO_WT_REHOST_ARTIFACT version="1.0"><HEADER><ARTIFACT_TYPE>Rehost
Artifact</ARTIFACT_TYPE><ARTIFACT_VERSION>1.0</ARTIFACT_VERSION><TRANSACTION_ID>00DD93AAAC</TRAN
SACTION_ID><UDI><PID>UBR-
MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Device</SOURCE><CREATE_DATE>2013-07-
04T13:41:34.151Z</CREATE_DATE><CISCO_REHOST_CHANGES><CISCO_REHOST_ADD><CISCO_WT_LICENSE
```

version="1.0"><FEATURE_NAME>US_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2013-07-
05T00:13:44.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">v/mLxNULGRGMruR/vu09b2lRd2w=</LICENSE_LINE_HASH><TYPE>EXTENSION</TYPE><EXPIRATIO
N><DAYS>60</DAYS></EXPIRATION><EULA>YES</EULA><COUNT>60</COUNT></CISCO_WT_LICENSE></CISCO_REHOST
_ADD><CISCO_REHOST_ADD><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>DS_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2013-07-
05T00:13:44.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">vXiItxKb5jUhxKsJvOsdobszcyg=</LICENSE_LINE_HASH><TYPE>EXTENSION</TYPE><EXPIRATIO
N><DAYS>60</DAYS></EXPIRATION><EULA>YES</EULA><COUNT>72</COUNT></CISCO_WT_LICENSE></CISCO_REHOST
_ADD><CISCO_REHOST_REMOVE><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>DS_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2010-11-
25T07:51:48.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">GG9Lxrd1VJd0ihBN8FxbiV+y4f0=</LICENSE_LINE_HASH><TYPE>PERMANENT</TYPE><COUNT>72<
/COUNT></CISCO_WT_LICENSE></CISCO_REHOST_REMOVE><CISCO_REHOST_REMOVE><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>US_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2010-11-
25T07:52:01.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">djuYPaGEO/YcP/jdZdLBIpERW8=</LICENSE_LINE_HASH><TYPE>PERMANENT</TYPE><COUNT>60<
/COUNT></CISCO_WT_LICENSE></CISCO_REHOST_REMOVE><CISCO_REHOST_ADD><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>US_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2013-07-
05T00:13:44.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">Z16GLxkzY5soZX+lff80dXud70Q=</LICENSE_LINE_HASH><TYPE>PERMANENT</TYPE><COUNT>58<
/COUNT></CISCO_WT_LICENSE></CISCO_REHOST_ADD><CISCO_REHOST_ADD><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>DS_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2013-07-
05T00:13:44.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">/6XdchgOaVgYv9HFcDUtsuzqMDY=</LICENSE_LINE_HASH><TYPE>PERMANENT</TYPE><COUNT>70<
/COUNT></CISCO_WT_LICENSE></CISCO_REHOST_ADD></CISCO_REHOST_CHANGES></HEADER><CONTENT><DECIPHER_
INFO
encoding="BASE64">AAEAAGAOAA4AhQEBgABlBmH/Q5r7IwMdRbaS/JAFyDQEKgWqkgLtrFwFdZa1cKxv3eZF/WVGvcBUBc
WkYMB5ULk/RAA0BkVdecbCoHbpe2LNaTVbI1zBAKW/B6iPNqIwIbGzfUTNsFkV3hKtVPBayWiG4boAAAAAAAAAAAAAAAAA
AAAAAAAAAAAAAAAAA=</DECIPHER_INFO><CORE_DATA><CIPHER_DATA
encoding="BASE64">AAEAAGAPAA8RtAAPABAanu6WfSp4fjmEfsILXTPN3nG/7QCtE2Saa+L9N3qAiqCF5QTlorKYqN8NTk
BZnYdSoDs003+n0Ek9c5kzTzxnbtK2Qw+qtbtAgS4L5ZwgM1WC5v8+muTuyAFefMglgXuG6rsoosn+7vkvaF02Au2I+wLvXg
Tl9BYVMxrZixyk+aZYWL32z6GHF2P013xXLQk+nPovyB9Hy7/o8xBaVDZ+zYb2hUIB8osfvyqyJP0S4u9V4UWr22z2Vx1s
+GBw528i/tf3xB1+c3DtAWQfcAaPk5WPuB+KEYBjvhs/uSXqxWaQpDKxvQow5Im5+js4od5/Whk0cq+OBLEXDGG7eubr+ra
azeP+7ULUN+zSY5yCNOe0wfJv1c4n/bQaAAX8a38+KzKndJL8cI7LkyUgNxiv1KugcaQYjaDstiWxanQ7ok87eVNMCTsck2Gq
Uxfow4n1KWYDTW6ZOA3LzXwF+9uJZNzSTifbFrwE5r1sylNPGbtLD0AmHpfKPAzTuXadjrJoMLNwc+w52TK25dHhrRqWn4Pc
fwj5ceOhovPa6+XtsiTP+x/63xRf+OBi5iihoCBAUm+mhn6xy2uHDIiPK1AeY/no7E6Cyh7QS9gP9wFyGyBJVq7n7qmGJG
ctdDZkTl9Q34RUDycvvrtrQnyf3nbOL3Nox5PxY7zomxP2LldJ7A3+EsXFE06aw/c4Y9Ggb1g1Gfb6IAM9/HZwZh4fYWWvC
LoZDl1lCiBTVWlFwIGX49WTZqp9A//EMyOxcmEbbPEBIyifID19fRvJecVK8q39MsDY+V1R/li12idGFJtiU1hLUQnoPYRip
fpdSo4P5T+QxT6GIBSstXy55D1WLtEalcw18o9h6XLlnUySTMZBmHMH1MzevOgKRTaxJfMlHbTKiU11NboVdbUKclc0PPEy
ely9XX19Z0LlTYNazAe4wbnxouDbsQ99WuxYpPr8TcrD+ab8vKX3DUFxu+pyznPVzcymlTlkW2ZtsFzk4VjqU3xHBaZhhz2R
bdQckwlnkBB9+9e4eZ6wVOC29pVZBrBA8mh6Bt7H3dwj1LJNmpdegeZTgnr7+dHbATppbVeFfZe06wJ1jmM/EzRs/7/1mA01
uXUd6WUSjsyzUTIEyFtMVwfb1un9uyMzoSzQbCerCz3vHQdi/dy8iQbXwGyJPKhjHhbBjiKN6+plUXHzRGvr0r09v/kIdTLn
fkBFgXPOoCRIuUmbUZ/ULimzibTf0PfqwQ98r42dQwXgN4UPybKoR6/pQcPX287GVsB/5zpIvWR9544B+1Dvo+cCeuVA/60W
J3UFvqoCA9YNM6b+B6A4mZvBT78S+j+r+prNfMBzhnyD9OyOOpY5JocOEJfkdMsVDT78G+acfeqzRm76Ny4N4YbKVI4kUA06
PS0fQrsvK1hHUAu00yluVnqaD3OX/SH8C97HCN1hmXUydz9ZfabAq49jairvba7fLHyHFY56RaQUhjck08v70CXyy+3zVWF9
Ce6YmAAjeTqVIE4Q6hZqXQbvLOuB+YHoSVaUIfQ3LaJDi9phIrDlfpL9bYaCDDDCgarbj8Xh/CT+6qit1bXikoVSMlJ/xHD
EP9FFbL9oQQ0U90I4J6Hqcn/f0SD4wjiS86Rz6+EE6kNNG00FhVxQZQsZfABsHy6PFXF4sH2lr333ILEiAxLypwUiANfkTU
ulf94rpdMKubQbPtjah1BnS1tCka3ANK5XomDcmJ379K119zHs+s4B+I6/Dbb4kvZKUA++UPyzu/AxhlXOXGodRI419lvjtD
+rr3/kIJo0FkX3b1sx5qIdxgNsZmAG3ijUIxcMqMensJ7+/1zV7GCGfM9002E9BFqCvLzat0MKRKPu2aWM+LpOXvr9ybWjn0
Y4hIDR/3tnAYFo85ZAHtDOOdyEHMaqx38fZuFHQ0vGKA+XZzhZy2qDG1SsAzN39V1DsDThkbgm5hM9seUHLvWin9QEsFzpe
bI6ENWIEz8vhlYwtfJZ5v/8KeBydSeTvYr9lr0+02zSNfdrMmguldG104ZQ60358AnR7EBtN57WAYCrNjswyFySKSKQtHiZh
KVLXMxiBoXdwJcVquT8sLjk60iRtPtoboTRVHNCDBTardMonhHiy5ZY6DIKhg7DN/1noOAPwNY8K4BZhtPyzb3P9BGg+tAiyt
Tzm0ulz/ktAweled7IU311RvS7wR3Wvxh7WTwiQG8e4fj+FiOtZ90XBnBabl+7V53KHbcgXRC4w3wJmH804Gwe2UDVuyARFE
6uSbeZvf3FQitViC03h/gnGcvWtV6ghsOzwm7spxz2VNORK1KZRn+FmDPrTPBJeu6YN+VAFXVc27fJ/10phJiRdomUW/VJgG
YGXZxC0wAZOm9Mdht4W/nSsupcZQROiOB4EPP06jnj6Ij5iNowSjgDFQ0rIz9wTe06qvI33uunyq/jih8+g7qqwpzXncc70
gQ2hAO2Kynp4GjX5aUALbxs00diMjT2JUAH2aMoi7ZAqE9izk8WYpEzWdsD1GALfIedJEFQvUDFFewZDxEA4+JxhHT0ybuK
j8KCZKMT0jhIOG6UgMuyR0rw10/YAC3RSjVDCYieW2MpirnFJDS5TbQ6ua8YbVpdJn+b4wTfsl29fv/mSPj3mZQCsF9k7M+

72Jy2b29Bqz/G0ZJB6+7+hXQRYVzB8XciS9bnPBwMt3JSKugotK65dqUTVoE9c+kPkmZ/hAUkST6FukqiZRE4mJYmgbJJyXM
YcHJkv5HrUaJ8xfeB8+gJT4OgbhaV2X6W2Yl22vVeV+epGPxU8VzBdQcltDoE6TU5YPqV8Pb7J/Z7KHF+QkcClq9lZKCV7ob
9H4xvuBKsSGHS0Hki3/gzgrkM8fvaxWDC3RJK7Cl1qd84Yl7DxToCSmaFWymKaoRvK+iYxs1E6k4FdKrVobLvdIm+jZTcfuW
BD389nBuGmiDfVwIf5/DPuTJpXbppPrCjCZzwwUJf1K+ZjNjO9HLonYomtP49T45+0uFBfd8w63rgTtx39N3iteJkEievSR
hkyB4ziL/gl6oB9ssb/OYEMJoc+BIjuxLExyIonl4qN/xlB2Vm7AcfH6uOagaT/qTm+xsEe5OZDivuv4cr2zKdbQUiVXky1k
bfZGJdOR41kh2eOeWYMKbHI9UipZ3mEgknBm+ZE6AUwYlRbZP3JrxUfNoXI73zIkCVZidzBYPVekCBHxTRWnbXXqxz4kKn0
TOigchAdyhOgfsE1sgWDCtRBreXHP3qT5syFSA7pydhTspK3BLMiWSuRzW9uH0bMJF8LURvnJD4hI1D1hLmFP4TDOv5bo2Mj
CgQmUSKaMfBulXdB/OVawWrmdqXU/W4JIQUt96JNIC14BIZXtM2e8zWaziw4g83F8ND7v3fIFrvaReQL7K7Q+pZn7BbIPNG6
A5pMSJ79zChz+Da8JxZ5hxPhxjzt+SpXZ3Tz0SLP49B6WL6dtiOcbIh854ekEDQRHwtDUMMtayfdIBsureERzmUDLXHT73V
/+PIFMEkxwv6dDsr81qbsOyMT47DcCrcJwEvxxWDS2Px3OyuzA79Feps1vmKoudhm8Ik4zXujfbDNdf00uV/P001EQASUiT
pllm/1/YQ/3fdOnxtm823/n+FXksa4GX0ji+9qr7GmsEDo/sxPql0p4Ha+epmoYmiTKAJW7i9r+XLMTdpMXKriVgKIx6qydB
C5TGcKomeaAKVULkvHvCF801/NyUdaSVg2cMcm7WWarOrwHcjF7Wy/KccbXocgirYjgzXlU2REza+RRln+xy802IQDDaNBk
7ED6W1Dy9MKPknJc6vTJ+kf1bap0ag+CmOGdGsgWJVRIMEk7UBJagChpP+eLPTmk6s7du9WLMVegBRMqIttqHhVodZt01J
Q1HGZfDvrGndd0V4kqDB0p28C0Y+Jci/V09waVfWHXsowL0hFXerFRYNNRvToXIdXug3uwKgVsl7QIKdWz3cKDbOCbbzR0V1
/YdewkOBWYbqxZ6dIeGCKmYnXk2KJhkxz1QkkEw5JLvpYIPcR70iLVWr/nEH+CtWCG0fRiWVRPDFuCXU2Hrmq7hBv2c9+Fi6
V2TmWXHxrMBS3CflzTo06V1bLOpt1G75b76D/ntzaCbco30/UtGkRvOZhj3pwUd/oj4exSQ9SJrpashlYmGL9nAVzOMoI3
p34LOyL3Y165zEEDuGQcsVd0ESxHf+81+7Pws9Y6+p5V70+vi10Jp4ia0BOgtDb2gic/gpxeKqCIyK6qaRwJ6kIJRoFuaoVb
xBiZlU4Xmb818bMm/zQDonWOZFHvjtYukuqKdnbf20o2CY+Sf6HV3IMcrTOMLL9xdeJbHJZHC7Y/PU7w4JOT6boDHFHv5Y
q2je90Dn5HzU/3wrXpvmLwbixVSDhphcdCEvKE8zUZuM0YHnn5uGn0YECiiQX4r2i7dBy7elocqeMFEMQLVoOS0jt0tZgO/
Is/J8hXHV8xkRCSzVUYJBTRDb22vmpv5rbR805KQ8sBfXvILHbXQaj8Clu9Th6nRKbcEqGsDR1BQ941m4/aMyZe891tqe1l
uuJuIs7qXf00GKTBl+SliWw0kzjI5z8vRobFTNGzifo/7qRCjad2+xf3dyR4zswJ28GZcUee1ni3DWX/devKhpi4F1a+fTv1
EquDrkrYZdTAaxvGBjqqWPZCKK/32X1GTlWcBv9xNqSHY31IVME02FFWglK/519RK5WAvB00a0oii7QYXiUQ3S5Znp2YUvRy
e7jGq12zhixzorOD9W1DzGrVLjPfmWlaQ/hhv3SnCLrJ/Z45FLYJzWk6lQDGRan21d6MYnUgzwx033+Zx4K159WgoGapGEfo
Qn56eolqE5ehaPCCWX09pJt1gTjtRR8e47iEX/fZ7rkyUfWxqBlBYyGP14WTmv1Q7N3VqyT6UIYj2Y028/SCUDKlhhKqPRi
wvJo3Hnb3jIokILNZnefu5tjFpU5quPV6Y2C1e1LfgUoHUIHTW/ap5XlSbiu3uLl/QpmmFPmFeJjJ3axOAYVo0s7pRmIWRo9
EvVy7LFEELHnZoSyR2jIVlvx0wCCwB/tLPDDi9twcOERdoMM+WFPCAZZEeBI7LfzZYT6DjCmGbdg2C2wdoVNqENIT2P61nV
zQIJTEJf1KtV7rVWHBaS9CesJxlXlnc1mJU6+lgFm9+a8QhEQvYx/4U4B54EYiXH2P3dxNhQbzemdROIluMjM3mF0ZK9zbWn
PTuEN87JTrQ1+UwXHKsA/zPGROGjmCdYqIDeVm76HUDkgm7oQ0c4qD88LNKzc0UbkzBwJwTp9xymawjX9AnUe3hOQR1WVN
Lm9D6p4db5JSasUwBuxbB8obn/YLwB1Fi03bVO/tWSEdy/BWG9w6N2NcX4P+I1mmV9tOYOQv741VbuC9YufbNyOzaFWY6qt
exCODtmNbvufIPCYznUbAYWeHzUbgwzAb1EtW6LPwKYpElkRsorXWL4p72NDK49w5kfBsYgWRd5C+/iJvzF9nnh5mBd5bg5l
ZTDiNB/aLdlM7QnkzAKI+42h1wWqBR/nmTfON9cPQY4U8VepkliI2BHoZMW5IeQaRh1D1n0EpIa7hp/yl0Hln1eRJaBxo2Nz
CY8bQN61KVfXM+3/XC8D/M8bYn4zybUf3NmbQy+ES7p/AwrBwhdEhc3biHpKm0TdAdJalkzaH8rOadqsenLWuWXVnHzIWgWb
uuUca5hTWfeAz0CuJAZDme+ETTSihYcfBIZcoMuKfrJvqMdRRLId6w/1LYCCuAogxNTXzDYqjd79uJjNR/n5Mn/D7jOztWd+
5POtDC7g1lqh64zok+hKfropP2fuzU9wUkZqahjMG7/A5/IVGhn7y5k6MLx5IZDYRkxkAzYv0lhoGEOjIpmDowkymZVml2kL
HQOrmmEE+y0TMwu74YyDapxCqguA3MckE6i/PGtpIW9+JhKTW8tgMr7Irv1SsdLIIiO2UVpa0aadEbnAtZP3y2i9YHCTbuJ
8kuBlw8t4mJMYe/ayR8EOw1+90</CIPHER_DATA></CORE_DATA><SIGNATURE_INFO
encoding="BASE64">AAEAAgALAAAsAVAECAQlAYiZn2o1/b/XEYyF3681aOv/kIQAAAAAAAAAAAAAAAAAE/cnMwLdddnDg807K
ZDqj7n5UvftxqDacwXmHnecgM3yfHlctTmyWC01Cdm9Mtt8g==</SIGNATURE_INFO></CONTENT></CISCO_WT_REHOST_A
RTIFACT></CISCO_WT_ARTIFACTS> ubr10012-1#

Étape 4.1 : Écrivez les informations de rehost

Type de produit : « Safenet »

Identité de produit UDI : <Target PID>

Numéro de série UDI : <Target SN>

Dans le domaine « de ticket de Rehost » entrez dans le texte extrait du ticket de Rehost comme ci-dessus.

Cliquez sur alors « ensuite »

Complete Secure Rehost/Transfer



1. Enter Rehost Ticket/Key | 2. Review

Select the Product Type:

Safenet

Enter a Rehost Ticket required to generate the license for the new device.

* UDI Product ID:

* UDI Serial Number:

* Rehost Ticket:

```
<?xml version="1.0" encoding="UTF-8"?><CISCO_WT_ARTIFACTS
version="1.0"><CISCO_WT_REHOST_ARTIFACT version="1.0">
<HEADER><ARTIFACT_TYPE>Device
Credentials</ARTIFACT_TYPE>
<ARTIFACT_VERSION>1.0</ARTIFACT_VERSION>
<TRANSACTION_ID>T and I trans id</TRANSACTION_ID><UDI>
```

Cancel

Next

Étape 4.2 : Générez le fichier de licence pour la cible LC

Le clic « obtenir le permis ». Vous recevrez un fichier de licence par l'email.

Upload Rehost Ticket to Finish Rehost

Use this page to complete the final step of the secure license transfer process. [How do I ...](#)



✓ 1. Enter Rehost Ticket/Key

2. Review

	Serial Number	Product ID
1 Source	CAT1435E0TZ	UBR-MC3GX60V
Target	CAT1616E015	UBR-MC3GX60V

SKU	Quantity	More Information	Feature
1.1 SWLIC-MC3GX60V-DS	2	1 DS license: Must configure with UBR-MC3GX60V only	DS_License
1.2 SWLIC-MC3GX60V-US	2	1 US license: Must configure with UBR-MC3GX60V only	US_License

Your License Key will be emailed within the hour to these email addresses and connected with the specified end user.

*Send To:

daszhang@cisco.com



*End User:

Zhang, Dashuai



*License Agreement:

I agree with the Terms of the License

[View License Agreement...](#)

Back

Get License

Cancel

Étape 5 : Installez le nouveau permis sur la cible LC.

Étape 5.1 : fichier de licence de copie à CMTS

Copiez le fichier de licence de votre email sur un serveur TFTP accessible de l'uBR10K.

Copiez le fichier de licence sur uBR10K du serveur TFTP.

```
ubr10012-1#copy tftp://10.66.94.155/?CAT1616E015_20130704172627009.lic disk0:
```

```
Destination filename [CAT1616E015_20130704172627009.lic]?
```

```
Accessing tftp://10.66.94.155/CAT1616E015_20130704172627009.lic...
```

```
Loading CAT1616E015_20130704172627009.lic from 10.66.94.155 (via GigabitEthernet1/1/0): !
```

```
[OK - 2237 bytes]
```

```
2237 bytes copied in 0.556 secs (4023 bytes/sec)
```

```
ubr10012-1#
```

Étape 5.2 : Vérifiez l'état en cours de permis avant d'installer le nouveau permis sur la cible LC

Vérifiez l'état en cours de permis sur le subslot 8/0 avant d'appliquer le nouveau fichier de licence :

```
ubr10012-1#show license detail subslot 8/0
```

```
Index: 1      Feature: DS_License      Version: 1.0
```

```
License Type: Permanent
```

```
License State: Active, In Use License Count: 60/60/0 (Active/In-use/Violation) License  
Priority: Medium Store Index: 0 Store Name: Primary License Storage Index: 2 Feature: DS_License  
Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4  
days Evaluation period left: 8 weeks 4 days License Count: 72/0/0 (Active/In-use/Violation)
```

```
License Priority: None Store Index: 1 Store Name: Evaluation License Storage Index: 3 Feature:
US_License Version: 1.0 License Type: Permanent License State: Active, In Use License Count:
16/16/0 (Active/In-use/Violation) License Priority: Medium Store Index: 1 Store Name: Primary
License Storage Index: 4 Feature: US_License Version: 1.0 License Type: Evaluation License
State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days
License Count: 60/0/0 (Active/In-use/Violation) ?????????? ?????????? License Priority: None Store
Index: 0 Store Name: Evaluation License Storage ubr10012-1#
```

Étape 5.3 : Installez le nouveau permis sur la cible LC

Installez le nouveau permis :

```
ubr10012-1#license install disk0:CAT1616E015_20130704172627009.lic
```

```
Installing licenses from "disk0:CAT1616E015_20130704172627009.lic"
```

```
Installing...Feature:US_License...Successful:Supported
```

```
Installing...Feature:DS_License...Successful:Supported
```

```
2/2 licenses were successfully installed 0/2 licenses were existing licenses 0/2 licenses were
failed to install
```

Étape 5.4 : Vérifiez l'état de permis après installation

Exécutez la commande de **détail de show license** pour 8/0 après avoir installé le permis 2x2 rehosted. Le compte change à 62/18 :

```
ubr10012-1#????????????????????????????????????????????????????????????????????????????????
8/0      ?????????????????????????????????????????????????????????????????????????????????
```

```
Index: 1      Feature: DS_License                               Version: 1.0
```

```
License Type: Permanent
```

```
License State: Active, In Use License Count: 62/62/0 (Active/In-use/Violation) License
Priority: Medium Store Index: 3 Store Name: Primary License Storage Index: 2 Feature: DS_License
Version: 1.0 License Type: Permanent License State: Inactive License Count: 60/0/0 (Active/In-
use/Violation) License Priority: Medium Store Index: 0 Store Name: Primary License Storage
Index: 3 Feature: DS_License Version: 1.0 License Type: Evaluation License State: Inactive
Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days License Count:
72/0/0 (Active/In-use/Violation) License Priority: None Store Index: 1 Store Name: Evaluation
License Storage Index: 4 Feature: US_License Version: 1.0 License Type: Permanent License State:
Active, In Use License Count: 18/18/0 (Active/In-use/Violation) License Priority: Medium Store
Index: 2 ?????????? ?????????? Store Name: Primary License Storage Index: 5 Feature: US_License
Version: 1.0 License Type: Permanent License State: Inactive License Count: 16/0/0 (Active/In-
use/Violation) License Priority: Medium Store Index: 1 Store Name: Primary License Storage
Index: 6 Feature: US_License Version: 1.0 License Type: Evaluation License State: Inactive
Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days License Count:
60/0/0 (Active/In-use/Violation) License Priority: None Store Index: 0 Store Name: Evaluation
License Storage ubr10012-1#
```