

移除RV34x上不符合要求的Anyconnect許可證

目標

本文檔旨在向您展示如何刪除RV340系列路由器上的「不合規」許可證。

簡介

如果您擁有一台具有AnyConnect許可證的裝置，其許可證顯示為「已註冊」但「不合規」，並且因此不能使用AnyConnect，則此文章適合您。最近，RV340系列路由器於2019年4月26日1.0.3.15發佈了新韌體版本。從該版本開始並繼續轉發，您無需購買AnyConnect伺服器許可證即可配置路由器上的AnyConnect。您只會對客戶端許可證收取費用。

要檢視有關RV340系列路由器的AnyConnect許可的詳細資訊，請按一下[此處](#)。

適用裝置

RV340系列

將韌體更新為1.0.3.15及更高版本

步驟1.要刪除「不合規」，您需要將韌體更新為1.0.3.15版才能使用AnyConnect VPN。請按一下[此處](#)訪問RV34x系列的下載頁面。應開啟*Software Download*頁面。

Software Download



Downloads Home / Routers / Small Business Routers / Small Business RV Series Routers / RV340 Dual WAN Gigabit VPN Router / Small Business Router Firmware- 1.0.03.15

RV340 Dual WAN Gigabit VPN Router

Release 1.0.03.15

Related Links and Documentation
[Release Notes and OSD for RV34x Routers v1.0.03.15](#)

▲ My Notifications

File Information	Release Date	Size
Firmware image for Cisco RV340, RV340W, RV345, and RV345P Release 1.0.03.15 RV34X-v1.0.03.15-2019-04-05-02-25-51-AM.img	26-Apr-2019	69.64 MB

步驟2.選擇最新版本，然後按一下Download圖示開始將最新韌體版本下載到您的PC。

在本示例中，我們將下載韌體版本1.0.3.15。

Software Download

Downloads Home / Routers / Small Business Routers / Small Business RV Series Routers / RV340 Dual WAN Gigabit VPN Router / Small Business Router Firmware- 1.0.03.15

[Expand All](#) [Collapse All](#)
Latest Release **1**
1.0.03.15
All Release
1.0

RV340 Dual WAN Gigabit VPN Router

Release 1.0.03.15


[My Notifications](#)

[Related Links and Documentation](#)
[Release Notes and OSD for RV34x Routers v1.0.03.15](#)

File Information	Release Date	Size
Firmware image for Cisco RV340, RV340W, RV345, and RV345P Release 1.0.03.15 RV34X-v1.0.03.15-2019-04-05-02-25-51-AM.img	26-Apr-2019	69.64 MB

2
[↓](#)


步驟3. 登入路由器的Web組態頁面。

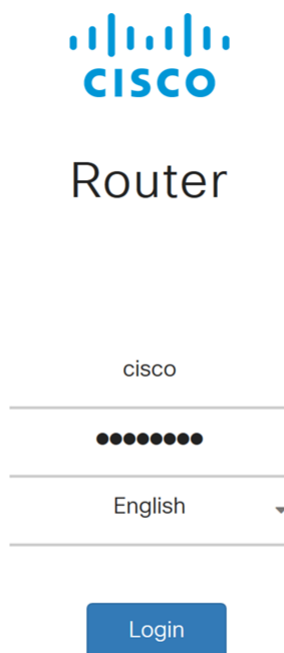

The image shows the Cisco Router login page. At the top is the Cisco logo. Below it, the word "Router" is displayed. The login form consists of a text input field containing "cisco", a password field with seven dots, a language dropdown menu set to "English", and a blue "Login" button.

©2017-2019 Cisco Systems, Inc. All rights reserved.
Cisco, the Cisco logo, and Cisco Systems are registered trademarks of Cisco Systems, Inc. and/or its affiliates in the United States and certain other countries.


步驟4. 導覽至管理>檔案管理。

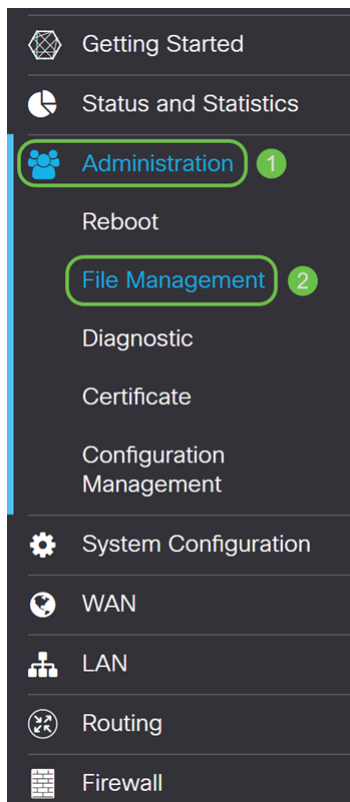

步驟5. 向下滾動到 *Manual Upgrade* 部分，為 **File Type** 選擇 **Firmware Image**。

Manual Upgrade

File Type: Firmware Image Signature File USB Dongle Driver Language File

Upgrade From: cisco.com PC USB 


Reset all configurations/setting to factory defaults

The device will be automatically rebooted after the upgrade is complete.

步驟6. 在 *Upgrade From* 欄位中選擇 **PC**。

Manual Upgrade

File Type: Firmware Image Signature File USB Dongle Driver Language File

Upgrade From: cisco.com PC USB 

Firmware Image Format: *.img (Maximum size: 100MB)

No file is selected


Reset all configurations/setting to factory defaults

The device will be automatically rebooted after the upgrade is complete.

步驟7. 按一下 **Browse...** 選擇要使用的韌體映像。

Manual Upgrade

File Type: Firmware Image Signature File USB Dongle Driver Language File

Upgrade From: cisco.com PC USB 

Firmware Image Format: *.img (Maximum size: 100MB)


No file is selected

Reset all configurations/setting to factory defaults

The device will be automatically rebooted after the upgrade is complete.


步驟8.出現 *Open* 視窗。導航到RV34x韌體映像所在的資料夾。

在我們的示例中，RV34x韌體位於 *Downloads* 資料夾中。

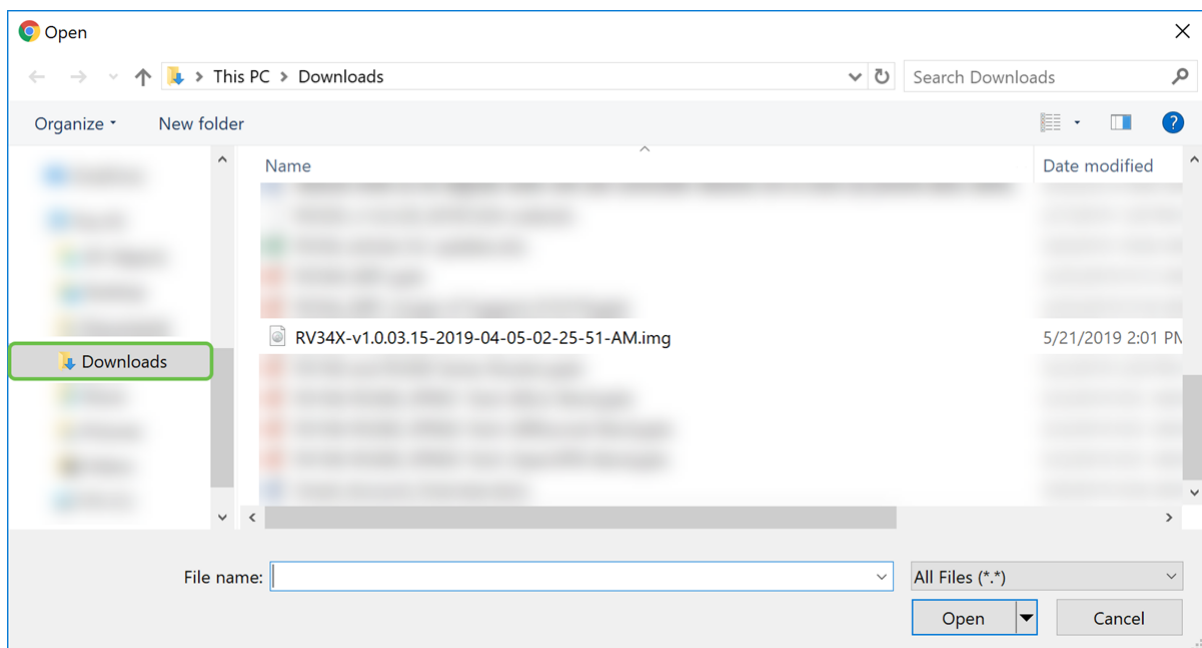


步驟9.選擇韌體映像，然後按一下 *Open*。

在本示例中，我們選擇了 **RV34-v1.0.03.15-2019-04-05-02-25-51-AM.img**。

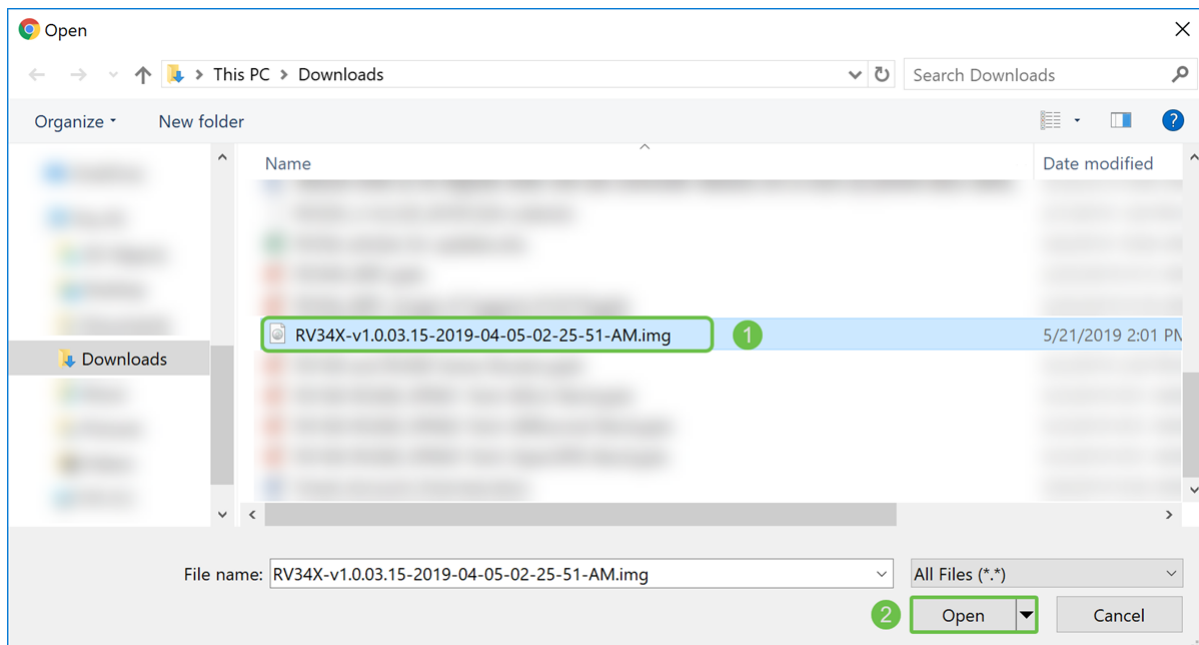


步驟10.按一下**Upgrade**。

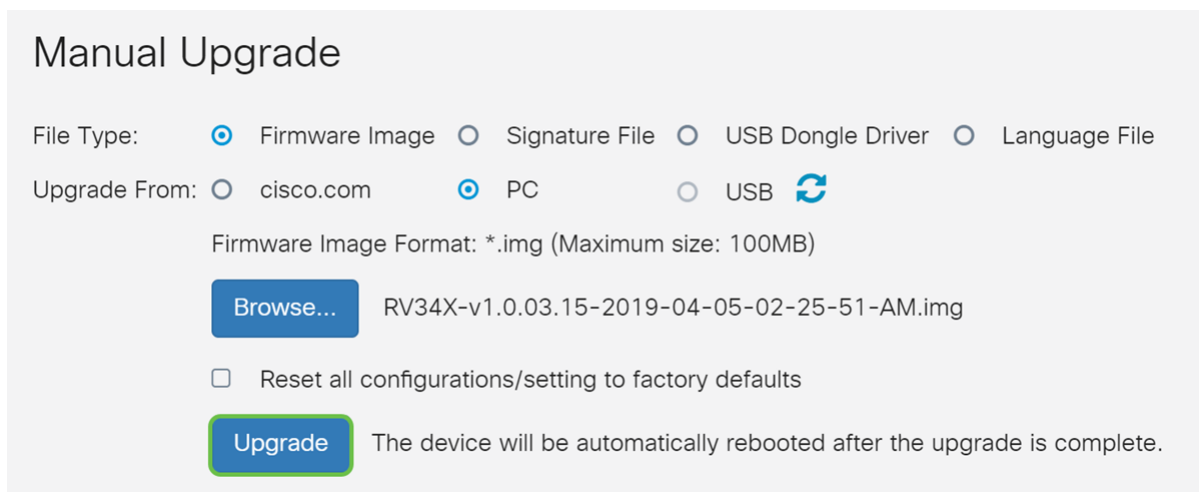

附註：升級完成後，裝置將自動重新啟動。

步驟11.可能會出現一個確認框，詢問「Are you sure you want to upgrade the firmware now?」 按一下「**Yes**」開始升級。

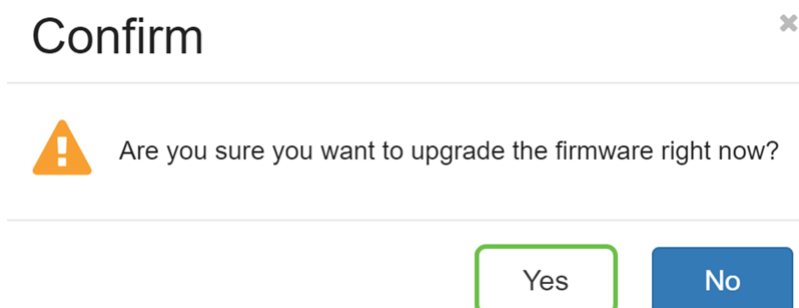

附註：在韌體升級期間，網路流量暫停。此過程需要幾分鐘時間。升級完成之前，請勿關閉電源、重置、關閉視窗或斷開電纜。

結論

現在應刪除「不合規」狀態。您應該能夠在路由器上配置AnyConnect。

要瞭解如何在RV34x系列路由器上配置AnyConnect VPN連線，請按一下[此處](#)。

以下是RV34x上AnyConnect VPN的3分鐘影片：

檢視本文的影片版本.....

[按一下此處檢視思科的其他技術對話](#)

檢視與本文相關的影片.....

[按一下此處檢視思科的其他技術對話](#)